

**SUN VALLEY** (A20) 7 S UTC-7 N35°00.34' W114°33.90'

PHOENIX

725 B NOTAM FILE PRC

L-7E

**RWY 18-36:** H3700X42 (ASPH) LIRL**RWY 18:** Road.**RWY 36:** NSTD—GA 3.0°. Rgt tfc.**SERVICE:** **FUEL** 100LL **LGT** NSTD VASI (red and white lghts like a PAPI) in a single unit located on the left side of rwy set at 3°. **ACTIVATE** LIRL Rwy 18-36—122.975.**AIRPORT REMARKS:** Attended 1400-0100Z. 24 hr self svc 100LL with major credit card. All acft tfc stay east of arpt. No straight-in apch and departures. Rwy 18-36 + 2-6' brush 35' from rwy centerline entire length east side. Shallow drainage swale 25' in length located 40' right of Rwy 36 for entire rwy length. Rwy 18-36 NSTD markings, length and width. Acft tie down fee \$7.00 per night.**AIRPORT MANAGER:** 760-315-5096**COMMUNICATIONS:** CTAF/JUNICOM 122.975**CLEARANCE DELIVERY PHONE:** For CD ctc Los Angeles ARTCC at 661-575-2079.**RADIO AIDS TO NAVIGATION:** NOTAM FILE EED.**NEEDLES (H) (H) VORTAC** 115.2 EED Chan 99 N34°45.9' W114°28.45' 328° 15.0 NM to fld. 620/15E.

VORTAC unusable:

100°-130° byd 27 NM blo 6,600'

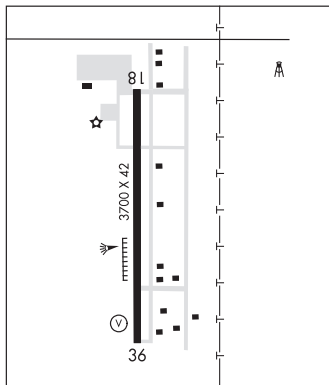
170°-220° byd 20 NM blo 5,800'

220°-280° byd 35 NM blo 6,800'

TACAN AZIMUTH &amp; DME unusable:

165°-220° byd 20 NM blo 8,000'

165°-220° byd 30 NM blo 12,000'

**CASA GRANDE MUNI** (CGZ)(KCGZ) 5 N UTC-7 N32°57.29' W111°46.01'

PHOENIX

1464 B TPA—2502(1038) NOTAM FILE CGZ MON Airport

H-4J, L-5B, A

**RWY 05-23:** H5200X100 (ASPH) S-18.5, D-65, 2S-82 MIRL

IAF

0.3% up NE

**RWY 05:** MALSR. PAPI(P4L)—GA 3.0° TCH 40'. Road.**RWY 23:** PAPI(P2L)—GA 3.0° TCH 40'. Road. Rgt tfc.**SERVICE:** S4 **FUEL** 100LL, JET A+ **LGT** **ACTIVATE** MALSR Rwy 05—CTAF.**AIRPORT REMARKS:** Attended 1300-2300Z. Fuel 24 hr credit card svc avbl for 100LL only. Jet A avbl after hrs with \$150 call out fee 520-251-3366. Arpt frequently used for practice inst apchs by trans acft. Parachute Jumping. Service road within primary surface. GPS Rwy 23 - operational necessity only. Holdlines on all twys connecting to the rwy are set at 280' from rwy centerline. Acft taxiing on Twy B be alert to passing acft holding on the connecting twys.**AIRPORT MANAGER:** (520) 421-8625**WEATHER DATA SOURCES:** AWOS-3PT 132.175 (520) 836-3392.**COMMUNICATIONS:** CTAF/JUNICOM 122.7® **ALBUQUERQUE CENTER APP/DEP CON** 125.4**CLEARANCE DELIVERY PHONE:** For CD ctc Albuquerque ARTCC at 505-856-4861.**RADIO AIDS TO NAVIGATION:** NOTAM FILE PRC.**STANFIELD (H) (H) VORTAC** 114.8 TFD Chan 95 N32°53.15' W111°54.52' 048° 8.3 NM to fld. 1316/12E.

ILS 111.15 I-CGZ Rwy 05. Class IA. LOC only unmonitored 0000-1500Z Mon-Fri and 1900-1700Z Sat.

Glide slope unusable for couple apchs blo 1,650' MSL.

