


VORTAC TRV 117.3 Chan 120	APP CRS 157°	Rwy Idg 4755 TDZE 23 Apt Elev 23
---	------------------------	---

VOR/DME RWY 14
TREASURE COAST INTL (FPR)

T When local altimeter setting not received, use Vero Beach altimeter setting and increase all MDA 40 feet; increase S-14 visibility Cats C/D ½ SM; **A** increase Circling visibility Cat C/D ¼ SM. Helicopter visibility reduction below 1 SM NA. Night Landing Rwy 14 NA.

MISSED APPROACH: Climb to 800 then climbing right turn to 2600 on heading 270° and TRV VORTAC R-185 to BIWIK/TRV 9 DME and hold.

ATIS 134.825	PALM BEACH APP CON 132.8	FORT PIERCE TOWER ★ 128.2 (CTAF) 0	GND CON (GCO) 119.55
------------------------	------------------------------------	---	--------------------------------

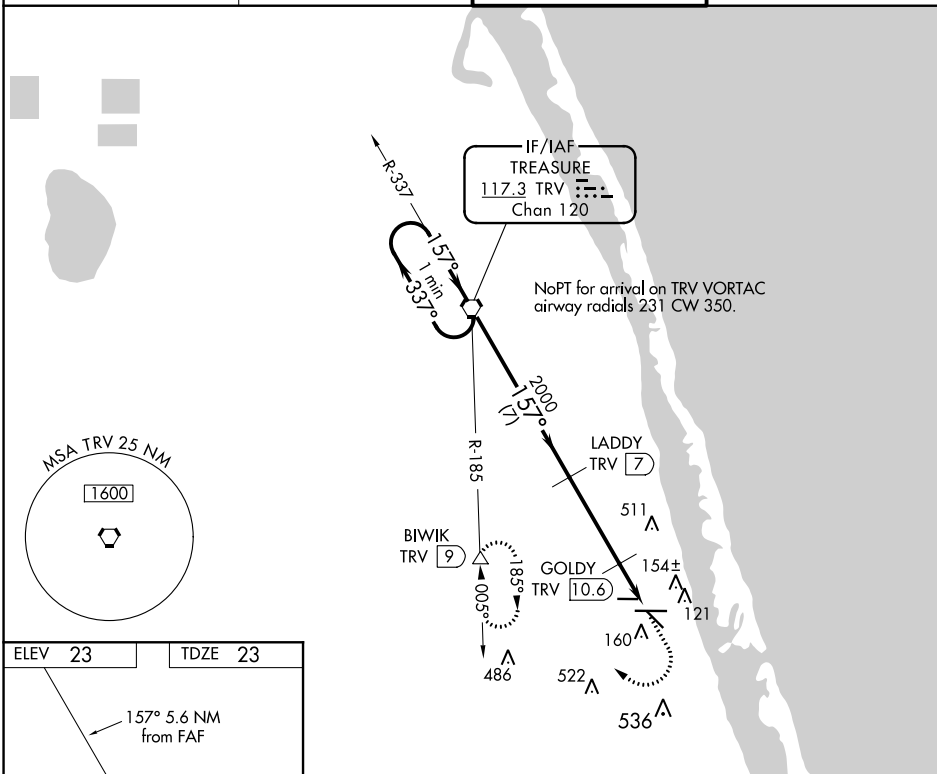

REIL Rwy 10R and 28L
MIRL all Rwy

VGSI and descent angles not coincident (VGSI Angle 3.00/TCH 46).				
CATEGORY	A	B	C	D
S-14	420-1	397 (400-1)	420-1 $\frac{1}{8}$	397 (400-1 $\frac{1}{8}$)
C CIRCLING	460-1 437 (500-1)	480-1 457 (500-1)	880-2 $\frac{1}{2}$ 857 (900-2 $\frac{1}{2}$)	880-2 $\frac{3}{4}$ 857 (900-2 $\frac{3}{4}$)