

GOLDSBORO, NORTH CAROLINA

ILS or LOC Y RWY 26

LOC I-DDX

109.9

APCH CRS

261°

Rwy Idg

11,760

TDZE

109

Arprt Elev

109

AL-169 [USAF]

SEYMOUR JOHNSON AFB

(KGSB)

▼

* When ALS inop, increase RVR to 40 and vis to ¾ mile.

** When ALS inop, increase CAT AB RVR to 55 and vis to 1 mile, CAT CDE RVR to 60 and vis to 1½ miles.

ALSIF-1

A1

MISSED APPROACH: Climb to 2200 via GSB TACAN R-261 to TULME and hold.

ATIS ★

317.625

SEYMOUR JOHNSON APP CON

258°-110°

123.7

290.9

111°-257°

119.7

273.6

SEYMOUR JOHNSON TOWER ★

126.25

370.875

GND CON

138.1

275.8


CLNC DEL

128.025

270.8

*** Circling N of Rwy 8-26 not authorized.

Autopilot coupled approach
NA below 375' MSL.

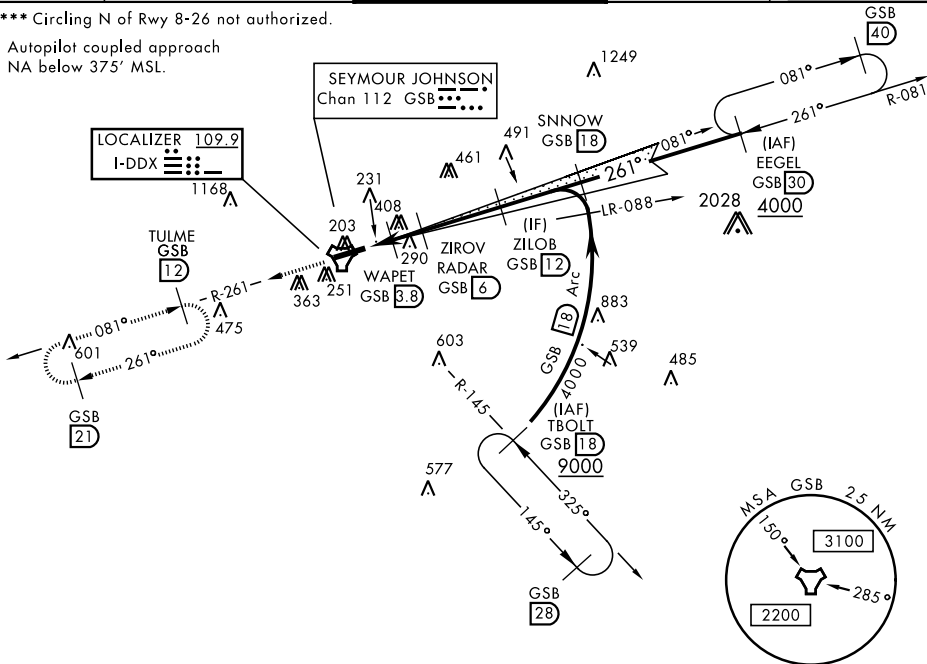

EMERG SAFE ALT 100 NM 3700

[illegible]

GOLDSBORO, NORTH CAROLINA

35°20'N-77°58'W

SEYMOUR JOHNSON AFB (KGSB)

Amdt 8 02DEC21

ILS or LOC Y RWY 26

SE-2, 16 JUN 2022 to 14 JUL 2022

SE-2, 16 JUN 2022 to 14 JUL 2022