


GOLDSBORO, NORTH CAROLINA


TACAN Y RWY 8

TACAN GSB Chan 112	APCH CRS 081°	Rwy Idg 11,760 TDZE 73 Arpt Elev 109	AL-169 [USAF]	SEYMOUR JOHNSON AFB (KGSB)
* When ALS inop, increase CAT AB RVR to 55, vis to 1 mile, CAT CDE vis to 1 3/8 miles. ** Circling N of Rwy 8-26 not authorized.			ALSF-1 	MISSED APPROACH: Climb to 2300 via GSB R-081 to ZILOB and hold.
ATIS ★ 317.625	SEYMOUR JOHNSON APP CON 258°-110° 123.7 290.9 111°-257° 119.7 273.6	SEYMOUR JOHNSON TOWER ★ 126.25 370.875	GND CON 138.1 275.8	CLNC DEL 128.025 270.8

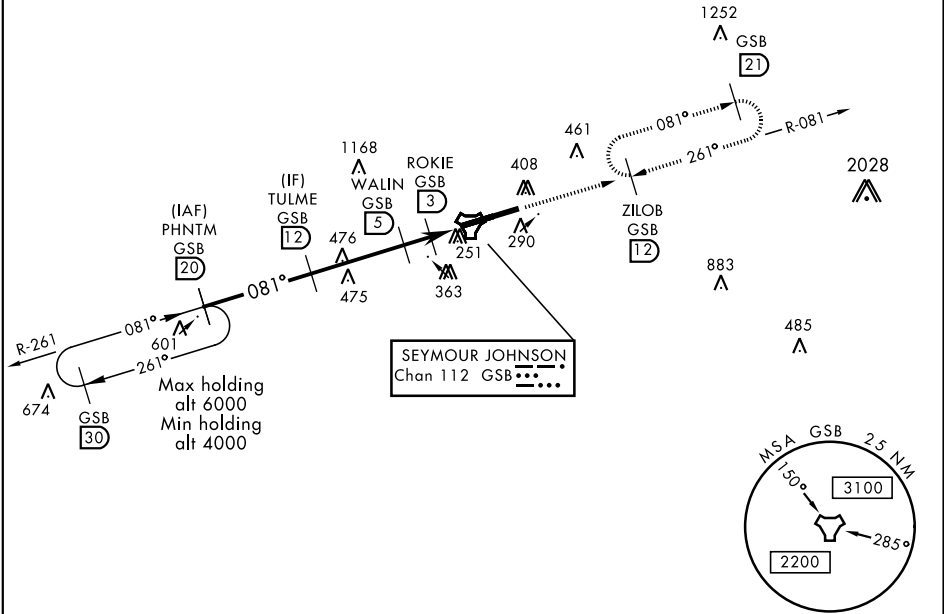

EMERG SAFE ALT 100 NM 3700

PHNTM R-261 20		TULME 12		WALIN 5		ROKIE 3		ZESIX 1.7 9		TACAN		↑ WALIN to ZESIX		2300 GSB R-081		ZILOB R-081 12	
4000		2500		1600		960											
↑ 3.01° TCH 55																	
						2 NM		2.1 NM		.5 NM							
CATEGORY		A		B		C		D		E							
S-8 *		560/24 487 (500-½)				560/50		487 (500-1)									
CIRCLING **		620-1 511 (600-1)				680-1½ 571 (600-1½)		700-2 591 (600-2)		760-2¼ 651 (700-2¼)							

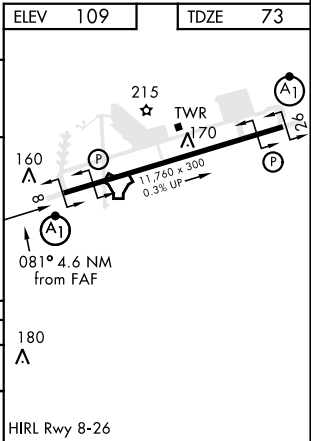

GOLDSBORO, NORTH CAROLINA

35°20'N-77°58'W

SEYMOUR JOHNSON AFB (KGSB)

Amdt 7 05DEC19

TACAN Y RWY 8

SE-2, 16 JUN 2022 to 14 JUL 2022

SE-2, 16 JUN 2022 to 14 JUL 2022