



LOC I-SBN 109.3	APP CRS 272°	Rwy Idg 8412 TDZE 774 Apt Elev 798
---------------------------	------------------------	---

ILS RWY 27L (SA CAT I & II)
SOUTH BEND INTL (SBN)

▼ SA Cat I: Requires specific OPSPEC, MSPEC, or LOA approval and use of HUD to DH. SA Cat II: Reduced lighting: Requires specific OPSPEC, MSPEC, or LOA approval and use of Autoland or HUD to touchdown.		MALSR 	MISSED APPROACH: Climb to 1200 then climbing right turn to 2400 direct GJI VORTAC and hold.	
ATIS 120.675	SOUTH BEND APP CON ★ 118.55 257.8	SOUTH BEND TOWER ★ 135.675 (CTAF) 0 257.8	GND CON 121.7	CLNC DEL 121.9

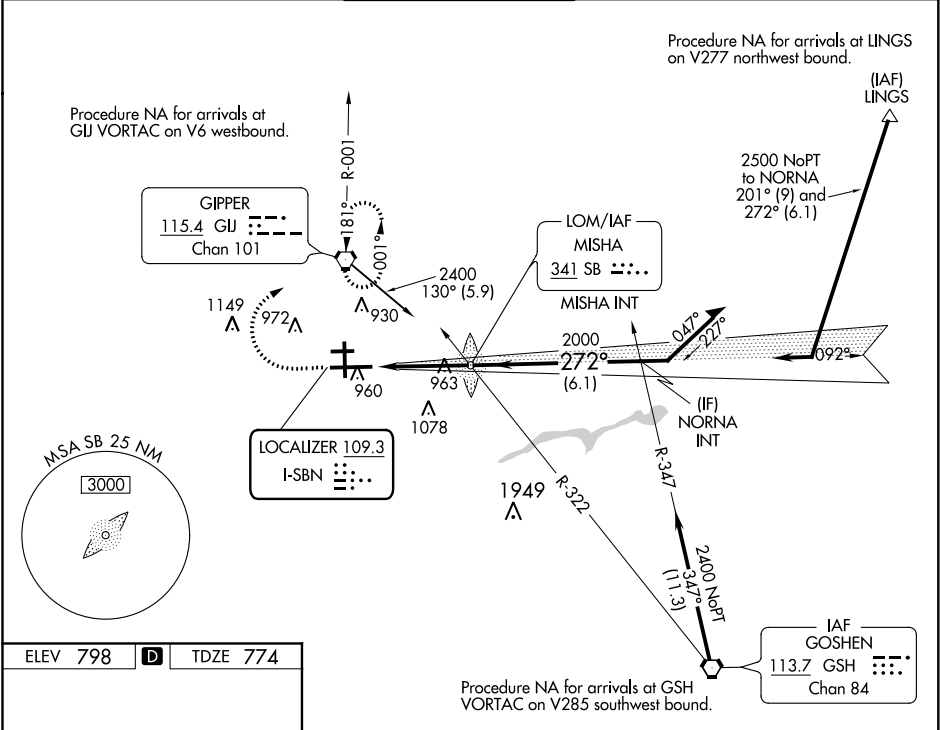

ELEV 798	TDZE 774
----------	----------

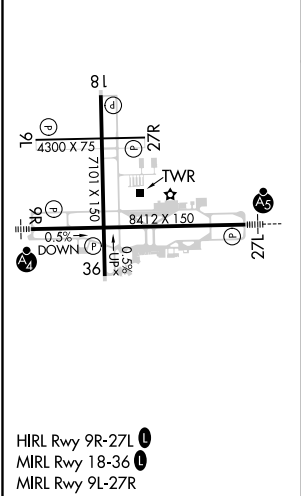

1200	2400	GIJ				
						
			MISHA LOM/INT		Remain within 10 NM	
			1972			
			NORNA			
			092°		272°-2400	
			2400		GS 3.00° TCH 53	
			2000			
			3.6 NM		6.1 NM	
			975°			
CATEGORY	A		B	C	D	
S-ILS 27L	SA CAT I		RA 179/14	150 DA 924		
S-ILS 27L	SA CAT II		RA 114/12	100 DA 874		
SA CATEGORY I & II ILS SPECIAL AIRCREW & AIRCRAFT CERTIFICATION REQUIRED						

EC-2, 16 JUN 2022 to 14 JUL 2022

EC-2, 16 JUN 2022 to 14 JUL 2022