


RNAV (RNP) Z RWY 13R
PALM SPRINGS INTL (PSP)

MISSED APPROACH: Climb to 900 then climbing left turn to 4000 direct TRM VORTAC and hold.


T For uncompensated Baro-VNAV systems, procedure NA below
A 1°C or above 54°C.

ATIS 124.65	SOCAL APP CON ★ 126.7 370.95 135.275 251.1	PALM SPRINGS TOWER ★ 119.7 (CTAF) 377.05	GND CON 121.9	CLNC DEL 128.35	UNICOM 122.95
----------------	--	---	------------------	--------------------	------------------

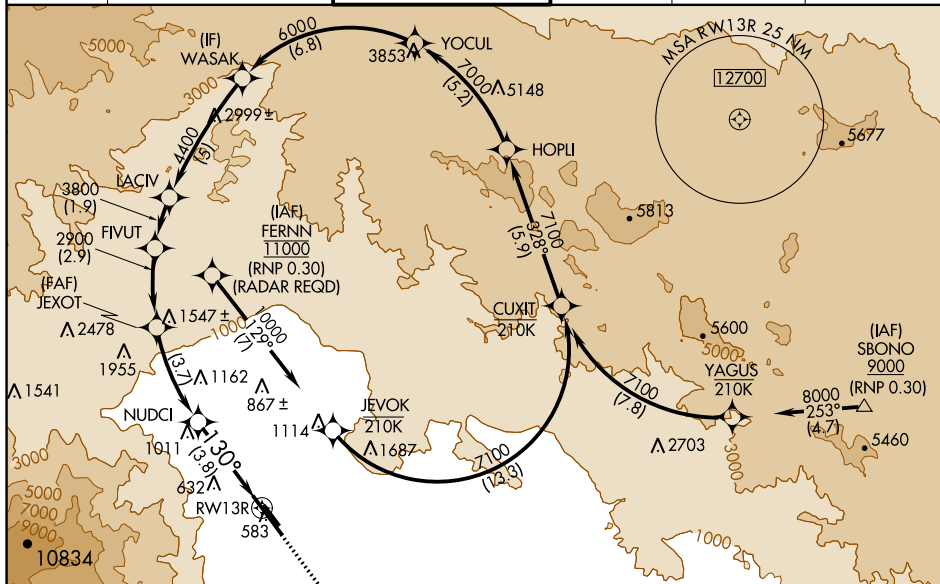

Procedure NA for arrival
on TRM VORTAC
airway radials 263 CW 021.

MISSED APCH FIX

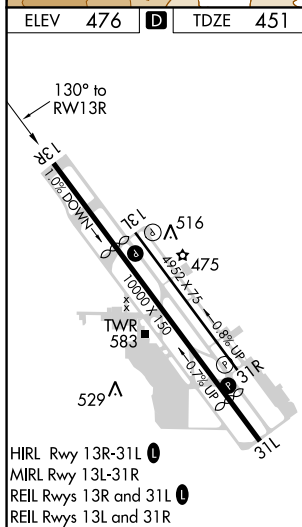

CATEGORY	A	B	C	D
RNP 0.17 DA		812-1¼	361 (400-1¼)	
RNP 0.30 DA		882-1½	431 (500-1½)	

AUTHORIZATION REQUIRED

PALM SPRINGS, CALIFORNIA
Amdt 1A 05DEC19

33°50'N-116°30'W

PALM SPRINGS INTL (PSP)
RNAV (RNP) Z RWY 13R