



ILS or LOC RWY 9L
ORLANDO SANFORD INTL (SFB)

MISSED APPROACH: Climb to 500 then climbing left turn to 2000 on heading 080° and ORL VORTAC R-033 to SMYRA INT/ORL 33.1 DME and hold.


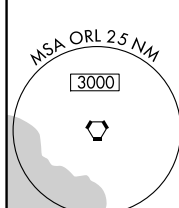


500 ↑	2000 hdg 080°	ORL R-033	SMYRA △
----------	---------------------	--------------	------------

VGSI and ILS glidepath not coincident
(VGSI Angle 3.00/TCH 71).

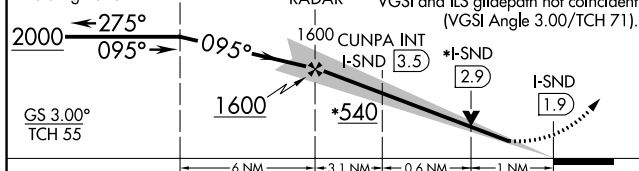

CATEGORY	A	B	C	D
S-ILS 9L	255-1/2 200 (200-1/2)			
S-LOC 9L	540-1/2 485 (500-1/2)		540-1 485 (500-1)	
C CIRCLING	580-1 525 (600-1)		600-1 1/2 545 (600-1 1/2)	640-2 585 (600-2)
CUNPA FIX MINIMUMS (DUAL VOR RECEIVER OR DME REQUIRED)				
S-LOC 9L	440-1/2 385 (400-1/2)		440-5/8 385 (400-5/8)	
C CIRCLING	580-1 525 (600-1)		600-1 1/2 545 (600-1 1/2)	640-2 585 (600-2)

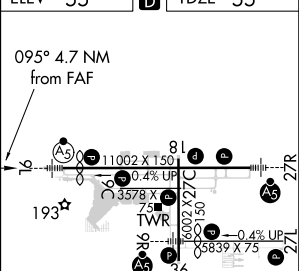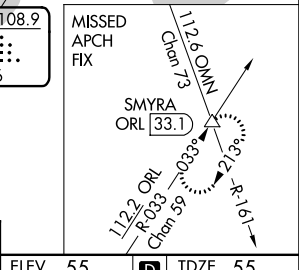

SE-3. 16 JUN 2022 to 14 JUL 2022