


WAAS CH 63141 W36A	APP CRS 022°	Rwy Idg TDZE Apt Elev	3400 275 275
--	------------------------	-----------------------------	---

RNAV (GPS) RWY 36


MANLEY HOT SPRINGS (MLY)(P.A.M.L)

RNP APCH.	When Tanana altimeter setting not received, procedure NA. Circling NA west of Rwy 18-36. Rwy 36 helicopter visibility reduction below ¾ SM NA. Procedure NA at night.	MISSED APPROACH: Climbing right turn to 4400 direct OLSEE and hold.
-----------	--	---

TAL/PATA ASOS 135.1	ANCHORAGE CENTER 120.9 319.2	FAIRBANKS RADIO 122.3 122.65	UNICOM 122.8(CTAF) 0
-------------------------------	--	--	--------------------------------

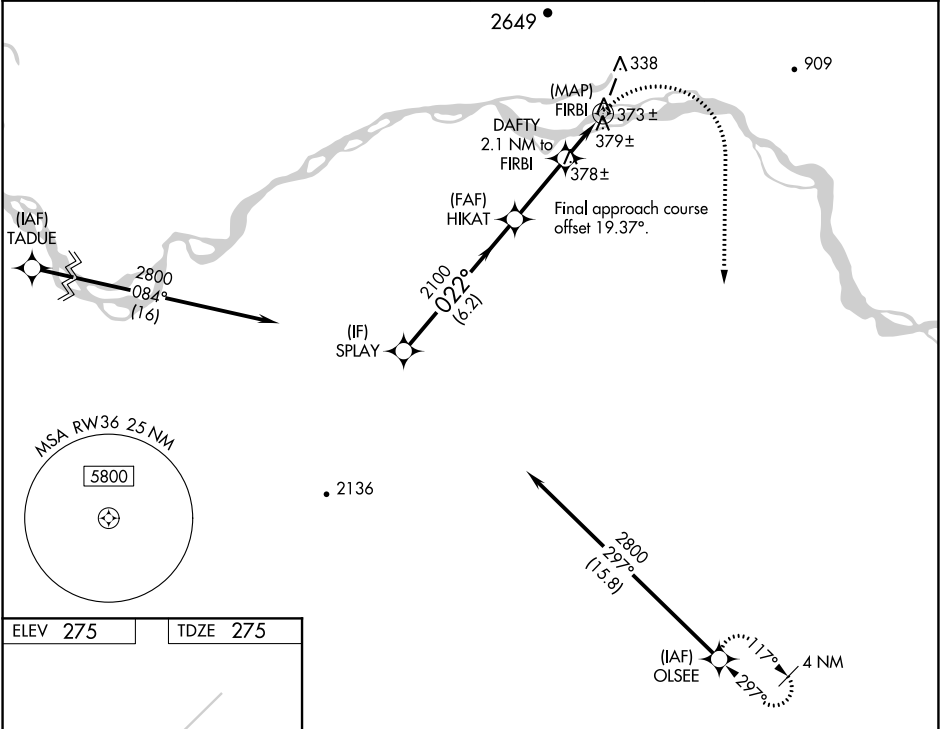

ELEV 275	TDZE 275
----------	----------

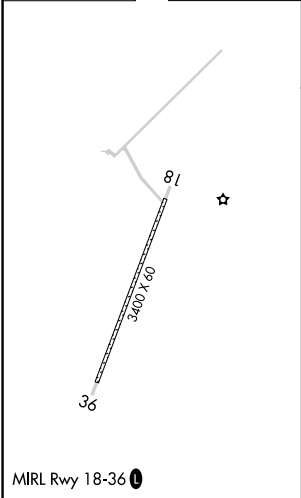

SPLAY				HIKAT		DAFTY 2.1 NM to FIRBI		FIRBI			
2800				2100		1200					
022°				2.98° TCH 40							
6.2 NM				2.8 NM		2.1 NM		0.7			
CATEGORY		A		B		C		D			
LP	MDA	720-1		445 (500-1)		720-1 3/8 445 (500-1 3/8)		NA			
LNAV	MDA	1020-1 745 (800-1)		1020-1 1/4 745 (800-1 1/4)		1020-2 745 (800-2)		NA			
 CIRCLING		1140-1 1/4 865 (900-1 1/4)		1280-1 1/4 1005 (1100-1 1/4)		1580-3 1305 (1400-3)		NA			