

STEVENSVILLE

BAY BRIDGE (W29) 1 W UTC-5(-4DT) N38°58.59' W76°19.80'

15 B TPA—1215(1200) NOTAM FILE W29

RWY 11-29: H2713X60 (ASPH) MIRL 0.3% up E

RWY 11: REIL. PAPI(P2L)—GA 3.0° TCH 39'.

RWY 29: REIL. PAPI(P2L)—GA 3.0° TCH 30'. Trees.

SERVICE: S4 **FUEL** 100LL **LGT** ACTVT REIL Rwy 11 and Rwy 29; MIRL Rwy 11-29—CTAF. Rwy 11 VGSI unusable byd 5 deg left of centerline. PAPIs are baffled.

NOISE: Noise abatement proc in effect—AMGR. Noise sensitive residential area S of arpt; enter downwind for Rwy 29 over water twr S of fld.

AIRPORT REMARKS: Attended Mon-Sat 1230-2130Z†, Sun unattended.

Wildlife on and in/ov arpt. Self serve fuel avbl H24 with credit card. Tgl ops NA. Alert heli 8 NM east of arpt. Rotor craft: Use rgt tfc pat for Rwy 29. At all other times, use left tfc pat. Prkg fee.

AIRPORT MANAGER: 410-643-4364

WEATHER DATA SOURCES: AWOS-3 120.575 (410) 643-8795.

COMMUNICATIONS: CTAF/UNICOM 122.725

Ⓡ **POTOMAC APP/DEP CON** 119.0

CLEARANCE DELIVERY PHONE: For CD ctc Potomac Apch at 866-429-5882.

RADIO AIDS TO NAVIGATION: NOTAM FILE BWI.

BALTIMORE (I) (L) VORTACW 115.1 BAL Chan 98 N39°10.26' W76°39.68' 138° 19.4 NM to fld. 150/11W.

TACAN AZIMUTH & DME unusable:
133°-155° byd 20 NM blo 10,000'
300°-349° byd 35 NM

TACAN DME unusable:
133°-155° byd 36 NM

VOR unusable:
133°-155° byd 20 NM blo 10,000'
197°-217° byd 17 NM
282°-292°


TACAN AZIMUTH unusable:
029°-042° byd 30 NM
180°-190° byd 17 NM

WASHINGTON

COPTER

L-29E, 34F, 36I, A

IAP

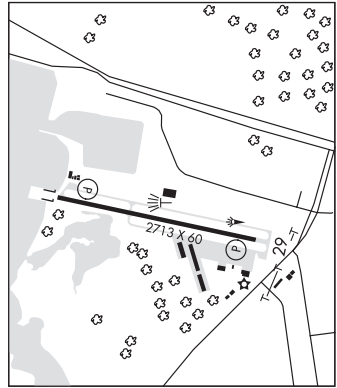

KENTMORR AIRPARK (3W3) 5 SW UTC-5(-4DT) N38°55.09' W76°21.53'

WASHINGTON

10 TPA—1000(990) NOTAM FILE DCA

RWY 10-28: 2400X75 (TURF)

RWY 10: Thld dsplcd 200'. Trees.

RWY 28: Thld dsplcd 150'. Trees.

NOISE: Preferred calm or crosswind Rwy 28, for noise abatement. Preferred 90° crosswind Rwy 28, for noise abatement.

AIRPORT REMARKS: Unattended. Numerous birds, deer, other wildlife on and in/ov arpt. No ngt ops. Unlimited vehicle access to acft movement areas. Rwy 10-28 may be soft and wet. Rwy 10-28 dsplcd thrs mxd with orange cones. Helicopters requested to use standard tfc pattern. Taxi and park on north side of rwy.

AIRPORT MANAGER: 301-456-0566

COMMUNICATIONS: CTAF 122.9

CLEARANCE DELIVERY PHONE: For CD ctc Potomac Apch at 866-429-5882.

TIPTON (See FORT MEADE(ODENTON) on page 102)

WASHINGTON EXEC/HYDE FLD (See CLINTON on page 97)