

| | | |
|--|------------------------|--|
| WAAS CH 48813 W05A | APP CRS 054° | Rwy Idg 10000 TDZE 384 Apt Elev 435 |
|--|------------------------|--|


RNAV (GPS) Y RWY 5L

RALEIGH-DURHAM INTL (RDU)

RNP APCH-GPS.




⚠ Simultaneous approach authorized. LNAV procedure NA during simultaneous operations. For uncompensated Baro-VNAV systems, LNAV/VNAV NA below -12°C or above 54°C. For inop ALS, increase LNAV/VNAV all Cats visibility to RVR 5500. Use of FD or AP required during simultaneous operations.

MALSR



MISSED APPROACH: Climb to 1000 then climbing left turn to 2200 direct DUHAM and hold.

| | | | | | | | |
|------------------------|---|---|--|-----------------------------------|-----------------------------------|--------------------------|-------|
| D-ATIS 123.8 | RALEIGH APP CON 127.675 307.9 | (EAST) RALEIGH TOWER (WEST) 127.45 257.8 Rwys 5R-23L and 14-32 | (EAST) GND CON (WEST) 121.9 348.6 Rwys 5R-23L and 14-32 | (EAST) 348.6 Rwy 5L-23R | (WEST) 348.6 Rwy 5L-23R | CLNC DEL 120.1 | CPDLC |
|------------------------|---|---|--|-----------------------------------|-----------------------------------|--------------------------|-------|

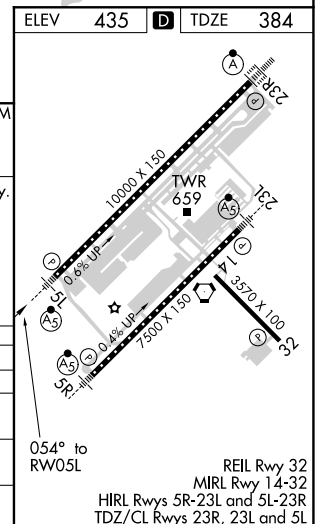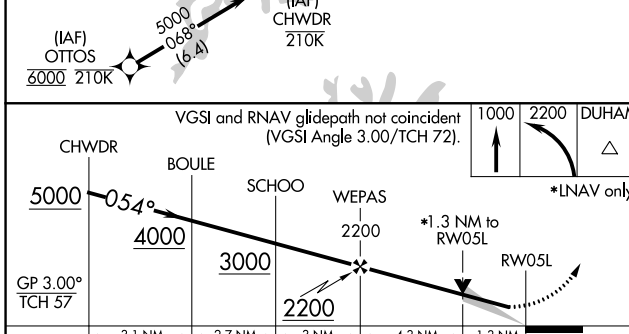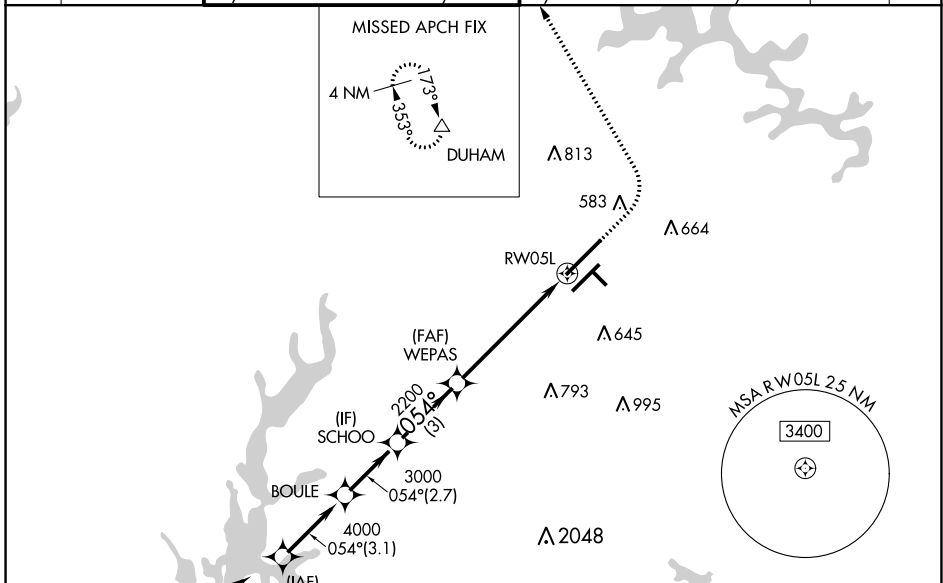

| | | | | |
|--------------|--------|---------------|-----------------------------|-----------------------------|
| CATEGORY | A | B | C | D |
| LPV DA | | 598/18 | 214 (200-1/2) | |
| LNAV/VNAV DA | | 748/35 | 364 (400-2/3) | |
| LNAV MDA | 840/24 | 456 (500-1/2) | 840/45 | 456 (500-2/3) |
| CIRCLING | 960-1 | 525 (600-1) | 1020-1 1/2 585 (600-1/2) | 1180-2 1/2 745 (800-2/2) |

SE-2, 08 SEP 2022 to 06 OCT 2022

SE-2, 08 SEP 2022 to 06 OCT 2022