

|                                        |                        |                             |                                     |
|----------------------------------------|------------------------|-----------------------------|-------------------------------------|
| WAAS<br>CH <b>40442</b><br><b>W11A</b> | APP CRS<br><b>109°</b> | Rwy Idg<br>TDZE<br>Apt Elev | <b>4700</b><br><b>6</b><br><b>6</b> |
|----------------------------------------|------------------------|-----------------------------|-------------------------------------|


RNAV (GPS) RWY 11

HYDE COUNTY (7W6)

RNP APCH.

MISSED APPROACH: Climb to 500 then climbing right turn 3000 direct PUNGO and hold.

|                           |                                               |                               |
|---------------------------|-----------------------------------------------|-------------------------------|
| AWOS-3P<br><b>119.275</b> | CHERRY POINT APP CON<br><b>124.725 350.35</b> | UNICOM<br><b>122.7 (CTAF)</b> |
|---------------------------|-----------------------------------------------|-------------------------------|

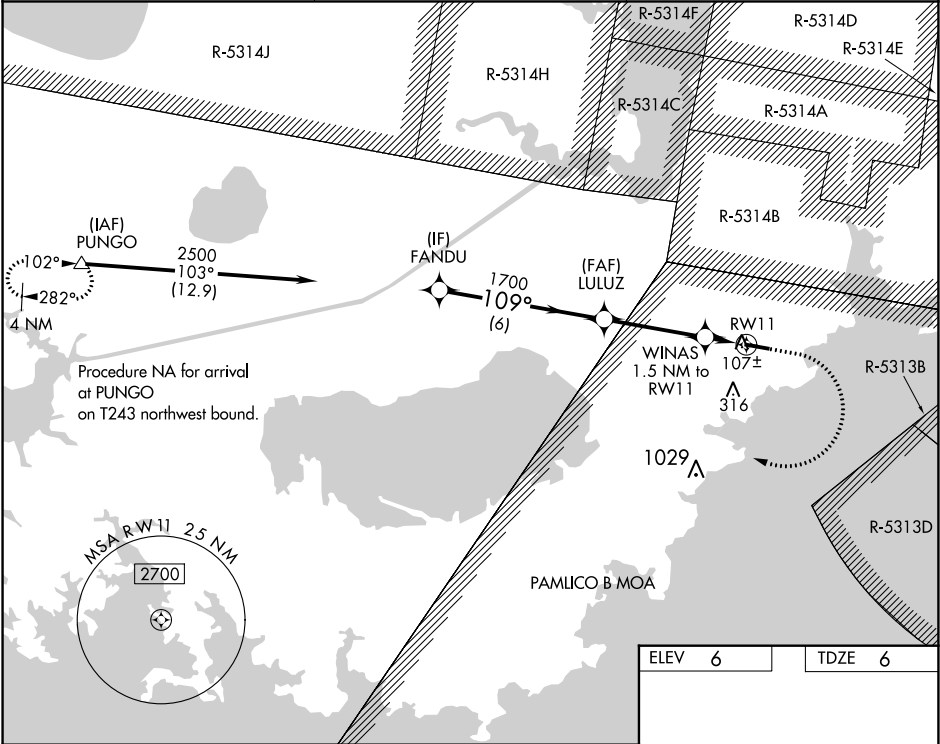

FANDU

2500

109°

LULUZ

1700

3.00° TCH 45

520

1 NM to RW11

RW11

6 NM

3.7 NM

0.5

1 NM

500

3000

PUNGO

WINAS 1.5 NM to RW11

109° to RW11

4700 X 100

| CATEGORY | A                    | B                    | C  | D |
|----------|----------------------|----------------------|----|---|
| LP MDA   | 360-1                | 354 (400-1)          | NA |   |
| LNAV MDA | 360-1                | 354 (400-1)          | NA |   |
| CIRCLING | 420-1<br>414 (500-1) | 460-1<br>454 (500-1) | NA |   |

MRL Rwy 11-29