

LOC I-BAL <u>109.7</u>	APP CRS 105°	Rwy Idg 9953 TDZE 143 Apt Elev 143
----------------------------------	------------------------	---

BALTIMORE/ ILS RWY 10 (CAT II & III)
WASHINGTON INTL THURGOOD MARSHALL (BWI)

RADAR required for procedure entry.
DME required.





ALSF-2

MISSED APPROACH: Climb to 2500 on BAL VORTAC R-105 to HURTZ/BAL 12.1 DME/RADAR and hold.

D-ATIS	POTOMAC APP CON				BALTIMORE TOWER	GND CON	CLNC DEL
115.1 127.8	119.0 282.275	(020°-130°)	119.7 290.475	(131°-180°)	119.4 257.8	121.9	118.05
	124.55 317.425	(101°-100°)	128.7 307.9	(181°-019°)			

ALTERNATE MISSED
APCH FIX

CPDLC

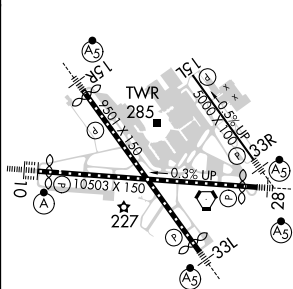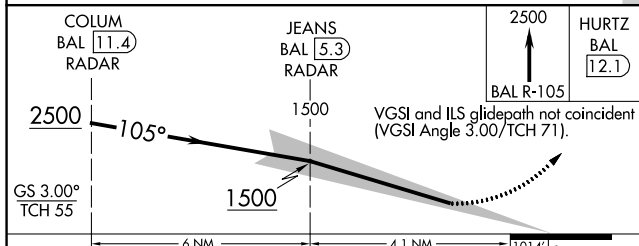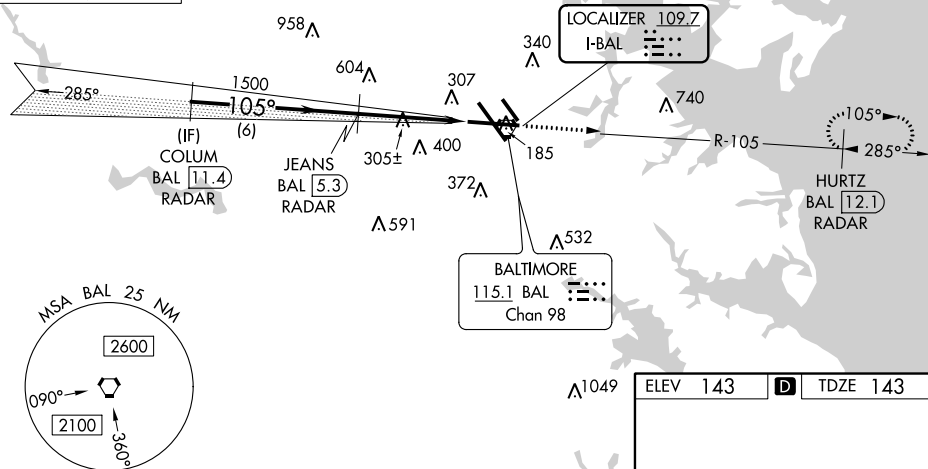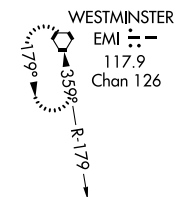

CATEGORY	A	B	C	D
S-ILS 10	CAT II RA 102/12 100 DA 243			
S-ILS 10	CAT III RVR 06			

CATEGORY II & III ILS - SPECIAL AIRCREW
& AIRCRAFT CERTIFICATION REQUIRED

TDZ/CL Rwy 10 and 33L
REIL Rwy 15L and 33R
HIRL all Rwy