




VORTAC HBR 111.8 Chan 55	APP CRS 354°	Rwy Idg 5507 TDZE 1561 Apt Elev 1563
--	------------------------	---

VOR RWY 35
HOBART RGNL (HBR)


V When local altimeter setting not received, use *Altus/Quartz Mountain Rgnl* altimeter setting and increase all MDAs 80 feet, increase S-35 Cats C/D and Circling Cat C visibility $\frac{1}{4}$ SM, increase *FAPRA* fix minimums S-35 Cats C/D and Circling Cat C visibility $\frac{1}{4}$ SM. *VDP NA* when using *Altus/Quartz Mountain Rgnl* altimeter setting.

MISSED APPROACH: Climb to 2100, then climbing right turn to 3800 direct HBR VORTAC and hold.

ASOS 133,325	ALTUS APP CON ★ 125.1 353.7	UNICOM 122.8 (CTAF)
------------------------	---------------------------------------	-------------------------------

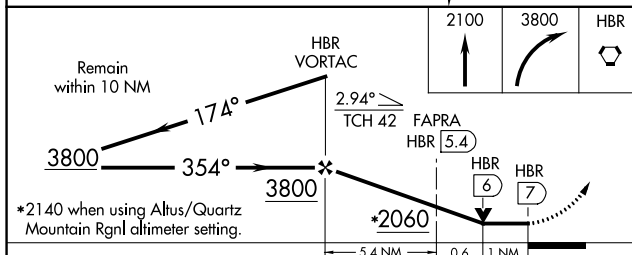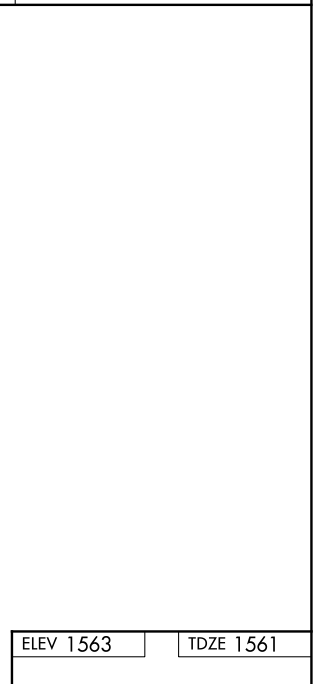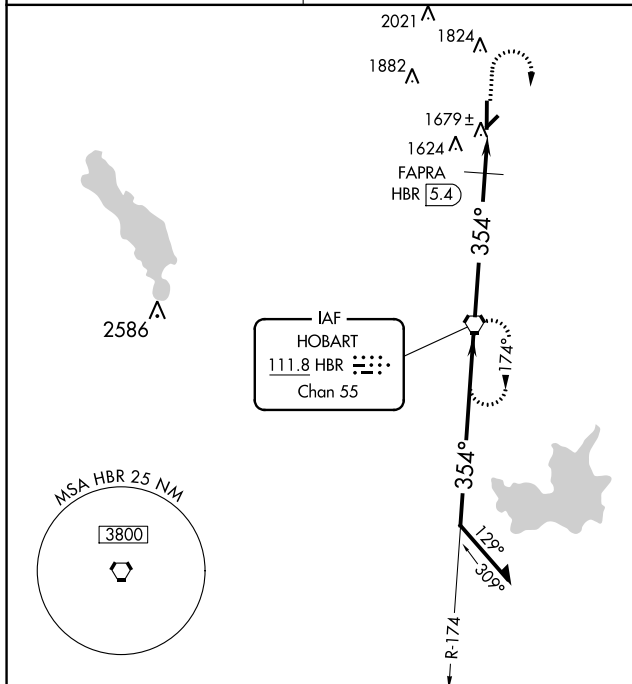

CATEGORY	A	B	C	D
S-35	2060-1	499 (500-1)	2060-1¼ 499 (500-1¼)	2060-1½ 499 (500-1½)
CIRCLING	2060-1	497 (500-1)	2320-2¼ 757 (800-2¼)	2460-3 897 (900-3)
FAPRA FIX MINIMUMS				
S-35	1980-1	419 (500-1)	1980-1¼	419 (500-1¼)
CIRCLING	1980-1 417 (500-1)	2020-1 457 (500-1)	2320-2¼ 757 (800-2¼)	2460-3 897 (900-3)

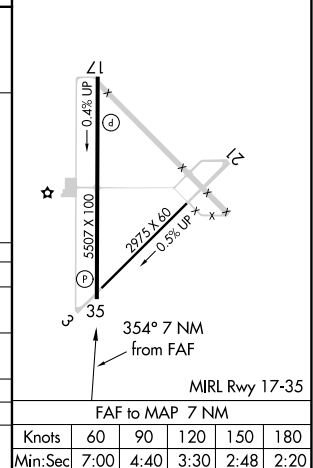

HOBART RGNL (HBR)
VOR RWY 35