

LOC I-MGM	APP CRS	Rwy Idg	9020
109.9	097°	TDZE	219
		Apt Elev	221

ILS or LOC RWY 10

MONTGOMERY RGNL (DANNELLY FLD) (MGM)


⚠ Circling for Cat E NA north of Rwy 10-28. For inop ALS, increase S-ILS 10 Cat E visibility to RVR 4000, and increase S-LOC 10 Cat E visibility to 1% SM.

⚠ ASR ** RVR 1800 authorized with the use of FD or AP or HUD to DA.

MALSR

MISSED APPROACH: Climb to 700 then climbing right turn to 3000 direct MGM VORTAC and hold, continue climb-in-hold to 3000 (TACAN aircraft continue 3500 on MGM VORTAC R-126 to SHADY INT/ MGM 15 DME and hold SE, RT, 306° inbound).

ATIS	MONTGOMERY APP CON *	DANNELLY TOWER *	GND CON	CLNC DEL	UNICOM
120.675	124.0 363.025	119.7 (CTAF) 360.85	121.7 348.6	118.3 270.3	122.95

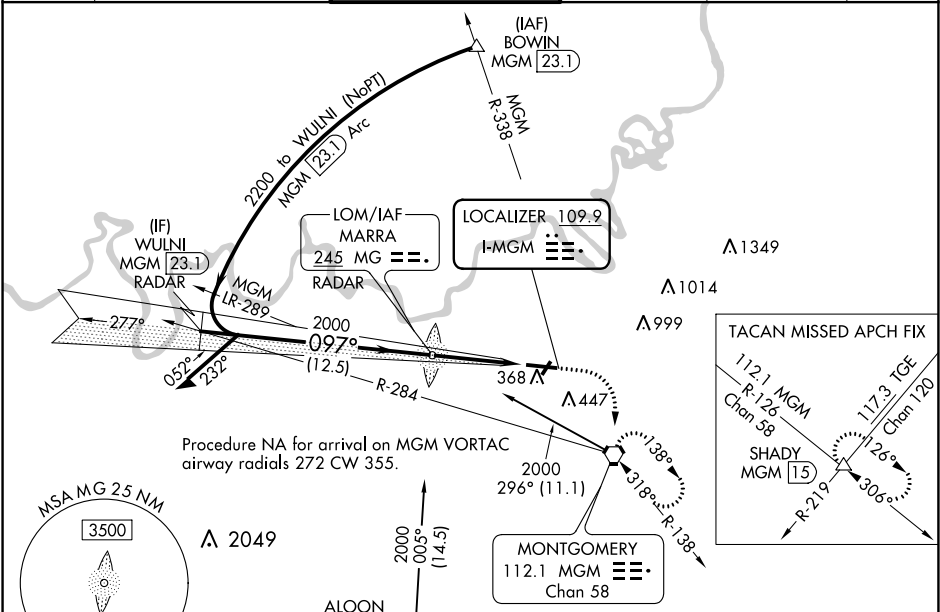

ADF or DME or RADAR REQUIRED

Remain within 10 NM

MG LOM RADAR

2000 097°

2000

GS 3.00° TCH 50

1931

700 3000 MGM

VGSI and ILS glidepath not coincident (VGSI Angle 3.00/TCH 64).

5.2 NM

ELEV 221 TDZE 219

097° 5.2 NM from FAF

REIL Rwy 3
MIRL Rwy 3-21
HIRL Rwy 10-28

FAF to MAP 5.2 NM

Knots	60	90	120	150	180
Min:Sec	5:12	3:28	2:36	2:05	1:44

ILS or LOC RWY 10

SE-4, 01 DEC 2022 to 29 DEC 2022

SE-4, 01 DEC 2022 to 29 DEC 2022