

WAAS CH 99600 W36A	APP CRS 002°	Rwy Idg 8003 TDZE 261 Apt Elev 264
--	------------------------	---


RNAV (GPS) RWY 36
GOLDEN TRIANGLE RGNL (GTR)

RNP APCH.

⚠ For uncompensated Baro-VNAV systems, LNAV/VNAV NA below -15°C or above 54°C. When local altimeter setting not received, use Columbus AFB altimeter setting: increase LPV DA to 500 feet, LNAV/VNAV DA to 593 feet and LNAV/VNAV visibility 1/8 SM; increase all MDAs 40 feet. Baro-VNAV and VDP NA when using Columbus AFB altimeter setting.

MISSED APPROACH:
Climb to 3000 direct HUYKA and hold.

ATIS 126.375	COLUMBUS APP CON ★ 135.6 323.275	GOLDEN TRIANGLE TOWER ★ 118.2 (CTAF) 0 298.875	GND CON 135.375 322.475	CLNC DEL 135.375 322.475
------------------------	--	--	-----------------------------------	------------------------------------

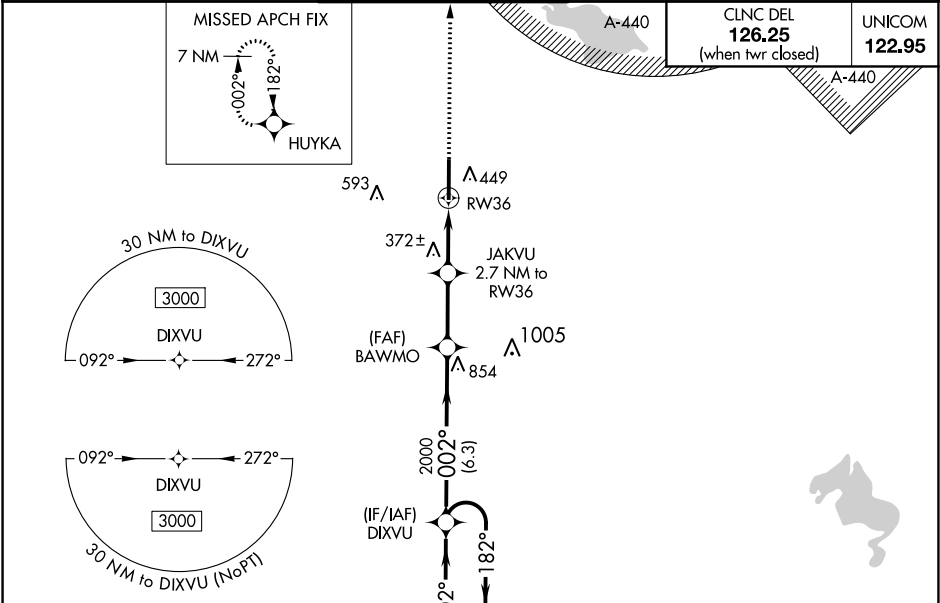

ELEV 264 TDZE 261

7 NM Holding Pattern DIXVU

VGSI and RNAV glidepath not coincident (VGSI Angle 3.00/TCH 55).

GP 3.00° TCH 42

6000 3000 182° 002° 002°

2000 1140 6.3 NM 2.7 NM 1.7 NM 1 NM

BAWMO JAKVU 2.7 NM to RW36 *1 NM to RW36 RW36

*LNAV only.

CATEGORY	A	B	C	D	E
LPV DA	461-3/4 200 (200-3/4)				
LNAV/VNAV DA	554-7/8 293 (300-7/8)				
LNAV MDA	640-1 379 (400-1)		640-1 379 (400-1 1/8)		
CIRCLING	760-1 496 (500-1)		960-2 696 (700-2)	960-2 1/4 696 (700-2 1/4)	960-2 1/2 696 (700-2 1/2)

8003 X 150

36

002° to RW36

HIRL Rwy 18-36

SC-4, 01 DEC 2022 to 29 DEC 2022

SC-4, 01 DEC 2022 to 29 DEC 2022