
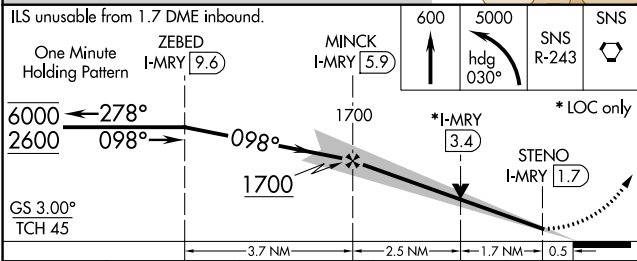


LOC/DME I-MRY	APP CRS	Rwy ldg	7000
110.7	098°	TDZE	198
Chan 44		Apt Elev	257

ILS or LOC RWY 10R
MONTEREY RGNL (MRY)

DME required.	MALSR	MISSED APPROACH: Climb to 600 then climbing left turn to 5000 on heading 030° and on SNS VORTAC R-243 to SNS VORTAC and hold, continue climb-in-hold to 5000. # Missed approach requires minimum climb of 265 feet per NM to 1360.
⚠ Circling NA south of Rwy 10R-28L. For inop ALS, increase S-ILS 10R all Cats visibility to RVR 6000, and increase S-LOC 10R Cat C and D visibility to 2 SM.		

ATIS 119.25	NORCAL APP CON 133.0 251.15 (001°-135°) 127.15 307.125 (136°-360°)	MONTEREY TOWER ★ 118.4 (CTAF) 257.8	GND CON 120.875 348.6	CLNC DEL 135.45	UNICOM 122.95
-----------------------	--	--	---------------------------------	---------------------------	-------------------------

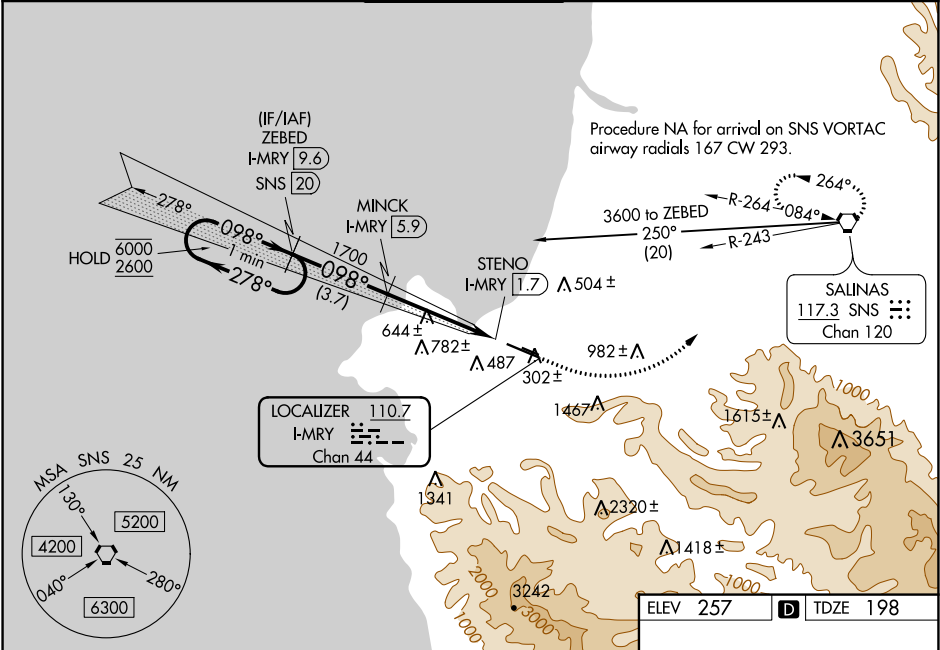

CATEGORY	A	B	C	D
S-ILS 10R#	398/24	200 (200-½)		
S-ILS 10R	583/35	385 (400-¾)		
S-LOC 10R	920/24	722 (700-½)	920-1⅝	722 (700-1⅝)
CIRCLING	920-1	663 (700-1)	1280-3	1023 (1100-3)

