

APP CRS
297°

Rwy Idg
TDZE
Apt Elev
2621
5
5

RNAV (GPS) Y RWY 30

SAN CARLOS (SQL)


▼

▲

DME/DME RNP-0.3 NA. When local altimeter setting not received, use San Francisco Intl altimeter setting and increase all MDA 40 feet.
Rwy 30 visibility reduction by helicopters below 1 SM NA.
Circling NA west of Rwy 12-30.

MISSED APPROACH: Climbing left turn to 5400 direct AMEBY and hold, continue climb-in-hold to 5400.

ATIS 125.9	NORCAL APP CON 133.95 317.6	SAN CARLOS TOWER ★ 119.0 (CTAF) 0 326.2	GND CON 121.6	UNICOM 122.95
---------------	--------------------------------	--	------------------	------------------

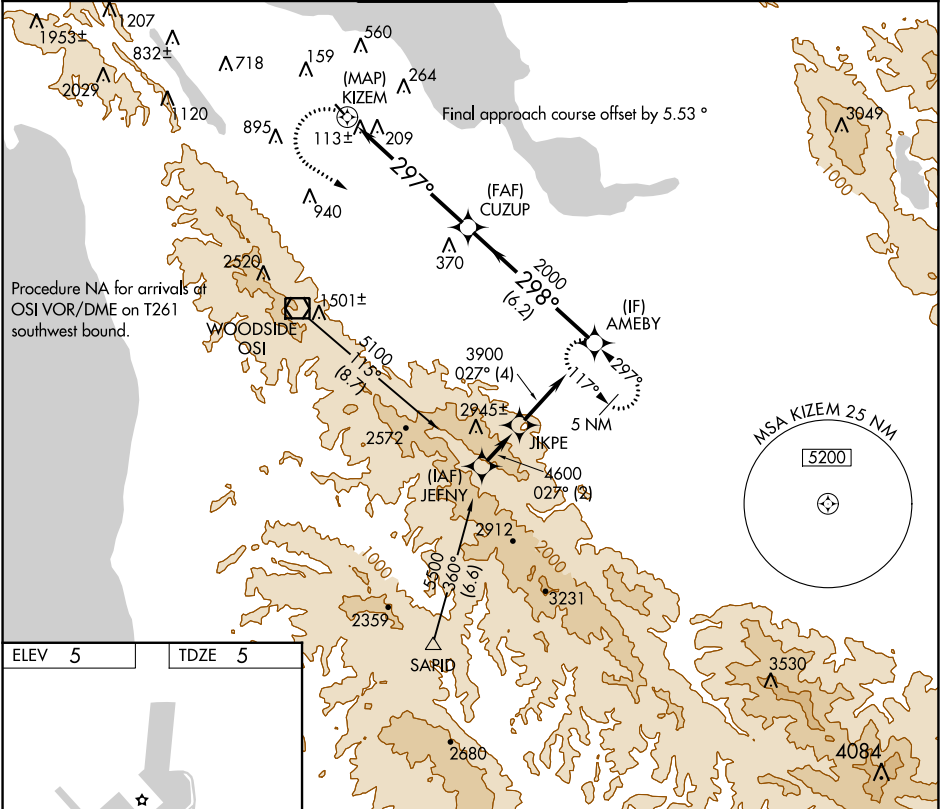

ELEV 5

TDZE 5

REIL Rwy 12 and 30 1

MIRL Rwy 12-30 1

5400	AMEBY	VGSI and descent angles not coincident (VGSI Angle 3.00/TCH 25).	AMEBY	
CATEGORY	A	B	C	D
LNAV MDA	1260-1 ¼	1255 (1300-1 ¼)	NA	
CIRCLING	1260-1 ¼	1260-1 ½	NA	