

**MANTEO** N35°54.92' W75°41.70' NOTAM FILE MQI.  
**NDB (MHW)** 370 MQI at Dare Co Rgnl. 7/9W. NDB unmonitored 2300–1300Z. SHUTDOWN.

**CHARLOTTE**  
 L-35D

**MARION**

**SHIFLET FLD** (9A9) 3 N UTC-5(-4DT) N35°43.24' W82°00.59'  
 1212 B NOTAM FILE RDU

**ATLANTA**

**RWY 10-28:** 3340X180 (TURF) LIRL

**RWY 10:** Trees.

**RWY 28:** Trees.

**SERVICE:** LGT Rotating bcn lgt RDO-CTL for based acft only. Arpt lgt RDO-CTL for based acft only.

**AIRPORT REMARKS:** Unattended. Arpt CLOSED at ngt to in-transit tfc. Deer on and invof arpt. Rwy 10 has private drive crossing in front of thr. Rwy subj to flooding after very heavy rains on east end. Hangars are spaced closer than normal, slower taxi speeds rqrtd.

**AIRPORT MANAGER:** 828-803-4019

**COMMUNICATIONS:** CTAF 122.9

**CLEARANCE DELIVERY PHONE:** For CD ctc Atlanta ARTCC at 770-210-7692.

**MARTIN CO** (See WILLIAMSTON on page 357)

**MAXTN** N34°43.99' W79°26.62' NOTAM FILE RDU.  
**NDB (MHW/LOM)** 257 ME 055° 5.2 NM to Laurinburg/Maxton. 198/8W.

**CHARLOTTE**  
 L-35A, 36E

**MAXTON**

**LAURINBURG/MAXTON** (MEB)(KMEB) 3 N UTC-5(-4DT) N34°47.53' W79°21.95'  
 216 B NOTAM FILE MEB

**CHARLOTTE**  
 H-9C, 12H, L-35A, 36E  
 IAP

**RWY 05-23:** H6503X100 (ASPH) S-60, D-160, 2D-256 HIRL

**RWY 05:** MALSR. PAPI(P4L)—GA 3.0° TCH 52'.

**RWY 23:** PAPI(P4L)—GA 3.0° TCH 38'. Thld dspcd 187'. Road. Rgt tfc.

**RWY 13-31:** H3536X75 (CONC) S-25, D-35

**RWY 13:** Trees. Rgt tfc.

**RWY 31:** Acft.

**SERVICE:** S2 FUEL 100LL, JET A1+ LGT Actvt MALSR Rwy 05, PAPI Rwy 05-23, HIRL Rwy 05-23—CTAF. Rwy 23 PAPI OTS indef.

**AIRPORT REMARKS:** Attended Mon-Fri 1300-2200Z. Parachute Jumping. Heavy parachute jumping at south end of clsd Rwy 18-36 and south side of Rwy 13-31. Farming eqpt and mil ops on and invof arpt. For svc after hrs call 910-277-0367 or 910-318-6907. 24 hr self svc with credit card. For airframe repairs call arpt to arrange for service. Mil acft frqly oper fm clsd ptn of Rwy 13-31 and clsd Rwy 18-36. Rwy 13-31 daylight use only. Rwy 13-31 2750 ft conc stopway on southeast end. No line of sight btn rwy ends. Ldg fee.

**AIRPORT MANAGER:** (910) 844-3601

**WEATHER DATA SOURCES:** ASOS 134.125 (910) 844-5338.

**COMMUNICATIONS:** CTAF/UNICOM 122.8

® **FAYETTEVILLE APP/DEP CON** 127.8

**GCO** 135.075 (FAYETTEVILLE CLNC DEL)

**CLEARANCE DELIVERY PHONE:** For CD if una via GCO ctc Fayetteville Apch at 910-484-8012.

**RADIO AIDS TO NAVIGATION:** NOTAM FILE RDU.

**SANDHILLS (L) (L) VORTACW** 111.8 SDZ Chan 55 N35°12.93' W79°35.28' 160° 27.6 NM to fld. 588/3W.

VOR unusable:

075°-143°

144°-154° blo 6,000'

144°-154° byd 23 NM

155°-179° blo 5,000'

180°-264° blo 8,000'

301°-019° byd 10 NM blo 10,000'

DME unusable:


041°-092° blo 3,000'

TAC AZM unusable:

016°-050° byd 28 NM blo 3,000'

**MAXTN NDB (LOM)** 257 ME N34°43.99' W79°26.63' 055° 5.2 NM to fld.

**ILS** 110.7 I-MEB Rwy 05. Class IE. LOM MAXTN NDB. LOC unusable byd 17° right of course. LOC unusable byd 29° left of course.

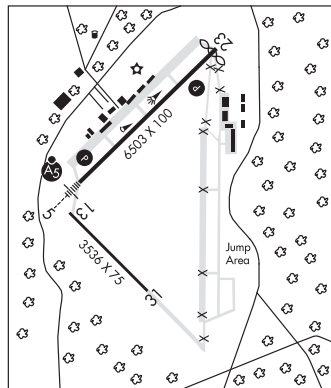

**MCCUTCHEON FLD** (See NEW RIVER MCAS (MCCUTCHEON FLD) on page 329)