

WAAS CH 90505 W04A	APP CRS 037°	Rwy Idg 5500 TDZE 904 Apt Elev 904
--	------------------------	---

RNAV (GPS) RWY 4
BOLTON FLD (TZR)

RNP APCH.




For uncompensated Baro-VNAV systems, LNAV/VNAV NA below -16°C or above 54°C. For inop ALS, increase LNAV/VNAV all Cats visibility to 1¼ SM and LNAV Cats C/D visibility to 1¾ SM.

MALSR



MISSED APPROACH:
Climb to 3000 direct
OYILU and left turn
on track 294° to
MECAN and hold.

AWOS-3 135.925	COLUMBUS APP CON 134.0 279.6	BOLTON TOWER ★ 128.1 (CTAF) 0	GND CON 121.8
--------------------------	--	---	-------------------------

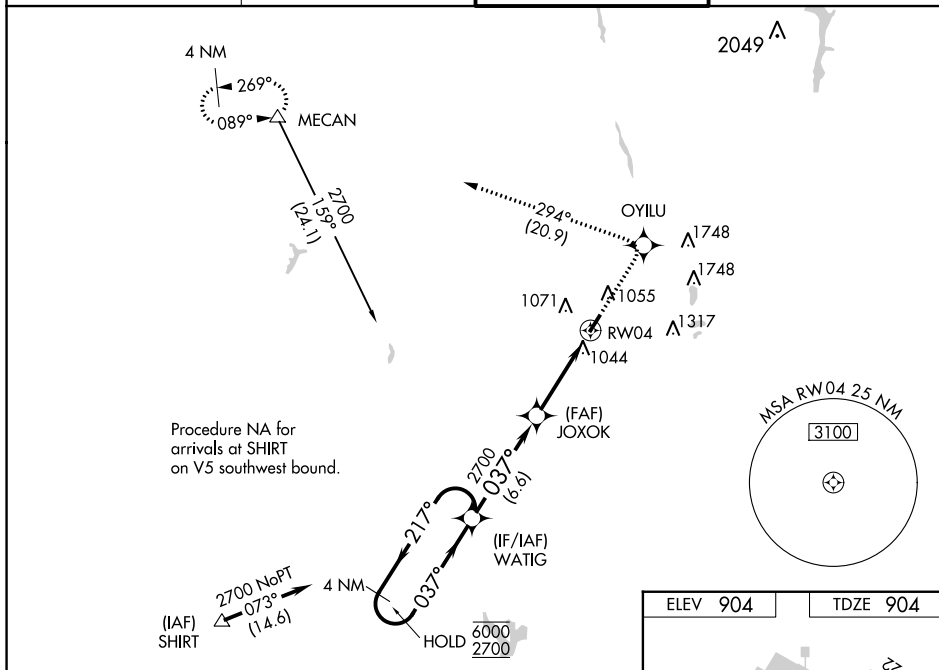

VGSJ and RNAV glidepath not coincident
(VGSJ Angle 3.00/TCH 25).

4 NM Holding Pattern

WATIG JOXOK

6000 ← 217°
2700 → 037°


GP 3.00°
TCH 39

* 1.4 NM to RW04

RW04

6.6 NM 4 NM 1.4

CATEGORY	A	B	C	D
LPV DA	1163-½ 259 (300-½)			
RNAV/ VNAV DA	1325-1 421 (500-1)			
RNAV MDA	1360-½ 456 (500-½)	1360-⅞ 456 (500-⅞)	1360-1 456 (500-1)	1360-1 456 (500-1)
CIRCLING	1360-1 456 (500-1)	1380-1 476 (500-1)	1380-1½ 476 (500-1½)	1500-2 596 (600-2)

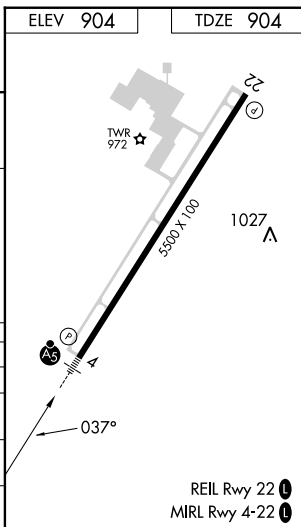

RNAV (GPS) RWY 4