


|                                        |                        |                                                                 |
|----------------------------------------|------------------------|-----------------------------------------------------------------|
| WAAS<br>CH <b>73010</b><br><b>W09A</b> | APP CRS<br><b>091°</b> | Rwy Idg <b>4100</b><br>TDZE <b>3669</b><br>Apt Elev <b>3703</b> |
|----------------------------------------|------------------------|-----------------------------------------------------------------|

RNAV (GPS) Z RWY 9

GRANT COUNTY RGNL/OGILVIE FLD (GCD)

|                                                                                                                                                                      |                                                                                                                          |
|----------------------------------------------------------------------------------------------------------------------------------------------------------------------|--------------------------------------------------------------------------------------------------------------------------|
| <div><div></div><div>When local altimeter setting not received, procedure NA.<br/>DME/DME RNP-0.3 NA. Helicopter visibility reduction<br/>below ¾ SM NA.</div></div> | MISSED APPROACH: Climb to 12000 direct YERPU<br>and on track 057° to OXVEN and hold, continue<br>climb-in-hold to 12000. |
|----------------------------------------------------------------------------------------------------------------------------------------------------------------------|--------------------------------------------------------------------------------------------------------------------------|

|                          |                                        |                                 |
|--------------------------|----------------------------------------|---------------------------------|
| AWOS-3<br><b>118.375</b> | SEATTLE CENTER<br><b>128.15 257.75</b> | UNICOM<br><b>122.8 (CTAF) 0</b> |
|--------------------------|----------------------------------------|---------------------------------|

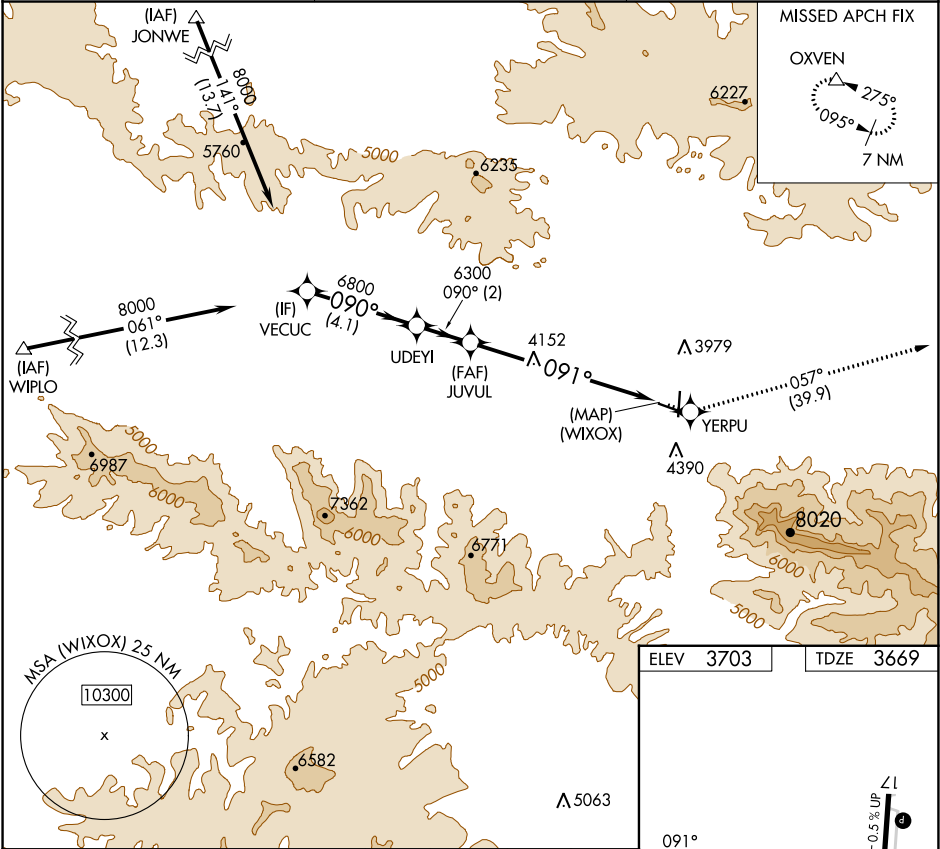

|          |  |        |             |       |       |       |
|----------|--|--------|-------------|-------|-------|-------|
| VEUCUC   |  | UDEYI  | JUVUL       | 12000 | YERPU | OXVEN |
| 8000     |  | 6800   | 6300        | 12000 | YERPU | OXVEN |
| GP 3.40° |  | 6300   | 6300        | 12000 | YERPU | OXVEN |
| TCH 54   |  | 6300   | 6300        | 12000 | YERPU | OXVEN |
| 4.1 NM   |  | 2 NM   | 7.1 NM      | 12000 | YERPU | OXVEN |
| CATEGORY |  | A      | B           | C     | D     |       |
| LPV DA   |  | 4269-2 | 600 (600-2) | NA    |       |       |

ELEV 3703

TDZE 3669

091°

1.0 % UP

4100 X 60

5224 X 60

3707

35

VGSI and RNAV glidepath not coincident  
(VGSI Angle 3.00/TCH 45).

(WIXOX)