

WADSWORTH**WADSWORTH MUNI** (3G3) 2 SW UTC-5(-4DT) N41°00.18' W81°45.39'**DETROIT**

974 B NOTAM FILE CLE

L-29B

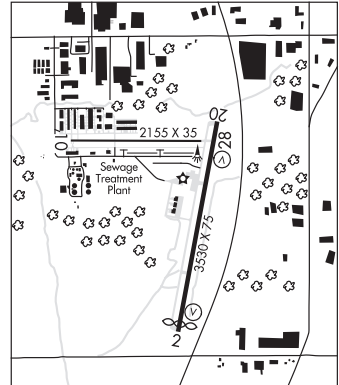
RWY 02-20: H3530X75 (ASPH) MIRL

IAP

RWY 02: VASI(V2R)—GA 3.5° TCH 24'. Thld dsplcd 130'. Fence.**RWY 20:** VASI(V2L)—GA 3.5° TCH 24'. Fence.**RWY 10-28:** H2155X35 (ASPH) 0.4% up E**RWY 10:** Pole.**RWY 28:** Tree.**SERVICE:** S4 FUEL 100LL, JET A1 + LGT ACTIVATE MIRL Rwy 02-20—CTAF. VASI Rwy 02 and Rwy 20 opr consly.**NOISE:** Rwy 20 calm wind rwy blo 4 kts for noise abatement. Avoid hospital to the N.**AIRPORT REMARKS:** Attended continuously. Birds, deer, and other wildlife on and in/ov arpt. No line of sight between Rwy 02 and Rwy 10. Rwy 10 clsd for departure when wind is less than 15 knots from the east. Twy B clsd to powered acft. Caution glider ops all rwys. Extensive helo ops.**AIRPORT MANAGER:** 330-334-9861**COMMUNICATIONS:** CTAF/UNICOM 122.8® **CLEVELAND APP/DEP CON** 118.6 (1100-0500Z±)® **CLEVELAND CENTER APP/DEP CON** 134.9 (0500-1100Z±) ctc Cleveland ARTCC at 440-774-0223.**CLEARANCE DELIVERY PHONE:** For CD ctc Cleveland Apch at 216-352-2323, when Apch clsd ctc Cleveland ARTCC at 440-774-0223.**RADIO AIDS TO NAVIGATION:** NOTAM FILE CAK.**AKRON (L) (L) VOR/DME** 114.4 ACO Chan 91 N41°06.47' W81°12.09' 260° 26.0 NM to fld. 1197/4W.

DME unusable:

Byd 10 NM

**WELTZIEN SKYPARK** (15G) 3 W UTC-5(-4DT) N41°01.69' W81°47.89'**DETROIT**

1210 B TPA-2000(790) NOTAM FILE CLE

RWY 03-21: H2410X37 (ASPH) LIRL(NSTD)**RWY 03:** PVASI(PSIL). Thld dsplcd 178'. Crops.**RWY 21:** PVASI(PSIL). Thld dsplcd 50'. Trees.**SERVICE:** S4 FUEL 100LL LGT Actvt nstd LIRL Rwy 03-21—CTAF. Nstd LIRL due to incor colors and mounting on 6" PVC pipe.**AIRPORT REMARKS:** Attended dawn-dusk. Birds and wildlife on and in/ov arpt. Pavement strength limit to 6500 pounds per arpt manager. Rwy 03-21 tgl NA.**AIRPORT MANAGER:** 330-573-6437**COMMUNICATIONS:** CTAF/UNICOM 123.05**CLEARANCE DELIVERY PHONE:** For CD ctc Cleveland Apch at 216-352-2323.