

## MILLBROOK

**SKY ACRES** (44N) 6 SW UTC-5(-4DT) N41°42.45' W73°44.28'

697 NOTAM FILE ISP

**RWY 17-35:** H3828X60 (ASPH) S-20 MIRL 1.3% up S

**RWY 17:** Trees.

**RWY 35:** PAPI(P2L)—GA 3.0° TCH 33'. Trees.

**SERVICE:** S4 FUEL 100LL **LGT** ACTIVATE MIRL Rwy 17-35; PAPI Rwy 35—122.8.

**AIRPORT REMARKS:** Attended 1300-2100Z±. Self-svc fuel avbl 24 hrs. Rwy 17-35 safety areas have 30' dropoffs sloping 20' from thld at both ends. Parallel twy not lgtd. PAPI Rwy 35 unusable 8° right of centerline. Cold temperature airport. Altitude correction required at or below -23C.

**AIRPORT MANAGER:** 845-677-5010

**COMMUNICATIONS:** CTAF/UNICOM 122.8

Ⓡ **NEW YORK APP/DEP CON** 132.75

**CLEARANCE DELIVERY PHONE:** For CD ctc New York Apch at 516-683-2448


**RADIO AIDS TO NAVIGATION:** NOTAM FILE ISP.

**KINGSTON (L) (L) VOR/DME** 117.6 IGN Chan 123 N41°39.93' W73°49.33' 068° 4.5 NM to fld. 581/12W.

VOR unusable:

045°-050° byd 35 NM blo 4,300'

070°-140° byd 30 NM blo 3,400'

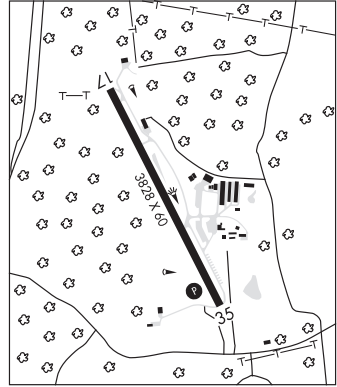

NEW YORK

L-33B, 34I

IAP

**MISSE** N44°51.25' W74°54.95' NOTAM FILE MSS.

**NDB (LOMW)** 278 MS 045° 5.8 NM to Massena Intl-Richards fld. 245/14W.

**MONTAUK** (MTP)(KMTP) 3 NE UTC-5(-4DT) N41°04.60' W71°55.23'

7 NOTAM FILE MTP

**RWY 06-24:** H3246X75 (ASPH) MIRL

**RWY 06:** PAPI(P2R)—GA 3.83° TCH 45'. Thld dspld 302'. Trees.

**RWY 24:** PAPI(P2L)—GA 4.0° TCH 24'. Thld dspld 668'. Hill. Rgt tfc.

**SERVICE:** **LGT** ACTVT MIRL and PAPI Rwy 06-24—121.7. PAPI Rwy 06 temporarily OTS.

**NOISE:** Noise abatement, Rwy 24 dep, right turn ASAP.

**AIRPORT REMARKS:** Attended 15 Apr-Oct dalgt hrs. Deer on or invof arpt.

PPR hel opns SS-SR; call amgr 631-668-3738. PPR jet acft; call amgr 631-668-3738. Helicopters call for prior permission to lnd on ramp area. No touch and goes Rwy 06-24. Rwy 06 18' brush along rwy edge 90' left, 30' pole 400' from thld 79' left, 31' pole 216' from rwy thld 233' right. Rwy 06, 26' tree 382' from thld 21' left, 25'-32' trees 180'-255' from thld 60'-90' left, 11'-17' trees 225'-270' from thld 4'-95' right. Rwy 24, 21' brush along rwy edge 87' rgt. Ldg fee.

**AIRPORT MANAGER:** 631-609-0932

**COMMUNICATIONS:** CTAF/UNICOM 122.7

Ⓡ **NEW YORK APP CON** 125.975

Ⓡ **PROVIDENCE DEP CON** 125.75 (Sun-Fri 1030-0530Z±, Sat

1030-0500Z±) other times ctc

Ⓡ **BOSTON CENTER DEP CON** 124.85

**CLEARANCE DELIVERY PHONE:** For CD ctc Providence Apch at 401-738-8945, when Apch clsd ctc Boston ARTCC at 603-879-6859.

**RADIO AIDS TO NAVIGATION:** NOTAM FILE HTO.

**HAMPTON (H) (H) VORTACW** 113.6 HTO Chan 83 N40°55.14' W72°19.00' 075° 20.3 NM to fld. 22/13W.

DME unusable:

280°-325° byd 35 NM blo 1,700'

326°-355° byd 30 NM blo 2,000'

TACAN AZIMUTH unusable:


280°-325° byd 35 NM blo 1,700'

326°-355° byd 30 NM blo 2,000'

VOR unusable:

010°-240°

270°-332°

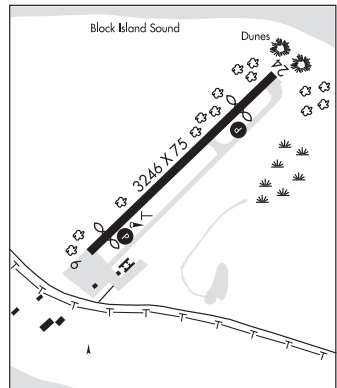

NEW YORK

COPTER

L-33C

IAP