

CONTINUED FROM PRECEDING PAGE

RADIO AIDS TO NAVIGATION: NOTAM FILE FKN.

FRANKLIN (L) (L) VORTACW 110.6 FKN Chan 43 N36°42.85' W77°00.74' 104° 20.0 NM to fld. 84/9W.

VOR unusable:

090°-119° byd 18 NM blo 2,000'

119°-128° byd 10 NM

129°-134° byd 33 NM

135°-148°

TACAN AZIMUTH unusable:

090°-139°

DME unusable:

090°-139°

LOC/DME 109.95 I-RKH Chan 36(Y) Rwy 04.

TANGIER ISLAND (TGI)(KTGI) 1 W UTC-5(-4DT) N37°49.55' W75°59.86'

WASHINGTON

5 B TPA—See Remarks NOTAM FILE DCA

L-34E, 36I

RWY 02-20: H2426X75 (ASPH) S-12.5

IAP

RWY 02: Tree. Rgt tfc.

RWY 20: Thld dsplcd 183'. Road.

SERVICE: LGT Arprt bcn OTS indef.

AIRPORT REMARKS: Attended Apr-Oct Sat-Sun 1300-2130Z±. Arprt closed SS-SR daily. Be alert: rstd area one mi west of arprt; hi-speed acft drop bombs & fire live ammunition in area. PAEW adjacent to all rwys, twys & ramps. TPA-605(600) lgt acft, 1505(1500) hvy acft. Rwy end 02: prev rwy nrs vsb on former rwy pavement. Chevrons on former rwy pavement poor. Rwy centerline poor. Rwy end 20: twy lead-in lines poor. Rwy centerline poor. Landing/parking fee to help pay for rwy rehab. Ldg fee.

AIRPORT MANAGER: 757-891-2496


WEATHER DATA SOURCES: AWOS-3 119.8 (757) 891-2246.

COMMUNICATIONS: CTAF/UNICOM 122.8

Ⓡ PATUXENT APP/DEP CON 121.0 (1200-0400Z± Mon-Sun. Other times by NOTAM) other times ctc

Ⓡ POTOMAC APP/DEP CON 127.2

CLEARANCE DELIVERY PHONE: For CD ctc Patuxent Apch at 301-342-3740, when Patuxent Apch is clsd ctc Potomac Apch at 866-640-4124.

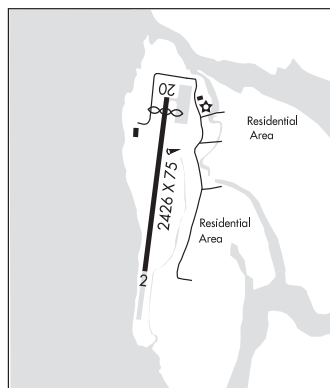

RADIO AIDS TO NAVIGATION: NOTAM FILE DCA.

CAPE CHARLES (L) (L) VORTACW 112.2 CCV Chan 59 N37°20.85' W75°59.86' 010° 28.7 NM to fld. 10/10W.

TACAN AZIMUTH unusable:

005°-015° byd 20 NM blo 4,000'

VOR unusable:

137°-322° byd 17 NM blo 2,000'

137°-322° byd 22 NM blo 3,000'

DME unusable:

005°-015° byd 20 NM blo 4,000'

TAPPAHANNOCK/ESSEX CO (XSA)(KXSA) 5 S UTC-5(-4DT) N37°51.58' W76°53.65'

WASHINGTON

135 B NOTAM FILE XSA

L-34E, 36I

RWY 10-28: H4300X75 (ASPH) S-12.5 MIRL

IAP

RWY 10: REIL. PAPI(P2L)—GA 3.0° TCH 40'. Trees.

RWY 28: REIL. PAPI(P2L)—GA 3.0° TCH 40'. Trees.

SERVICE: S4 FUEL 100LL, JET A LGT ACTIVATE MIRL Rwy 10-28 and PAPI Rwy 10 and Rwy 28 and rotating bcn—CTAF.

AIRPORT REMARKS: Attended Nov-Feb 1300-2300Z±. Mar-Oct 1400-0000Z±. Deer and other wildlife on and invof arprt.

AIRPORT MANAGER: 804-443-5885

WEATHER DATA SOURCES: AWOS-3 125.775 (804) 445-8724.

COMMUNICATIONS: CTAF/UNICOM 122.8

Ⓡ POTOMAC APP/DEP CON 126.4

CLEARANCE DELIVERY PHONE: For CD ctc Potomac Apch at 866-640-4124.

RADIO AIDS TO NAVIGATION: NOTAM FILE RIC.

RICHMOND (H) (H) VORTACW 114.1 RIC Chan 88 N37°30.14'

W77°19.22' 052° 29.5 NM to fld. 158/9W.

TAC AZM unusable:

060°-075° byd 10 NM blo 1,700'

