

ELLENDALE MUNI (4E7) 1 NE UTC-6(-5DT) N46°00.98' W98°30.94'

TWIN CITIES

1457 B NOTAM FILE GFK

L-14G

Rwy 13-31: H3499X60 (ASPH) S-12.5 MIRL

IAP

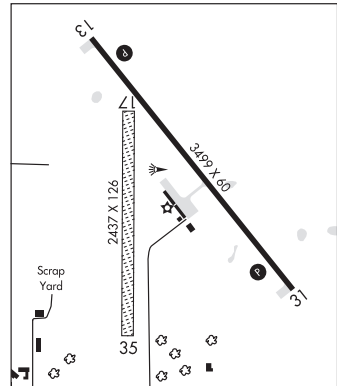
Rwy 13: PAPI(P2L)—GA 3.0° TCH 20'.**Rwy 31:** PAPI(P2L)—GA 3.0° TCH 20'.**Rwy 17-35:** 2437X126 (TURF)**SERVICE:** FUEL 100LL LGT ACTVT MIRL Rwy 13-31; PAPI Rwy 13 and 31—CTAF.**AIRPORT REMARKS:** Unattended. Birds and deer invof arpt. Rwy 17-35 CLOSED drg winter months due to lack of snow removal. 100LL self svc fuel avbl H24 via credit card. For rwy conds drg winter months call amgr at 701-830-0143. Rwy 31 +60' ant 1720' fm thld 340' L of extdd cntrln.**AIRPORT MANAGER:** 701-830-0143**COMMUNICATIONS:** CTAF 122.9

® MINNEAPOLIS CENTER APP/DEP CON 124.2

CLEARANCE DELIVERY PHONE: For CD ctc Minneapolis ARTCC at 651-463-5588.**RADIO AIDS TO NAVIGATION:** NOTAM FILE ABR.**ABERDEEN (VH) (DH) VOR/DME** 113.0 ABR Chan 77 N45°25.04' W98°22.12' 343° 36.5 NM to fld. 1303/7E.

VOR unusable:

040°-065° byd 40 NM blo 18,000'

**ENDERLIN****SKY HAVEN** (5N4) 1 W UTC-6(-5DT) N46°37.61' W97°37.21'

TWIN CITIES

1151 TPA-1804(653) NOTAM FILE GFK

Rwy 12-30: H2855X40 (ASPH) S-8 LIRL 0.3% up NW**Rwy 12:** Road.**SERVICE:** FUEL 100LL LGT ACTVT LIRL Rwy 12-30—CTAF. Rwy 12-30 thld lgts 86' outside Rwy 30 end, edge lgts 28' from rwy edges.**AIRPORT REMARKS:** Unattended. Birds and deer on and invof arpt. Confirm winter conds and snow removal with arpt manager at 701-799-6082. Electrical hookup for acft for wintertime use next to pilot lounge.**AIRPORT MANAGER:** 701-799-6082**COMMUNICATIONS:** CTAF 122.9**CLEARANCE DELIVERY PHONE:** For CD ctc Minneapolis ARTCC at 651-463-5588.