

CALHAN (5V4) 1 N UTC-7(-6DT) N39°02.90' W104°17.58'
 6450 TPA—7250(800) NOTAM FILE DEN
RWY 17-35: 4565X50 (TURF-GRVL) LIRL(NSTD)

DENVER

RWY 17: TRCV(TRIL). Road.
RWY 35: Trees. Rgt tfc.

SERVICE: S2 LGT Rwy 17-35 NSTD LIRL, north 3000' rwy lgt. ACTIVATE NSTD LIRL Rwy 17-35 and VASI Rwy 17 CTAF.
AIRPORT REMARKS: Attended irregularly. Vehicles crossing rwy. Rwy 17-35 width varies from 50' to 100'. Rwy 17 first 1250' 45' wide artificial turf. Be alert, intensive USAF student training invof Colorado Springs and Pueblo Colorado. Aerobatic practice area 1/2 mile west of Rwy 17-35 300' AGL to 10,000' MSL. South end rwy has side slope. -6' ditch 40' west of centerline. Ground raises on east side of rwy. Rwy 17 has 25' P-pole 400' from thld, 110' R of centerline. Rwy 17-35 has +15' road 110' from and parallel to rwy centerline W side of rwy full length. Rwy 35 has +4' fence 200' from thld obstruction, aprx +20' trees 70' west of centerline for first 500' of rwy, approx +25' P-line 850' from thld obstruction, aprx 2' burn at rwy thld. See Special Notices—USAF 306 FTG Flight Training Areas, Vicinity of Colorado Springs and Pueblo Colorado.

AIRPORT MANAGER: 719-338-2149

COMMUNICATIONS: CTAF/UNICOM 122.725

CLEARANCE DELIVERY PHONE: For CD ctc Colorado Springs Apch at 719-556-9105.

CANON CITY

FREMONT CO (1V6) 6 E UTC-7(-6DT) N38°25.71' W105°06.41'
 5442 B TPA—6500(1058) NOTAM FILE DEN
RWY 11-29: H5399X75 (ASPH) S-26, D-26 MIRL 1.1% up NW

DENVER

H-3F, 5A, L-10F

IAF

RWY 11: REIL. PAPI(P2L)—GA 3.0° TCH 23'.
RWY 29: REIL. PAPI(P2L)—GA 3.0° TCH 40'.

RWY 17-35: 1800X35 (TURF-GRVL) 1.2% up N
RWY 17: Bldg.

SERVICE: S4 FUEL 100LL, JETA A, 1, 2 LGT ACTVT REIL Rwy 11 and Rwy 29, PAPI Rwy 11 and Rwy 29, MIRL Rwy 11-29—CTAF. Apron areas lgt.

AIRPORT REMARKS: Attended 1500-0000Z†. Parachute Jumping. Gldr ops and towing on and invof arpt. CTN: USAF student trng invof Colorado Springs and Pueblo Arpt. Rwy 17, +32' hngr 1495' fm thr 100' R of extndd cntrln. Rwy 17 has a 20' building 66' left of rwy centerline, 105' remaining from rwy end. 2 ft trm W of Rwy 17-35 and first 250 ft S of Rwy 11-29. Rwy 17-35 crosses asph twy and rwy. Rwy 17-35 vrbl 35' to 45'. Rwy 17-35 prairie dog holes thrut. Paved twys mkd with blue and white reflectors. See Special Notices—USAF 306 FTG Flight Training Areas, Vicinity of Colorado Springs and Pueblo Colorado.

AIRPORT MANAGER: 719-784-3816

WEATHER DATA SOURCES: AWOS-3 120.025 (719) 784-2014.

COMMUNICATIONS: CTAF/UNICOM 122.8

Ⓡ DENVER APP/DEP CON 120.1 (1300-0500Z†)

Ⓡ DENVER CENTER APP/DEP CON 128.375 (0500-1300Z†)


CLEARANCE DELIVERY PHONE: For CD ctc Denver Apch at 303-342-1916.

RADIO AIDS TO NAVIGATION: NOTAM FILE PUB.

PUEBLO (VH) (H) VORTACW 116.7 PUB Chan 114 N38°17.66' W104°25.77' 276° 33.0 NM to fld. 4756/8E.

VOR unusable:

- 000°-030° byd 40 NM
- 215°-227° byd 40 NM blo 16,000'
- 215°-227° byd 62 NM
- 228°-240° byd 40 NM blo 18,000'
- 280°-340° byd 40 NM
- 341°-348° byd 40 NM blo 18,000'
- 349°-359° byd 40 NM blo 9,000'
- 349°-359° byd 61 NM

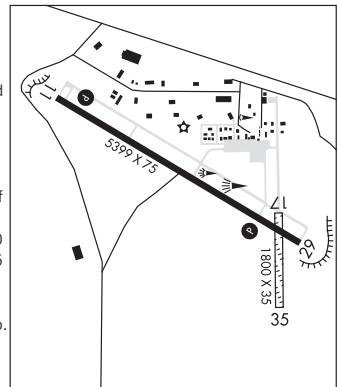

CENTENNIAL (See DENVER on page 329)