

LEADVILLE

LAKE CO (LXV)(KLXV) 2 SW UTC-7(-6DT) N39°13.17' W106°18.99'

DENVER
H-3F, 5A, L-9E
IAP

9934 B NOTAM FILE LXV

RWY 16-34: H6400X75 (ASPH) S-20, D-20 MIRL

RWY 16: PAPI(P2L)—GA 3.0° TCH 45'. Rgt tfc.

RWY 34: PAPI(P2L)—GA 3.0° TCH 45'.

SERVICE: FUEL 100LL, JET A LGT ACTVT PAPI RWY 16 and RWY 34;
MIRL RWY 16-34—CTAF.

AIRPORT REMARKS: Attended May-Sep 1430-2330Z, Oct-Apr
1500-2330Z. PPR for svc after hrs call 719-427-0026. Rwy 34 has
+50' power lines 750' from right of thld. Twy C and old ramp have
potholes and loose aggregate. All twys and new ramp area marked with
blue and white reflectors.

AIRPORT MANAGER: 719-486-0307

WEATHER DATA SOURCES: ASOS 118.375 (719) 486-8441.

COMMUNICATIONS: CTAF/UNICOM 122.8

Ⓡ DENVER CENTER APP/DEP CON 119.85


CLEARANCE DELIVERY PHONE: For CD ctc Denver ARTCC at 303-651-4257.

RADIO AIDS TO NAVIGATION: NOTAM FILE DEN.

RED TABLE (VH) (DH) VORW/DME 113.0 DBL Chan 77 N39°26.36'
W106°53.68' 104° 30.0 NM to fld. 11800/12E.


VOR unusable:

- 040°-056° byd 40 NM
- 057°-074° byd 40 NM blo 16,300'
- 057°-074° byd 65 NM
- 075°-100° byd 40 NM
- 115°-130° byd 40 NM
- 160°-200° byd 40 NM



HELIPAD H1: H150X100 (ASPH-CONC)

HELIPAD REMARKS: Helipad H1 has 20-30 ft trees 130 ft east of pad. Helipad H1 has 6-8 inch lip all around edges, concrete
has longitudinal and corner cracking.

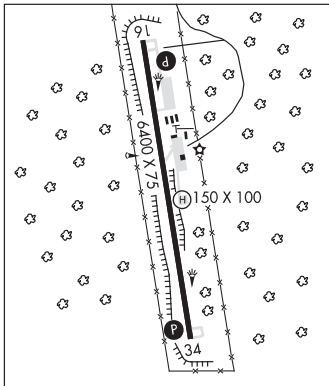

LIMON MUNI (LIC)(KLIC) 1 NE UTC-7(-6DT) N39°16.49' W103°39.95'

WICHITA
L-10F
IAP

5374 B NOTAM FILE LIC

RWY 16-34: H4700X60 (CONC) S-12.5 MIRL 0.5% up N

RWY 16: PAPI(P2L)—GA 3.0° TCH 39'.

RWY 34: PAPI(P2L)—GA 3.0° TCH 39'.

SERVICE: S2 FUEL 100LL LGT ACTVT PAPI Rwy 16 and Rwy 34;
MIRL Rwy 16-34—CTAF.

AIRPORT REMARKS: Unattended. 100LL: avbl H24 with credit card. Deer
on and invof arpt. CTN: Unctld vehicle aces. CTN: Mil student trng
invof Colorado Springs and Pueblo, Colorado. Rwy 34 +18 ft road
820 ft fm thr ob; +4 ft fence 785 ft fm thr ob; +22 ft sign 918 ft fm
rwy end on cntrln; +45 ft trees 1430 ft fm rwy end ob; +51 ft tank
1455 ft fm thr 150 ft R of cntrln. 3000 ft twy leading to S end of Rwy
16. Twy mkd with blue reflectors. PAJA on and invof arpt; midfield ovr
fit NA. See Special Notices—USAF 306 FTG Flight Training Areas,
Vicinity of Colorado Springs and Pueblo Colorado.

AIRPORT MANAGER: 719-775-2346

WEATHER DATA SOURCES: ASOS 121.125 (719) 775-0515.

COMMUNICATIONS: CTAF 122.9

DENVER CENTER APP/DEP CON 133.4

RCO 122.3 (DENVER RADIO)

CLEARANCE DELIVERY PHONE: For CD if una to ctc on FSS freq, ctc Denver
ARTCC at 303-651-4257.

RADIO AIDS TO NAVIGATION: NOTAM FILE DEN.

HUGO (VH) (H) VORW/DME 112.1 HGO Chan 58 N38°49.05' W103°37.28' 349° 27.5 NM to fld. 5233/7E.

VOR unusable:

- 272°-332° byd 40 NM
- 333°-351° byd 40 NM blo 9,000'
- 333°-351° byd 60 NM

