

EASTOVER, SOUTH CAROLINA

|                                              |                         |                                                    |
|----------------------------------------------|-------------------------|----------------------------------------------------|
| VORTAC MMT<br><b>113.2</b><br>Chan <b>79</b> | APCH CRS<br><b>328°</b> | Rwy Idg<br>TDZE <b>243</b><br>Arpt Elev <b>254</b> |
|----------------------------------------------|-------------------------|----------------------------------------------------|


AL-951 [USAF]

HI-TACAN RWY 32

MC ENTIRE JNGB (KMMT)

|                                                                     |               |                                                                                                                                               |
|---------------------------------------------------------------------|---------------|-----------------------------------------------------------------------------------------------------------------------------------------------|
| <p>✦ * When ALS inop, increase CAT CDE RVR 60, vis to 1½ miles.</p> | <p>ALSF-1</p> | <p>† MISSED APPROACH: Climb to 1100 direct MORRL/1 DME then climbing right turn to 3100 intercept MMT R-058 direct JOGSA/12 DME and hold.</p> |
|---------------------------------------------------------------------|---------------|-----------------------------------------------------------------------------------------------------------------------------------------------|

|                                 |                                            |                                                |                                           |
|---------------------------------|--------------------------------------------|------------------------------------------------|-------------------------------------------|
| <p>ATIS ★<br/><b>327.05</b></p> | <p>SHAW APP CON<br/><b>125.4 318.1</b></p> | <p>TOWER ★<br/><b>132.4 (CTAF) 0 253.5</b></p> | <p>GND CON<br/><b>127.625 226.675</b></p> |
|---------------------------------|--------------------------------------------|------------------------------------------------|-------------------------------------------|

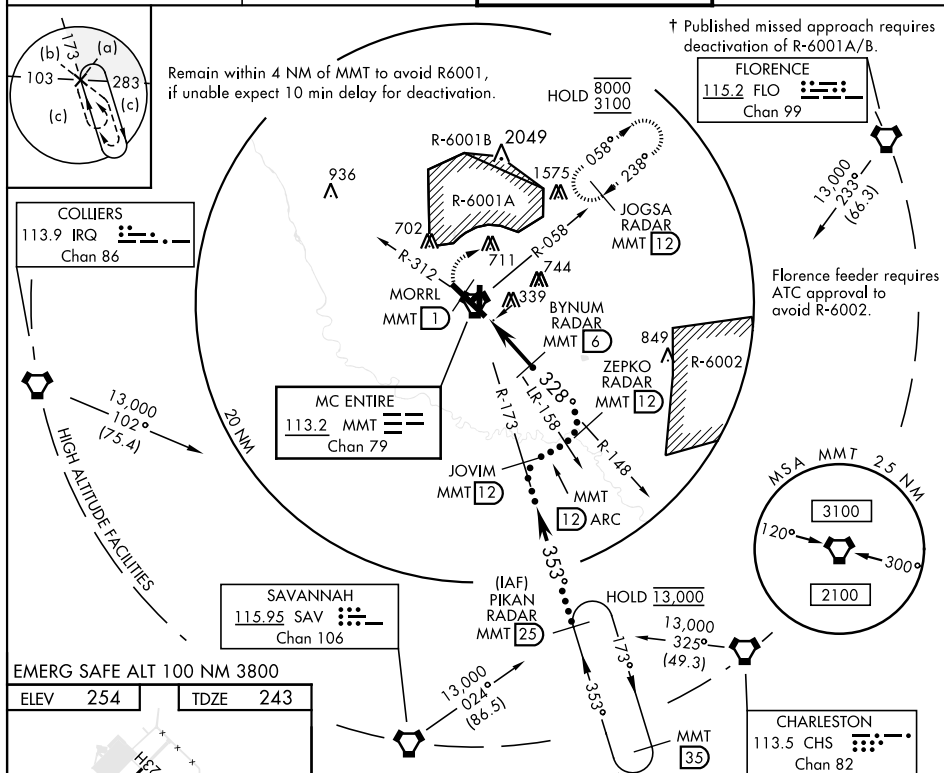

|                |                        |                        |                         |
|----------------|------------------------|------------------------|-------------------------|
| 1100 MORRL 1.5 | 3100 MMT R-058         | JOGSA MMT 12           | PIKAN RADAR 25          |
| VORTAC         | HUTEM 1.5              | BYNUM RADAR 6          | ZEPKO RADAR 12          |
| JOGSA MMT 12   | JOVIM 12               | PIKAN RADAR 25         | 13,000                  |
| 328°           | 328°                   | 355°                   | 13,000                  |
| 1700           | 2000                   | 3500                   | 2.67° TCH 48            |
| 0.5            | 4.5 NM                 | Arc                    |                         |
| CATEGORY       | C                      | D                      | E                       |
| S-32 *         | 640/40                 | 397                    | (400-¾)                 |
| CIRCLING       | 880-1¾<br>626 (700-1¾) | 940-2¼<br>686 (700-2¼) | 1020-2¾<br>766 (800-2¾) |

EASTOVER, SOUTH CAROLINA

33°55'N-80°48'W

MC ENTIRE JNGB (KMMT)

Amdt 4 25MAY17

HI-TACAN RWY 32