

LOC/DME I-BXP 110.15 Chan 38 (Y)	APP CRS 173°	Rwy ldg 12000 TDZE 5339 Apt Elev 5434
--	------------------------	--

ILS or LOC RWY 17L

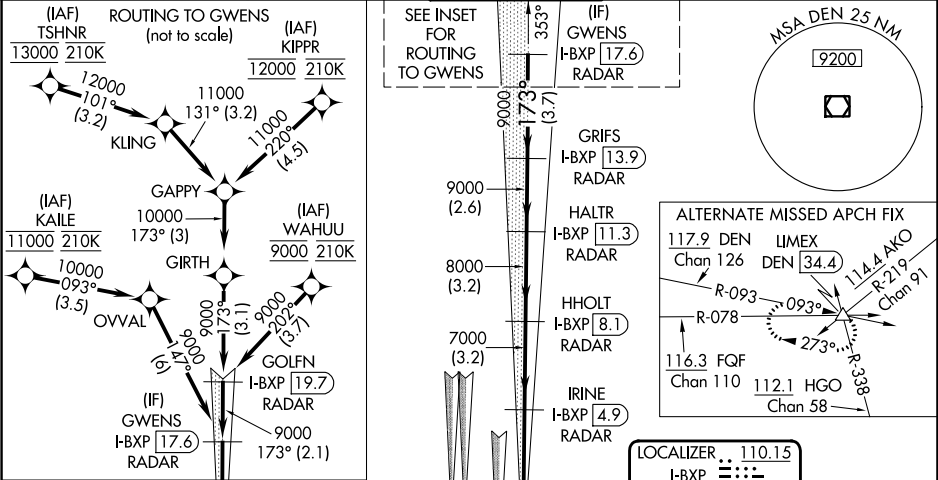
DENVER INTL (DEN)

▼ For inoperative MALSR, increase S-LOC Cts C/D visibility to RVR 4500.
S-LOC 17L DME or RADAR required. Simultaneous approaches
authorized with Rwy 17R and 16L/16R.
RVR 1800 authorized with the use of FD or AP or HUD to DA.

MALSR

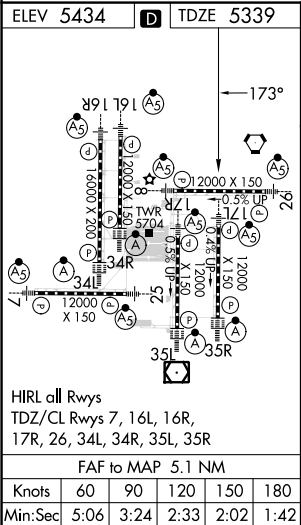

MISSED APPROACH: Climb to 5900
then climbing left turn to 10000 on
heading 120° and FQF VORTAC R-078
to UMEX INT/FQF 31.9 DME and hold.

D-ATIS ARR 125.6 379.9 DEP 134.025	DENVER APP CON 119.3 307.3 120.35 379.3 (NORTH) (SOUTH)	DENVER TOWER 132.35 239.275	GND CON 121.85 377.1	CLNC DEL 118.75	CPDLC
--	--	---------------------------------------	--------------------------------	---------------------------	-------



A 5824

DENVER
117.9 DEN
Chan 126



RADAR or GPS
REQUIRED

