

WEIRWOOD**CAMPBELL FLD** (9VG) 1 W UTC-5(-4DT) N37°27.51' W75°52.73'

WASHINGTON

40 NOTAM FILE DCA

RWY 03-21: 3000X100 (TURF)**RWY 03:** P-line.**RWY 21:** Road.**RWY 14-32:** 1455X140 (TURF)**RWY 14:** Road.**RWY 32:** Trees.**AIRPORT REMARKS:** Attended Mar-Nov dalgt hours. Be alert: 60' P-lines located 300' southwest off the AER 03.**AIRPORT MANAGER:** 914-772-6242**COMMUNICATIONS:** CTAF 122.9**CLEARANCE DELIVERY PHONE:** For CD ctc Norfolk Apch at 757-464-0757.**WEST POINT****MIDDLE PENINSULA RGNL** (FYJ)(KFYJ) 2 SE UTC-5(-4DT) N37°31.28' W76°45.77'

WASHINGTON

20 B TPA—See Remarks NOTAM FILE FYJ

H-10H, 12I, L-34E, 36H

RWY 10-28: H5000X75 (ASPH) S-30, D-50, 2D-85 MIRL

IAP

RWY 10: REIL. PAPI(P2L)—GA 3.5° TCH 53'. Tree.**RWY 28:** REIL. PAPI(P2L)—GA 3.5° TCH 53'. Trees.**SERVICE:** S4 **FUEL** 100LL, JET A+ **LGT** MIRL Rwy 10-28, REIL Rwy 10 and Rwy 28 opr SS-SR. During daylight hrs, PCL avbl upon req, ctc amgr 804-785-9725. **ACTIVATE** MIRL Rwy 10-28, REIL Rwy 10 and Rwy 28—CTAF.**AIRPORT REMARKS:** Attended 1300-2200Z†. Full and self-serve fuel avbl.

Parachute Jumping weekends only. Deer on and invof arpt.

TPA—820(800) light acft, 1520(1500) heavy acft. Rotor-wing and tiltrotor acft fly tfc pats south of Rwy 10-28 at 800' AGL or abv. Rwy 10 non-std marking placement.

AIRPORT MANAGER: 804-785-9725**WEATHER DATA SOURCES:** AWOS-3 132.825 (804) 785-2307.**COMMUNICATIONS:** CTAF/UNICOM 123.0® **POTOMAC APP/DEP CON** 126.75**CLEARANCE DELIVERY PHONE:** For CD ctc Norfolk Apch at 757-464-0757.**RADIO AIDS TO NAVIGATION:** NOTAM FILE DCA.**HARCUM (L) (L) VORTACW** 108.8 HCM Chan 25 N37°26.92'

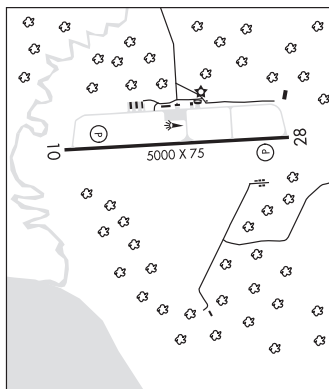
W76°42.68' 338° 5.0 NM to fld. 8/7W.

VOR unusable:

056°-095° blo 2,000'

174

275°-300° blo 2,000'

LOC/DME 109.55 I-FYJ Chan 32(Y) Rwy 10.**WILLIAM M TUCK** (See SOUTH BOSTON on page 381)