

SEATTLE PAINE FLD INTL (See EVERETT on page 234)

SEATTLE

SEKIU (11S) 0 NW UTC-8(-7DT) N48°15.97' W124°18.84'

355 B NOTAM FILE SEA

RWY 08-26: H2997X50 (ASPH) LIRL

RWY 08: Thld dsplcd 900'. Trees.

RWY 26: VASI(NSTD)—GA 4.0° TCH 35'. Tree.

SERVICE: LGT SS-SR.

AIRPORT REMARKS: Unattended. Deer on and invof arpt Sep-Mar. High ridge along N side of rwy. Turbulence on E end apch over water. Difficult apch when wind from N. Rwy 26 NSTD VASI 2 box VASI left side ngts only. Rwy 08-26 wdpsr alligator and block cracking.

AIRPORT MANAGER: (360) 417-3376

COMMUNICATIONS: CTAF 122.9

CLEARANCE DELIVERY PHONE: For CD ctc Seattle ARTCC at 253-351-3694.

SEQUIM VALLEY (W28) 4 NW UTC-8(-7DT) N48°05.88' W123°11.28'

SEATTLE

L-1E

151 B NOTAM FILE SEA

RWY 09-27: H3508X40 (ASPH) LIRL

RWY 09: Trees. Rgt tfc.

RWY 27: Trees.

SERVICE: FUEL 100LL

AIRPORT REMARKS: Unattended. Self svc fuel avbl 24 hrs. Wildlife on and invof arpt. Rwy 09-27 has 2 inch shoulder dropoff. Ldg fee.

AIRPORT MANAGER: 360-670-3083

COMMUNICATIONS: CTAF/UNICOM 122.7

CLEARANCE DELIVERY PHONE: For CD ctc Whidbey Apch at 360-257-3310.

RADIO AIDS TO NAVIGATION: NOTAM FILE SEA.

TATOOSH (VH) (H) VORTACW 112.2 TOU Chan 59 N48°17.99'

W124°37.62' 079° 59.0 NM to fld. 1650/22E.

VOR unusable:

020°-025° byd 40 NM


085°-090° byd 40 NM

091°-101° byd 40 NM blo 15,000'

091°-101° byd 58 NM

103°-109° byd 40 NM

356°-360° byd 40 NM

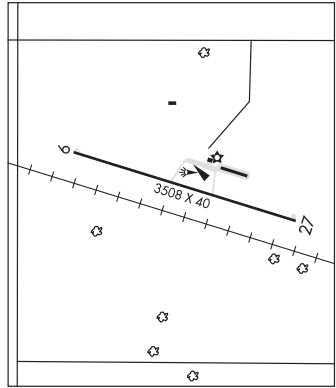

SHADY ACRES (See SPANAWAY on page 275)