

HATTERAS**BILLY MITCHELL** (HSE)(KHSE) 4 E UTC-5(-4DT) N35°13.97' W75°37.07'

CHARLOTTE

16 NOTAM FILE HSE

L-35C

RWY 07-25: H3002X75 (ASPH) S-30

IAP

RWY 07: Brush.**RWY 25:** Tree.

AIRPORT REMARKS: Unattended. Arpt CLOSED 30 min after SS until 30 min before SR. All ngt time ops prohibited. Flocks of seagulls on and in/ov arpt. High speed low-level mil ops in/ov arpt. Arpt located in Cape Hatteras National Seashore. Maintain 2000' vertical and horizontal distance from seashore beaches. Additional acft parking avbl on mid-field apron. Rwy 07-25 safety area is loose sand and dunes—not suitable for acft. +10-35' sand dunes and scrub trees both of rwy within ROFA.

AIRPORT MANAGER: 252-475-9000**WEATHER DATA SOURCES:** ASOS 118.375 (252) 995-3646.**COMMUNICATIONS:** CTAF 122.9**HATTERAS RCO 122.3 (RALEIGH RADIO)**Ⓡ **CHERRY POINT APP/DEP CON 119.75****CLEARANCE DELIVERY PHONE:** For CD ctc Cherry Point Apch at 252-466-5960.**RADIO AIDS TO NAVIGATION:** NOTAM FILE ECG.**ELIZABETH CITY (L) (L) VORW/DME 115.75** ECG Chan 104(Y)

N36°15.45' W76°10.54' 163° 67.2 NM to fld. 7/7W.

DME unusable:

020°-140° byd 20 NM blo 3,000'

160°-200° byd 10 NM blo 3,000'

160°-200° byd 25 nm. blo 5,000'

290°-330° byd 18 NM blo 3,000'

290°-330° byd 25 NM blo 5,000'

324°-334° byd 28 NM

VOR unusable:

020°-140° byd 20 NM blo 3,000'

WRIGHT BROTHERS (T) (T) VORW/DME 111.6 RBX Chan 53 N35°55.23' W75°41.82' 183° 41.4 NM to fld.

10/8W. NOTAM FILE MQI. VOR/DME unmonitored 2300-1300Z.

VOR unusable:

281°-318° blo 8,000'

319 blo 4,000'

320°-280°

CHERRY POINT (L) TACAN Chan 75 NKT (112.8) N34°54.14' W76°52.49' 081° 65.0 NM to fld.

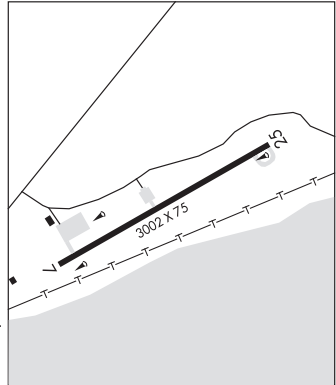
25/9W. NOTAM FILE RDU.

TACAN AZIMUTH unusable:

052°-060° byd 10 NM blo 3,000'

061°-089° byd 6 NM blo 5,000'

090°-109° byd 10 NM blo 3,000'

**HATTERAS** N35°14.01' W75°37.06'

CHARLOTTE

RCO 122.3 (RALEIGH RADIO)

L-35C

HENDERSON/OXFORD (See OXFORD on page 348)