

23334

WAAS CH 78007 W33A	APP CRS 330°	Rwy Idg 11440 TDZE 163 Apt Elev 192
--	------------------------	--

RNAV (GPS) RWY 33
BANGOR INTL (BGR)

RNP APCH.



T Circling NA northeast of Rwy 15 and 33. For uncompensated Baro-VNAV systems, LNAV/VNAV NA below -18°C or above 54°C. For inop ALS, increase LPV Cat E visibility to RVR 4000, LNAV/VNAV Cat E visibility to RVR 5500, and LNAV Cat E visibility to 1¼ SM.
A **RVR 1800 authorized with use of FD or AP or HUD to DA.
ASR



MISSED APPROACH:
Climb to 3000 direct
IKEXE and hold.


ATIS 127.75	BANGOR APP CON 118.925 239.3	BANGOR TOWER 120.7 233.7	GND CON 121.9 348.6	CLNC DEL 135.9 348.6
----------------	---------------------------------	-----------------------------	------------------------	-------------------------

MISSED APCH FIX

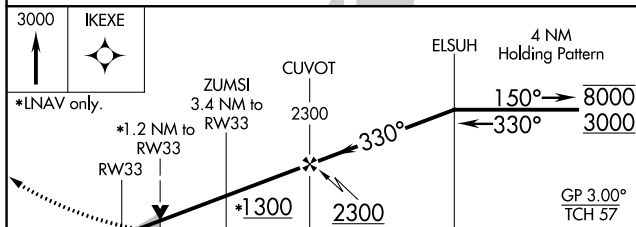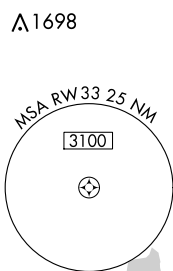

	1.2	2.2 NM	3.1 NM	8 NM		
CATEGORY	A	B	C	D	E	
LPV DA**	363/24 200 (200-½)					
LNAV/VNAV DA	519/30 356 (400-¾)					
LNAV MDA	600/24 437 (500-½)		600/40 437 (500-¾)			
C CIRCLING	640-1 448 (500-1)	720-1 528 (600-1)	740-1½ 548 (600-1½)	820-2 628 (700-2)	880-2½ 688 (700-2½)	

ELEV 192	D	TDZE 163
----------	----------	----------

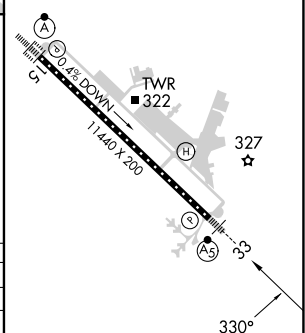

TDZ/CL Rwy 15
HIRL Rwy 15-33

BANGOR, MAINE
Amdt 1A 20JUN19

44°48'N-68°50'W

BANGOR INTL (BGR)
RNAV (GPS) RWY 33

NE-1, 21 MAR 2024 to 18 APR 2024