

TAMPA, FLORIDA




AL-416 (FAA)

24081

LOC/DME I-TPA	APP CRS	Rwy Idg	8300
110.3	187°	TDZE	26
Chan 40		Apt Elev	26

ILS RWY 19L (CAT II)
TAMPA INTL (TPA)

RADAR required for procedure entry.				ALSIF-2 	MISSED APPROACH: Climb to 600 then climbing left turn to 2800 on heading 160° and on PIE VORTAC R-138 to GIBBS INT/PIE 29.3 DME and hold.		
Simultaneous approach authorized. RVR 1000 authorized with specific OPSPEC, MSPEC, or LOA approval and use of autoland or HUD to touchdown.							
ARR	D-ATIS	DEP	TAMPA APP CON	TAMPA TOWER	GND CON	CLNC DEL	CPDLC
126.45	128.475		118.5 307.175	119.5 269.4	121.7 269.4	133.6	

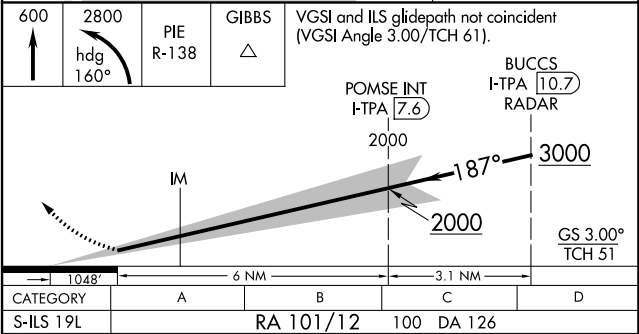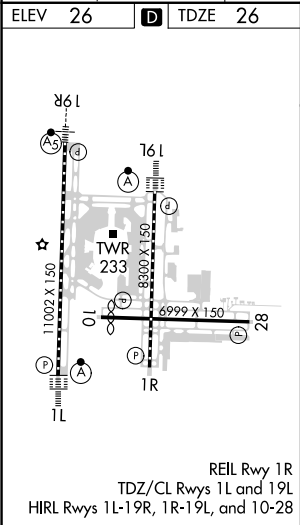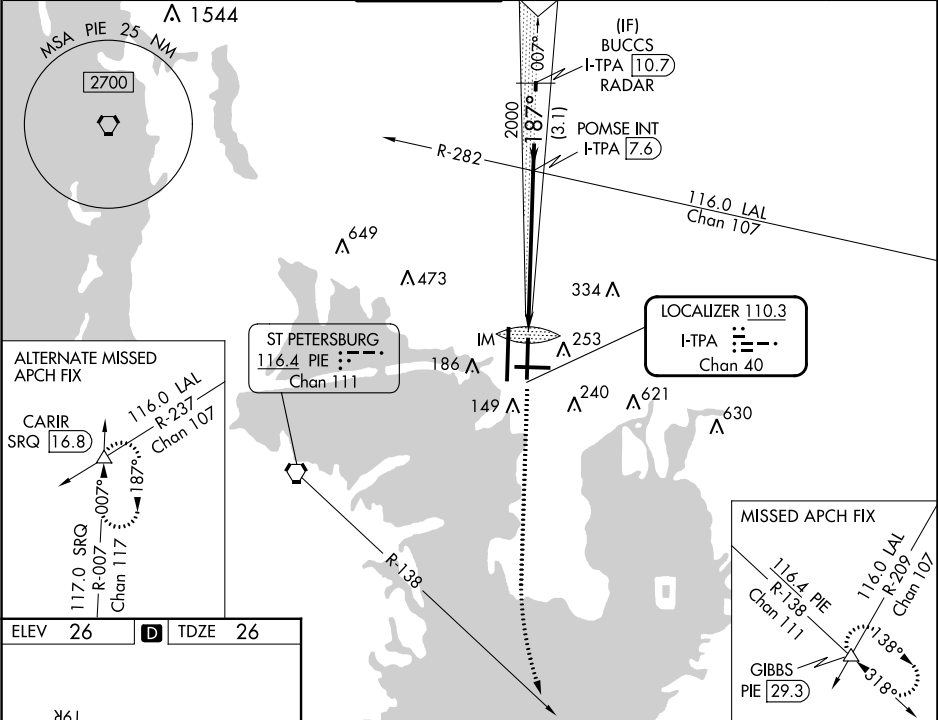

CATEGORY	A	B	C	D
S-ILS 19L	RA 101/12	100	DA 126	

CATEGORY II ILS - SPECIAL AIRCREW & AIRCRAFT CERTIFICATION REQUIRED

TAMPA, FLORIDA
Amdt 41 20APR23

27°59'N-82°32'W

TAMPA INTL (TPA)

ILS RWY 19L (CAT II)

SE-3, 21 MAR 2024 to 18 APR 2024

SE-3, 21 MAR 2024 to 18 APR 2024