

TAMPA, FLORIDA

AL-416 (FAA)

24081

LOC/DME I-TPA	APP CRS	Rwy Idg	8300
110.3	187°	TDZE	26
Chan 40		Apt Elev	26

ILS RWY 19L (SA CAT I)
TAMPA INTL (TPA)

RADAR required for procedure entry.

- ▼




Simultaneous approach authorized.
- ▲

Requires specific OPSPEC, MSPEC, or LOA approval.



MISSED APPROACH: Climb to 600 then climbing left turn to 2800 on heading 160° and on PIE VORTAC R-138 to GIBBS INT/PIE 29.3 DME and hold.

ARR	D-ATIS	DEP	TAMPA APP CON	TAMPA TOWER	GND CON	CLNC DEL	CPDLC
126.45	128.475		118.5 307.175	119.5 269.4	121.7 269.4	133.6	

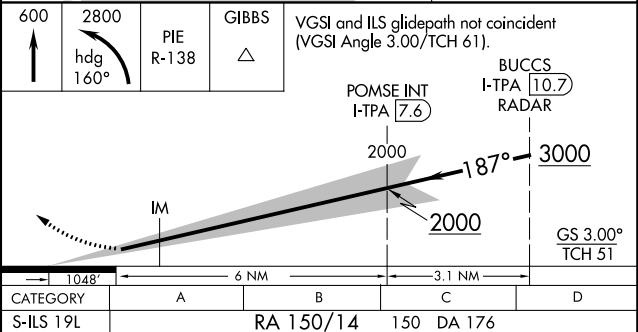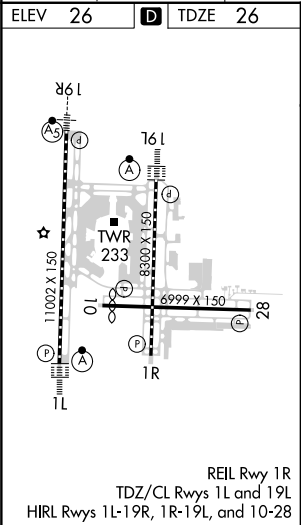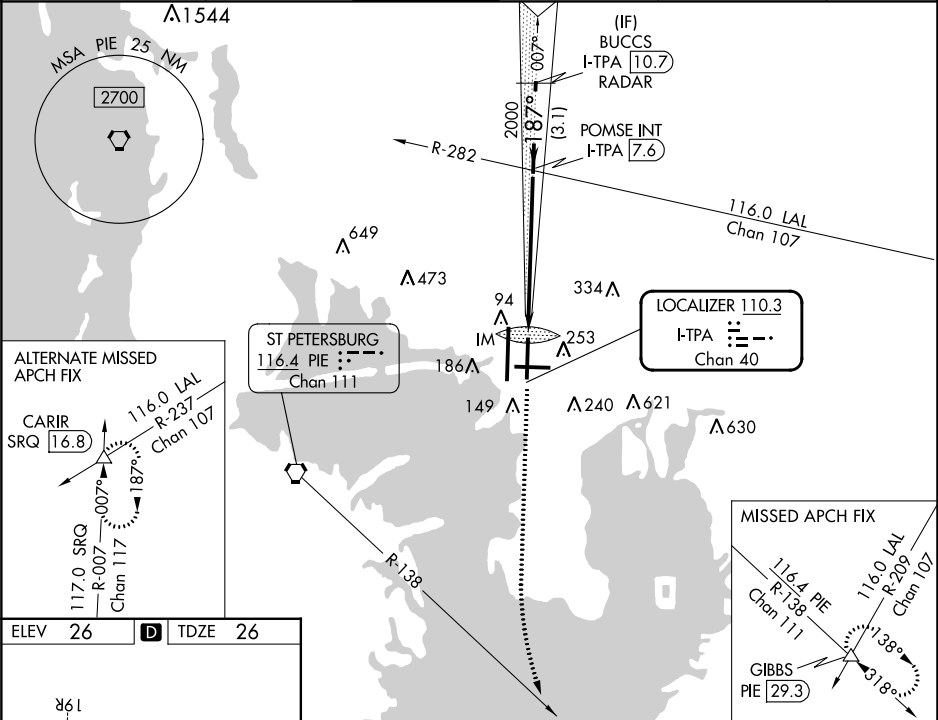

SA CATEGORY I ILS- SPECIAL AIRCREW
& AIRCRAFT CERTIFICATION REQUIRED

TAMPA, FLORIDA
Amdt 41 20APR23

27°59'N-82°32'W

TAMPA INTL (TPA)
ILS RWY 19L (SA CAT I)

SE-3, 21 MAR 2024 to 18 APR 2024

SE-3, 21 MAR 2024 to 18 APR 2024