

MUSKEGON CO (MKG)(KMKG) 4 S UTC-5(-4DT) N43°10.06' W86°14.13'CHICAGO
H-5E, 10F, L-281
IAP, AD

629 B ARFF Index—See Remarks NOTAM FILE MKG

RWY 06-24: H6501X150 (ASPH-PFC) S-120, D-250, 2S-175,
2D-497 PCN 62 F/A/X/T HIRL**RWY 06:** REIL. VASI(V4L)—GA 3.0° TCH 45'. Trees.**RWY 24:** MALSR. VASI(V4L)—GA 3.0° TCH 58'. Tree.**RWY 14-32:** H6100X150 (ASPH-PFC) S-120, D-230, 2S-165,
2D-430 PCN 56 F/A/X/T HIRL**RWY 14:** REIL. PAPI(P4L)—GA 3.0° TCH 45'. RVR-R**RWY 32:** MALSR. RVR-T**RUNWAY DECLARED DISTANCE INFORMATION****RWY 06:** TORA-6501 TODA-6501 ASDA-6501 LDA-6501**RWY 14:** TORA-6100 TODA-6100 ASDA-6100 LDA-6100**RWY 24:** TORA-6501 TODA-6501 ASDA-6100 LDA-6501**RWY 32:** TORA-6100 TODA-6100 ASDA-6100 LDA-6100**SERVICE:** S4 FUEL 100LL, JET A OX 2 LGT When ATCT clsd actv
MALSR Rwy 24; REIL Rwy 06; HIRL Rwy 06-24—CTAF. VASI Rwy
06 & 24 opr consly.**AIRPORT REMARKS:** Attended Nov-Mar, Mon-Fri 1100-0300Z‡,
Sat-Sun 1100-0200Z‡, Apr-Oct, Mon-Fri 1000-0200Z‡,
Sat-Sun 1000-0100Z‡. For svc aft hrs call FBO 231-798-2126.Deer and birds on and invof of arpt. Rwy 14-32 CLOSED dly
0400-1100Z‡. Class I, ARFF Index A. 24 hr PPR for ARFF Index

B svc and unsked acr ops grtr than 30 pax seats, call amgr 801-698-8187. Ldg fee.

AIRPORT MANAGER: 231-798-4596**WEATHER DATA SOURCES:** ASOS (231) 798-1317**COMMUNICATIONS:** CTAF 126.25 ATIS 124.3 UNICOM 122.95**RCO 122.5** (LANSING RADIO)Ⓡ **GREAT LAKES APP/DEP CON** 119.8 (North) 133.825 (South) (1030-0500Z‡)Ⓡ **CHICAGO CENTER APP/DEP CON** 132.275 (0500-1030Z‡)**TOWER** 126.25 (1100-0400Z‡) **GND CON** 121.6**CLEARANCE DELIVERY PHONE:** For CD when ATCT clsd ctc Great Lakes Apch at 269-459-3344, when Apch clsd ctc Chicago
ARTCC at 630-906-8921.**AIRSPACE:** CLASS D svc 1100-0400Z‡; other times CLASS E.**TRSA** svc ctc **APP CON****RADIO AIDS TO NAVIGATION:** NOTAM FILE MKG.(L) **TACAN** Chan 99 MKG (115.2) N43°10.16' W86°02.36' 270° 8.6 NM to fld. 659/1W.

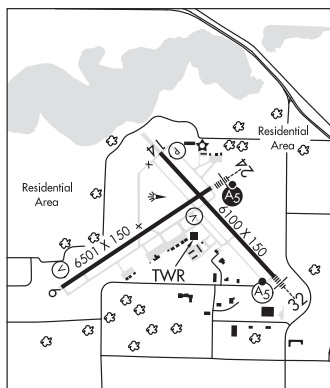
TACAN AZIMUTH unusable:

055°-090° byd 10 NM blo 4,000'

281°-360° byd 10 NM blo 8,000'

DME unusable:

281°-360° byd 10 NM blo 8,000'

ILS/DME 109.5 I-CJH Chan 32 Rwy 24. Class IA. ILS/DME unmonitored when ATCT clsd. Autopilot coupled
apchs NA below 1,150'. DME unusable byd 28° right of course.**ILS/DME** 109.9 I-MKG Chan 36 Rwy 32. Class IE. LOC and glideslope unmonitored when ATCT clsd.**ASR** (1100-0400Z‡)**NAPOLEON****NAPOLEON** (3NP) 1 NW UTC-5(-4DT) N42°10.26' W84°15.56'

DETROIT

963 NOTAM FILE LAN

RWY 09-27: 2740X200 (TURF)**RWY 09:** Tree.**RWY 27:** Tree.**RWY 15-33:** 2500X160 (TURF)**RWY 15:** Thld dsplcd 290'. Road.**RWY 33:** Thld dsplcd 550'. Bldg.**AIRPORT REMARKS:** Attended irregularly. Deer and lrg birds on and invof arpt. Ultralight ops in grass west of Rwy 15-33. Oil
tanks south of arpt. Rwy 09-27 and 15-33 not plowed in winter. Rwy 09-27 and 15-33 soft in spring. Rwy 09 dthr
1537', extds byd rwy midpt. Rwy 09-27 and Rwy 15-33 marked with 3' yellow cones; dthr mkd with 3 cones each side.**AIRPORT MANAGER:** 734-353-7900**COMMUNICATIONS:** CTAF 122.9**CLEARANCE DELIVERY PHONE:** For CD ctc Great Lakes Apch at 269-459-3345, when Apch clsd ctc Cleveland ARTCC at
440-774-0224/0490.