

DILLON (DLN)(KDLN) 4 NE UTC-7(-6DT) N45°15.32' W112°33.15'

5245 B NOTAM FILE DLN MON Airport

RWY 17-35: H6501X75 (ASPH) S-58, D-75, 2D-129 PCN 23 F/D/X/U

MIRL 1.4% up S

RWY 17: PAPI(P2L)—GA 3.0° TCH 37'.**RWY 35:** PAPI(P2L)—GA 3.0° TCH 24'.**RWY 04-22:** H3600X60 (ASPH) S-12.5 PCN 5 F/D/Y/U MIRL**RWY 04:** Road.**RWY 22:** PAPI(P2L)—GA 3.0° TCH 30'. Road.**SERVICE:** S4 FUEL 100LL, JET A LGT ACTVT PAPI Rwy 17, Rwy 22 and Rwy 35; MIRL Rwy 04-22 and Rwy 17-35—CTAF.**AIRPORT REMARKS:** Attended 1500-0000Z \ddagger . For aprt attendant after hrs call 406-683-5242 or 406-250-5280. Rwy visibility blocked by hngrs/bldgs on Rwy 17; confirm presence of other acct prior to tkof. All departures prohibited on Rwy 04 due to rwy visibility blocked by hngrs/bldgs. Rwy 17 1000 ft distance markers, Rwy 35 1000 ft distance markers.**AIRPORT MANAGER:** 406-683-5242**WEATHER DATA SOURCES:** ASOS 135.225 (406) 683-5470.**COMMUNICATIONS:** CTAF/UNICOM 122.8

RCO 122.2 (GREAT FALLS RADIO)

® SALT LAKE CENTER APP/DEP CON 132.4

CLEARANCE DELIVERY PHONE: For CD if una to ctc on FSS freq, ctc Salt Lake ARTCC at 801-320-2568.**AIRSPACE:** CLASS E.**RADIO AIDS TO NAVIGATION:** NOTAM FILE DLN.**(VH) (DH) VOR/DME** 113.0 DLN Chan 77 N45°14.91' W112°32.83' at fld. 5257/18E.

DME unusable:

045°-090° byd 30 NM blo 11,700'

090°-140° byd 30 NM blo 12,600'

140°-180° byd 30 NM blo 11,500'

275°-290° byd 30 NM blo 12,500'

VOR unusable:

016°-070° byd 40 NM

071°-081° byd 40 NM blo 15,000'

071°-081° byd 49 NM

082°-101° byd 40 NM

102°-112° byd 40 NM blo 15,000'


102°-112° byd 47 NM

113°-216° byd 40 NM

233°-257° byd 40 NM

266°-310° byd 40 NM

345°-353° byd 40 NM

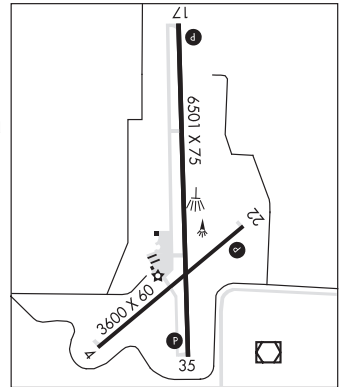

GREAT FALLS

H-ID, L-13C

IAP

DRUMMOND (M26) 3 SW UTC-7(-6DT) N46°37.25' W113°12.30'

4245 NOTAM FILE GTF

RWY 07-25: 2400X125 (TURF)**RWY 07:** Road.**RWY 25:** Bldg.**AIRPORT REMARKS:** Unattended. Rwy 07-25 extremely soft when wet. Snow removal irregular. Rwy 07-25 is a little rough due to bunch grass and rodent holes. Rwy 07-25 marked with white cones full rwy length.**AIRPORT MANAGER:** (406) 370-4178**COMMUNICATIONS:** CTAF 122.9

RCO 122.6 (GREAT FALLS RADIO)

GREAT FALLS

DUTTON (5U1) 1 E UTC-7(-6DT) N47°50.83' W111°41.90'

3699 B NOTAM FILE GTF

RWY 16-34: H3130X115 (ASPH-TURF) LIRL(NSTD) 1.1% up S**AIRPORT REMARKS:** Unattended. Snow removal intermittent. Rwy 16-34 2330 ft x 40 ft asph superimposed on Rwy 34 end cntr portion, remainder turf. Rwy 16-34 NSTD LIRL. Rwy edge lgts dspcd from Rwy 34 70' right, 55' left from rwy centerline. 2750' of rwy lgtd for ngt ops from dusk til dawn.**AIRPORT MANAGER:** (406) 788-5229**COMMUNICATIONS:** CTAF 122.9**CLEARANCE DELIVERY PHONE:** For CD ctc Great Falls Apch at 406-454-7555.

GREAT FALLS

EDGAR G OBIE (See CHINOOK on page 98)