

CRESWELL**HOBBY FLD** (77S) 1 NE UTC-8(-7DT) N43°55.85' W123°00.40'

541 B TPA-1406(865) NOTAM FILE MMV

RWY 16-34: H3102X60 (ASPH) S-12 MIRL**RWY 16:** Tree.**RWY 34:** Trees.**SERVICE:** S4 **FUEL** 100LL, JET A **LGT** ACTVT MIRL Rwy 16-34-CTAF.**AIRPORT REMARKS:** Attended Mon-Fri 1700-0200Z†, Sat-Sun 1900-0000Z†. Self serve fuel avbl 24 hrs. Birds on and invof arpt. Be aware mowing adj Rwy 16-34 wkdays. Parachute Jumping. Parachute jump area lctd east side of arpt. Be aware of skydivers crossing rwy. Ctc number for info and updates about skydiving ops, 541-895-3029. PAEW adj to Rwy 16-34 wkends 1600-0000Z†. Rwy 34 calm wind rwy.**AIRPORT MANAGER:** 541-895-2913**WEATHER DATA SOURCES:** AWOS-3 119.275 (541) 895-2349.**COMMUNICATIONS:** CTAF/UNICOM 122.7Ⓡ **CASCADE APP/DEP CON** 119.6 (1400-0730Z†)Ⓡ **SEATTLE CENTER APP/DEP CON** 125.8 (0730-1400Z†)**CLEARANCE DELIVERY PHONE:** For CD ctc Cascade Apch at 541-607-4674/4675, when Apch clsd ctc Seattle ARTCC at 253-351-3694.**RADIO AIDS TO NAVIGATION:** NOTAM FILE EUG.**EUGENE (VH) (H) VORTACW** 112.9 EUG Chan 76 N44°07.25' W123°13.37' 126° 14.8 NM to fld. 364/15E.

TACAN AZIMUTH unusable:

035°-055° byd 25 NM blo 9,400'

055°-075° byd 25 NM blo 9,000'

225°-230° byd 35 NM blo 5,500'

255°-295° byd 35 NM blo 7,500'

VOR unusable:

023°-033° byd 40 NM blo 18,000'

034°-040° byd 40 NM

120°-129° byd 40 NM

130°-140° byd 40 NM blo 8,000'

130°-140° byd 55 NM blo 11,000'

130°-140° byd 72 NM

141°-147° byd 40 NM

157°-166° byd 40 NM

167°-177° byd 40 NM blo 7,000'

167°-177° byd 62 NM

178°-204° byd 40 NM

205°-215° byd 40 NM blo 8,000'

205°-215° byd 64 NM

216°-286° byd 40 NM

287°-297° byd 40 NM blo 8,000'

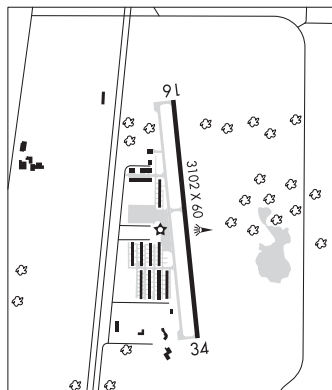
287°-297° byd 51 NM

298°-320° byd 40 NM

KLAMATH FALLS

L-1A

IAP

**CULVER****LAKE BILLY CHINOOK** (5S5) 6 W UTC-8(-7DT) N44°31.16' W121°19.24'

2695 NOTAM FILE MMV

RWY 16-34: H2500X32 (ASPH)**RWY 16:** Thld dsplcd 660'. Trees.**RWY 34:** Trees.**AIRPORT REMARKS:** Unattended. Animals on and in vicinity of arpt. Grass area south of rwy not for acct ops. Rwy 16-34 has restricted rwy sight distance. Rwy 16 NSTD dsplcd thld markings. Rwy 16-34 NSTD rwy markings no numbers or centerline. Loose grvl on sfc at various locations along full len of rwy.**AIRPORT MANAGER:** (541) 815-3707**COMMUNICATIONS:** CTAF/UNICOM 122.9**CLEARANCE DELIVERY PHONE:** For CD ctc Seattle ARTCC at 253-351-3694.

SEATTLE

DAVIS (See GATES on page 170)