

WAIMANALO N21°19.21' W157°40.90'
RCO 122.2 (HONOLULU RADIO)

HAWAIIAN-MARIANA
P-2G

WAHIAWA

WHEELER AAF (HHI)(PHHI) A 1 SW UTC-10 N21°28.89' W158°02.27'
843 B TPA—See Remarks NOTAM FILE PHHI Not insp.

HAWAIIAN ISLANDS
P-2G

RWY 06-24: H5608X100 (ASPH) PCN 47 F/A/W/T MIRL 0.4% up NE


RWY 06: Thld dsplcd 570'. Rgt tfc.

RWY 24: Rgt tfc.

SERVICE: S2 LGT ACTVT MIRL Rwy 06-24—CTAF. Rotating bcn 1/8 mile north of twr. LED lgts installed on rwy and all twys. **FUEL** F24, JAA, 1730-0845Z M-F, OT by NOTAM.

NOISE: Extremely noise sensitive area; avoid ovft communities surrounding Wheeler AAF.

MILITARY REMARKS: Attended Mon-Fri 1730-0900Z, exc hol and wkend; other times by NOTAM. **RSTD** PPR for full stop ldg, prk and for non-tenant acft, ctc Wheeler OPS C808-656-1282, DSN 456-1282. Hillclimber Apron rstd to Unmanned Shadow (RQ-7) OPS conducted btn 140' and 500' fr RCL with four sets of 4' net barriers mrk with obst lgt. No tsnt fixed-wing acft on Twy A thru Twy F, see AP3 for additional restrictions. **CAUTION** Extensive helicopter tfc invof arpt. Night vision goggle training A311 500' and below from 1 hr after SS thru 1 hr before SR. Extreme caution sweeper on rwy 1500-1700Z Mon-Fri. Use caution on north side of Rwy. Hold Lines are 50' from Rwy 06-24 edge. Remain on parallel Twy A when holding for Rwy. Use caution on Twy A due to no twy edge lights and rwy hold signs installed. All afld markings are extremely faded on all aprons and twys. Use caution when taxiing on Twy A; do not taxi behind acft in position and hold on Twy B, C, D, E, F due to recommended rotor/wingtip clnc avbl. Blue twy edge reflectors instld on Twy A north of rwy and on Twy J adj to south aprn. Mult tree obstn hazard penetration Rwy 24 40:1 apch clnc sfc slope out 6000 ft (east side). **TFC PAT** All acft arr from north will cross arpt at or abv 2500' enter tfc from the south. South traffic only. TPA—Rotary Wing 1500(657) fixed wing 2000(1157). **MISC** Wheeler Ops opr 1730-0900Z Mon-Fri exc hols and wkend, OT by NOTAM. Practice approaches by non-tenant acft restricted and approved only contingent upon tenant acft activity. Auto wx obsn, human backup avbl H24. Human wx obsn view obst by bldg W thru NE (250°-060°). Vis evaluation is ltd to 1/6 to 1/4 mile in this sctr. Wx svcs opr 24 hrs. 2 hr PN rqr for timely brief.

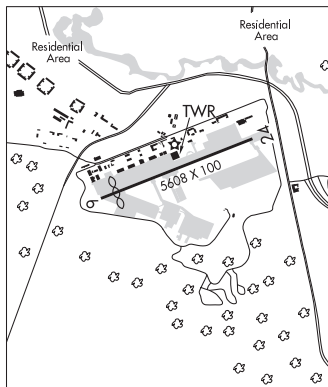

AIRPORT MANAGER: 808-656-2656

COMMUNICATIONS: CTAF 126.3 ATIS 119.675 242.4 D-ATIS 808-656-1789

Ⓡ **HONOLULU CONTROL FACILITY APP/DEP CON** 118.3 269.0

TOWER 126.3 235.625 (Opr 1730-0900Z Mon-Fri exc hol and wkend; OT by NOTAM.)

GND CON 121.85 237.5

LIGHTNING RADIO 141.65 239.5 (Mon-Fri after opr 1730-0900Z. **PINEAPPLE** Opr Mon-Fri 1730-0900Z.

PMSV METRO Wx svcs opr H24 125.1 DSN 315-456-1016/1017, C808-656-1016/1017. Alt ctc 17 DWS, DSN 315-449-8333/7950, C808-449-8333/7950. Alt METRO - 346.6 Hickam.

VFR ADZY SVC ctc HONOLULU Apch Ctrl

AIRSPACE: CLASS D svc Mon-Fri 1730Z-0900Z exc hol and wkend, OT by NOTAM; other times CLASS E.

RADIO AIDS TO NAVIGATION: NOTAM FILE HNL.

HONOLULU (H) VORTAC 114.8 HNL Chan 95 N21°18.50' W157°55.82' 319° 12.0 NM to fld. 10/11E.

TERN ISLAND

FRENCH FRIGATE SHOALS (HFS)(PHHF) 0 N UTC-11 N23°51.84' W166°17.08'

HAWAIIAN ISLANDS

6

RWY 06-24: 3000X200 (CORAL)

AIRPORT REMARKS: CLOSED except in emergency or PPR Fish and Wildlife.

Phone Honolulu 541-1201.

AIRPORT MANAGER: (808) 541-1201

