

VICI MUNI (501) 1 S UTC-6(-5DT) N36°08.46' W99°18.20'
 2268 NOTAM FILE MLC
RWY 16-34: H2565X50 (ASPH) S-8 RWY LGTS(NSTD) 1.0% up N
RWY 16: Pole.
SERVICE: LGT SS-SR. Rwy 16-34 intens rwy lgts NSTD.
AIRPORT REMARKS: Unattended. Rwy 16 145' Grain elevator 3200' NE fm end of thr. Rwy 34 30' drop off only 10' from thr.
AIRPORT MANAGER: 580-995-4442
COMMUNICATIONS: CTAF 122.9
CLEARANCE DELIVERY PHONE: For CD ctc Kansas City ARTCC at 913-254-8508.

WICHITA


VINITA MUNI (H04) 2 SE UTC-6(-5DT) N36°36.88' W95°09.10'
 695 B NOTAM FILE MLC
RWY 17-35: H4209X60 (ASPH-CONC) MIRL 0.4% up N
RWY 17: PAPI(P2L)—GA 3.0° TCH 45'. Thld dspclcd 210'. Fence.
RWY 35: PAPI(P2L)—GA 3.0° TCH 43'. Trees.
SERVICE: FUEL 100LL LGT ACTIVATE MIRL Rwy 17-35—CTAF.
AIRPORT REMARKS: Unattended. Ultralight activity on and invof arpt. 24/7 self serve 100LL available w/ cc. Interstate highway 425 ft north of Rwy 17 end.
AIRPORT MANAGER: 918-244-2704
COMMUNICATIONS: CTAF 122.9
 Ⓡ **KANSAS CITY CENTER APP/DEP CON** 128.6
CLEARANCE DELIVERY PHONE: For CD ctc Kansas City ARTCC at 913-254-8508.
RADIO AIDS TO NAVIGATION: NOTAM FILE TUL.
TULSA (H) (H) VORTACW 114.4 TUL Chan 91 N36°11.78' W95°47.29' 043° 39.7 NM to fld. 788/8E.
 TACAN AZIMUTH unusable:
 248°-258° byd 23 NM blo 3,100'
 DME unusable:
 248°-258° byd 23 NM blo 3,100'

KANSAS CITY
L-15E
IAP

WAGONER

HEFNER-EASLEY (H68) 2 E UTC-6(-5DT) N35°57.94' W95°20.51'
 599 B NOTAM FILE MLC
RWY 18-36: H3401X60 (ASPH) S-12.5 MIRL 0.4% up S
RWY 18: PAPI(P2L)—GA 3.0° TCH 40'. Trees.
RWY 36: PAPI(P2R)—GA 3.0° TCH 35'. Tree.
SERVICE: S4 LGT PAPI Rwy 18 and Rwy 36 oper constly; MIRL Rwy 18-36 on dusk-dawn.
AIRPORT REMARKS: Unattended. N-S turf used for twy only. Ultralights on and invof arpt.
AIRPORT MANAGER: 918-485-2554
COMMUNICATIONS: CTAF 122.9
 Ⓡ **TULSA APP/DEP CON** 119.1
CLEARANCE DELIVERY PHONE: For CD ctc Memphis ARTCC at 901-368-8453/8449.
RADIO AIDS TO NAVIGATION: NOTAM FILE TUL.
TULSA (H) (H) VORTACW 114.4 TUL Chan 91 N36°11.78' W95°47.29' 114° 25.7 NM to fld. 788/8E.
 TACAN AZIMUTH unusable:
 248°-258° byd 23 NM blo 3,100'
 DME unusable:
 248°-258° byd 23 NM blo 3,100'

DALLAS-FT WORTH
L-15E
IAP

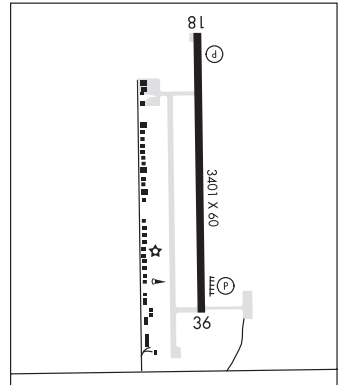

WALTERS MUNI (305) 5 W UTC-6(-5DT) N34°22.36' W98°24.35'
 1058 B NOTAM FILE MLC
RWY 16-34: H2900X50 (ASPH) S-7 MIRL
AIRPORT REMARKS: Unattended. Rwy cntrln markings faded.
AIRPORT MANAGER: 580-875-3337
COMMUNICATIONS: CTAF 122.9
CLEARANCE DELIVERY PHONE: For CD ctc Fort Worth ARTCC at 817-858-7584.

DALLAS-FT WORTH