

LONGMONT

VANCE BRAND (LMO)(KLMO) 3 SW UTC-7(-6DT) N40°09.86' W105°09.82'

CHEYENNE

5055 B NOTAM FILE DEN

L-10F, A

RWY 11-29: H4799X75 (CONC) S-30 MIRL 0.5% up NW

IAP

RWY 11: VASI(V2L)—GA 3.0° TCH 24'. Tree.

RWY 29: VASI(V2L)—GA 3.0° TCH 35'. Road.

SERVICE: S4 FUEL 100LL, JET A, MOGAS LGT ACTIVATE MIRL Rwy 11-29 and VASI Rwy 11 and Rwy 29—CTAF. Rwy 11 VASI unusable byd 3.9 NM. VASI does not provide obst clnc byd 3.9 NM from thld.

NOISE: Noise abatement procedures in effect ctc arpt manager 303-651-8431.

AIRPORT REMARKS: Attended dalgt hrs. Parachute jumping on and invof arpt primarily of rwy, avoid overflights mid fld. Ultralight and helicopter activity on and invof arpt. Rwy 29 has +15' highway 702' from thld, +25' to 35' bldgs/tanks aprx 1300' left of thld. NOTE: See Special Notices—Aerobic Operations in Colorado, USAF 306 FTG Flight Training Areas, Vicinity of Colorado Springs and Pueblo Colorado.

AIRPORT MANAGER: 303-651-8431

WEATHER DATA SOURCES: AWOS-3 120.0 (303) 684-7545.

COMMUNICATIONS: CTAF/UNICOM 122.975

® DENVER APP/DEP CON 125.12

CLEARANCE DELIVERY PHONE: For CD ctc Denver Apch at 303-342-1916.

RADIO AIDS TO NAVIGATION: NOTAM FILE BJC.

JEFFCO (VH) (DH) VORW/DME 115.4 BJC Chan 101 N39°54.78' W105°08.34' 345° 15.1 NM to fld. 5737/11E.

VOR unusable:

180°-225° byd 40 NM

226°-245° byd 36 NM blo 17,000'


246°-278° byd 30 NM blo 19,000'

279°-300° byd 34 NM blo 18,000'

301°-335° byd 40 NM

DME unusable:

246°-278° byd 30 NM

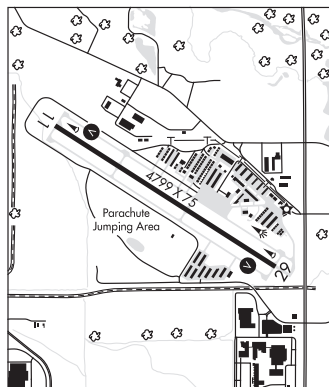

MC ELROY AIRFIELD (See KREMLING on page 345)

MEADOW LAKE (See COLORADO SPRINGS on page 321)