

WICHITA FALLS, TEXAS

HI-TACAN RWY 33L

TACAN SHP Chan 45	APCH CRS 334°	Rwy ldg 13.101 TDZE 1000 Arpt Elev 1019	AL-454 [USAF]	SHEPPARD AFB/WICHITA FALLS MUNI (KSPS)
-------------------	---------------	---	---------------	--




▼ * When ALS inop, increase CAT CDE vis to 1½ miles.
 ** Circling not authorized W of Rwy 15R-33L.



MISSED APPROACH: Climb and maintain 3300, intercept SHP TACAN R-335 to SHP R-335/9 DME (MEDSE) and hold.

ATIS * 132.05 269.9	APP CON 118.2 269.025	TOWER * 119.75 279.525 (CTAF)	GND CON 125.5 289.4	CLNC DEL 121.2 282.225	ASR
---------------------	-----------------------	-------------------------------	---------------------	------------------------	-----



CAUTION: Do not confuse parallel taxiway with Rwy 15R-33L.

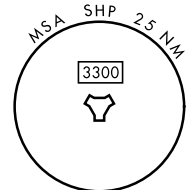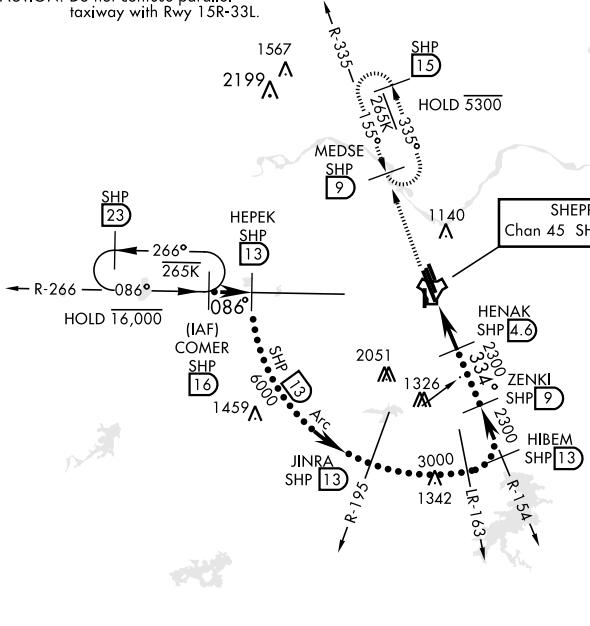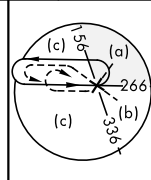

SC-2, 13 JUN 2024 to 11 JUL 2024

SC-2, 13 JUN 2024 to 11 JUL 2024

1407
 EMERG SAFE ALT 100 NM 4600

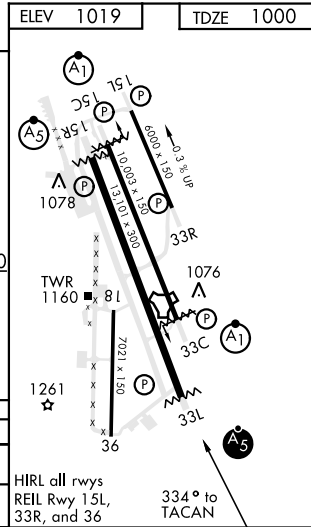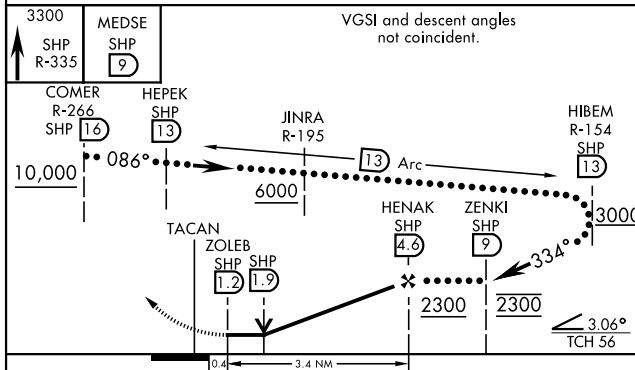

CATEGORY	C	D	E
S-33L *	1420-¾	420	(500-¾)
CIRCLING **	1480-1½ 461 (500-1½)	2020-3 1001 (1100-3)	2080-3 1061 (1100-3)

HIRL all rwys
 REL Rwy 15L,
 33R, and 36
 334° to TACAN

WICHITA FALLS, TEXAS 33°59'N-98°30'W SHEPPARD AFB/WICHITA FALLS MUNI (KSPS)

Amdt 6 14JUL22

HI-TACAN RWY 33L