

**DANSVILLE MUNI** (DSV)(KDSV) 1 NW UTC-5(-4DT) N42°34.23' W77°42.80'DETROIT  
L-301, 31E, 32F  
IAP

660 B NOTAM FILE DSV

**RWY 14-32:** H3500X100 (ASPH) S-30 MIRL 0.7% up SE**RWY 14:** VASI(V2L)—GA 3.0° TCH 35'. Fence.**RWY 32:** VASI(V4L)—GA 4.0° TCH 53'. Road.**SERVICE:** S2 **FUEL** 100LL **LGT** ACTIVATE VASI Rwy 14 and Rwy 32;  
MIRL Rwy 14-32—CTAF.**AIRPORT REMARKS:** Attended Mon-Fri 1400-2130Z±. Extensive glider activity. 100LL after hrs ctc AMGR cell. Call AMGR for fuel availability. Glider use right pat for the turf area to the rgt of Rwy 32 and left pat for the turf area to the left of Rwy 14. Rwy 14 90' relocated thld.**AIRPORT MANAGER:** 585-330-8840**WEATHER DATA SOURCES:** ASOS 118.325 (585) 335-2380.**COMMUNICATIONS:** CTAF/UNICOM 123.0

① ROCHESTER APP/DEP CON 123.7

**CLEARANCE DELIVERY PHONE:** For CD ctc Cleveland ARTCC at 440-774-0490.**RADIO AIDS TO NAVIGATION:** NOTAM FILE BUF.**GENESE** (L) (L) VOR/DME 108.2 GEE Chan 19 N42°50.06'

W77°43.97' 186° 15.9 NM to fld. 990/9W.

VOR portion unusable:

208°-224° byd 29 NM blo 5,000'

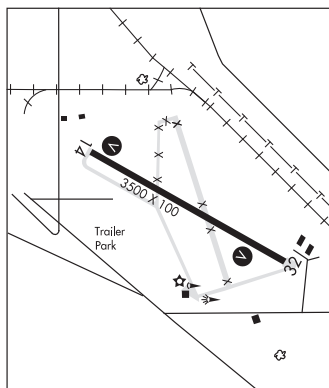
225°-230°

231°-245° byd 29 NM blo 5,000'

DME unusable:

115°-120° byd 29 NM blo 4,000'

140°-155° byd 30 NM blo 5,000'

**DART** (See MAYVILLE on page 219)**DEER PARK** N40°47.51' W73°18.22' NOTAM FILE ISP.NEW YORK  
COPTER  
H-101, L-33B, 34H

(L) (L) VOR/DME 117.7 DPK Chan 124 245° 6.3 NM to Republic. 117/12W.

VOR/DME unusable:

Byd 25 NM blo 5,000'

DME unusable:

265°-274° byd 17 NM blo 5,000'

275°-280°

281°-015° byd 17 NM blo 5,000'

**RCO** 122.2 (NEW YORK RADIO)**DEGRASSE MOORES** (1E8) 3 N UTC-5(-4DT) N44°23.28' W75°03.98'

MONTREAL

815 NOTAM FILE BTV

**RWY 02-20:** 2200X55 (TURF)**RWY 02:** Trees.**RWY 20:** Trees.**AIRPORT REMARKS:** Unattended. Deer on and invof arpt. Dirt road to hangar crosses approximate midpoint of rwy. Rwy 20 58' trees 263' from rwy beginning, across rwy width and approximately 800' along both sides. 2 ft ditch imt rt of thld mkd by cones. Rwy 20 starts at approximately 250' from trees on rwy end. Rwy 20 3 earthen ounds approx 5 ft high off right side of rwy 400 ft from thld. Trees/brush next to rwy thld L/S. Rwy 02 trees/brush next to corner of thld L/S.**AIRPORT MANAGER:** (315) 379-1907**COMMUNICATIONS:** CTAF 122.9**CLEARANCE DELIVERY PHONE:** For CD ctc Boston ARTCC at 603-879-6859.**DELANCEY** N42°10.70' W74°57.42' NOTAM FILE BUF.NEW YORK  
H-11C, 12H, L-33A

(L) (L) VOR/DME 112.1 DNY Chan 58 301° 21.8 NM to Sidney Muni. 2560/11W.

**DOWNTOWN MANHATTAN/WALL ST HELIPORT** (See NEW YORK on page 224)