

**SULPHUR SPRINGS MUNI** (SLR)(KSLR) 2 NW UTC-6(-5DT) N33°09.59' W95°37.27'**DALLAS-FT WORTH**

489 B NOTAM FILE SLR

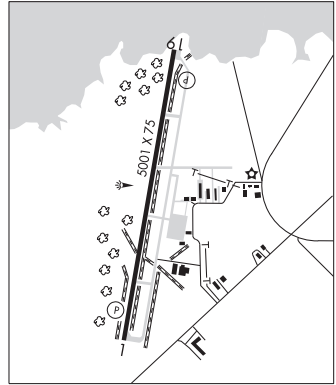
H-61, L-17D

**RWY 01-19:** H5001X75 (CONC) S-30, D-50 MIRL 0.4% up S

IAP

**RWY 01:** REIL. PAPI(P4L)—GA 3.0° TCH 56'. Fence.**RWY 19:** REIL. PAPI(P4L)—GA 3.0° TCH 40'.**SERVICE:** S4 **FUEL** 100LL, JET A **LGT** MIRL Rwy 01-19 preset low dusk-dawn. To incr instst and ACTVT REIL Rwys 01 and 19—CTAF. PAPI Rwys 01 and 19 oprn consly. Rwy 19 PAPI unusbl byd 8 degs right of RCL.**AIRPORT REMARKS:** Attended Mon-Sat 1400-0000Z†. For attendant on Sun call 903-885-49111 durg attended hrs. For attendant after hrs call police dispatch 903-885-7602. 100LL avbl 24 hrs self-serve. Birds on and invof arpt. Lgt sport acft oprg on west side of rwy. Rwy 01 45 ft bldg 1,820 dstc. Rwy 01, 44 ft unmkd p-line, 1530 ft dstc, 30:1; 58 ft tank, 1820 ft dstc, 30 ft L, 27:1; 125 ft antenna, 1515 ft east of Rwy 01 end.**AIRPORT MANAGER:** 903-885-4911**WEATHER DATA SOURCES:** AWOS-3 118.35 (903) 885-9605.**COMMUNICATIONS:** CTAF/UNICOM 123.075Ⓡ **FORT WORTH CENTER APP/DEP CON** 132.025**CLEARANCE DELIVERY PHONE:** For CD etc Fort Worth ARTCC at 817-858-7584.**RADIO AIDS TO NAVIGATION:** NOTAM FILE SLR.

(L) DME 109.0 SLR Chan 27 N33°11.92' W95°32.57' 240° 4.6 NM to fld. 508.

**SUNRAY** (X43) 1 NW UTC-6(-5DT) N36°01.75' W101°49.73'**WICHITA**

3507 NOTAM FILE FTW

L-15B

**RWY 02-20:** 3760X50 (GRVL-DIRT)**RWY 02:** P-line.**RWY 20:** Road.**RWY 17-35:** H3250X50 (ASPH) S-13 **RWY LGTS**(NSTD)**RWY 17:** Road.**RWY 35:** P-line.**SERVICE:** **LGT** Rwy 17-35 low intst solar lgts.**AIRPORT REMARKS:** Attended irregularly. 10 ft AGL gas well located 375 ft east of south end Rwy 02-20. Rwy 35 also 40 ft pline, 220 ft dstc, 150 ft L/R; 25 ft RR 265 ft dstc, 155 L/R. Rwy 35 also 40 ft pline, 219 ft dstc, 155 ft L, 118 ft R; 25 ft RR, 265 ft dstc, 0 ft B. Rwy 17-35 hngrs, parked vehicles, pipe supplies, gravel piles, and acft obst prim sfc. Rwy 02-20 rwy sfc rough, crops at rwy edge. Rwy 17-35 ends mkd with 5 ft "L" shaped concrete curbs.**AIRPORT MANAGER:** 806-948-4111**COMMUNICATIONS:** CTAF 122.9**CLEARANCE DELIVERY PHONE:** For CD etc Albuquerque ARTCC at 505-856-4861.**RADIO AIDS TO NAVIGATION:** NOTAM FILE BGD.**BORGER (L) TACAN** Chan 23 BGD (108.6) N35°48.42' W101°22.93' 291° 25.5 NM to fld. 3130/11E.

TACAN AZIMUTH unusable:

220°-320° byd 10 NM blo 12,000'

**SUNRISE BEACH** (2KL) 1 NE UTC-6(-5DT) N30°35.95' W98°24.55'**SAN ANTONIO**

854 NOTAM FILE SJT

**RWY 12-30:** 2649X110 (TURF) LIRL**RWY 12:** Tree.**RWY 30:** Tree. Rgt tfc.**SERVICE:** S4 **LGT** Arpt lgts ops dusk-0430Z†.**AIRPORT REMARKS:** Unattended. Nmrs deer on and invof rwy. Ngt opns not rcmd. No touch and go ldg ops. For acft svc call 512-755-0399. Transient prkg west end of rwy by open hgr. Pkg lmtd to 72 hrs. Emerg helipad lctd east of wind sock and segmented crc. Rwy 12-30 irrigated aft 0430Z† ngty. Trees in apch area and hngrs wi 60 ft of rwy. 20-30 ft trees alg both sides of rwy 75 ft each side of rwy cntrln. Rwy 12 thr mkd with white tires. Rwy 30 thr mkd with red lgts.**AIRPORT MANAGER:** 408-564-9954**COMMUNICATIONS:** CTAF 122.9**CLEARANCE DELIVERY PHONE:** For CD etc Houston ARTCC at 281-230-5622.