

**LINCOLNTON—LINCOLN CO RGNL** (IPJ)(KIPJ) 5 E UTC-5(-4DT) N35°28.99' W81°09.69'

**CHARLOTTE**  
H-9B, 12G, L-25D  
IAF

878 B NOTAM FILE IPJ

**RWY 05-23:** H5700X100 (ASPH) S-30, D-60 MIRL 0.3% UP SW

**RWY 05:** REIL. PAPI(P2L)—GA 3.4° TCH 64'. Thld dsplcd 200'. Trees.

**RWY 23:** REIL. PAPI(P2L)—GA 3.0° TCH 47'. Thld dsplcd 199'. Trees.

**SERVICE:** S4 FUEL 100LL, JET A1+ OX 2, 4 LGT To actvt REIL Rwy 05 & 23 dusk-dawn—CTAF; to actvt PAPI Rwy 05 & 23—CTAF. MIRL Rwy 05-23 dusk to 0300Z† preset low intst; to incr intst dusk to 0300Z† and to actvt MIRL Rwy 05-23 between 0300Z†-dawn—CTAF.

**AIRPORT REMARKS:** Attended Apr-Oct 1300-0000Z†, Nov-Mar 1300-2300Z†. Unattended Thanksgiving and Christmas Day. Deer, coyote and birds on and invof arpt. Rwy 23 has a 90 ft drop-off 100 ft frm pvmt end and 90 ft drop-off first 200 ft 160 ft both sides of cntrln. 200 ft swy SW end has been remarked as 200 ft dsplcd thr for Rwy 05.

**AIRPORT MANAGER:** 704-735-0602

**WEATHER DATA SOURCES:** AWOS-3 119.675 (704) 735-6954.

**COMMUNICATIONS:** CTAF/UNICOM 123.05

Ⓡ **CHARLOTTE APP/DEP CON** 134.75 **CLNC DEL** 124.9

**GCO** 124.9 (CHARLOTTE APCH) (Key mike 4 times slowly, wait for dial tone and ring)

**CLEARANCE DELIVERY PHONE:** For CD if una via GCO ctc Charlotte Apch at 704-359-0241.

**RADIO AIDS TO NAVIGATION:** NOTAM FILE CLT.

**CHARLOTTE (L) L VORW/DME** 115.0 CLT Chan 97 N35°11.42' W80°57.11' 335° 20.3 NM to fld. 732/5W.

DME portion unusable:

015°-050° byd 25 NM blo 3,000'

050°-100° byd 25 NM blo 2,500'

185°-202° byd 15 NM

203°-220°


270°-350° byd 20 NM blo 5,000'

VOR/DME controlled by Charlotte ATCT

VOR unusable:

203°-220°

**ILS/DME** 111.15 I-IPJ Chan 48(Y) Rwy 23. Class IB.

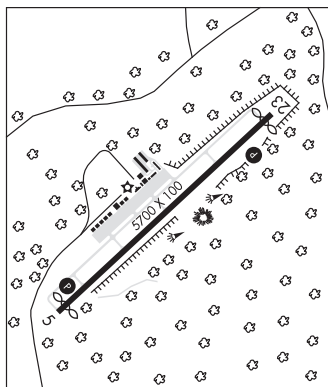

**LONE HICKORY** (See YADKINVILLE on page 368)

**LOUISBURG**

**TRIANGLE NORTH EXEC** (LHZ)(KLHZ) 5 SW UTC-5(-4DT) N36°01.40' W78°19.82'

**CHARLOTTE**  
H-9C, 12H, L-35B, 36G  
IAF

368 B NOTAM FILE LHZ

**RWY 05-23:** H5498X100 (ASPH-GRVD) S-40, D-60 HIRL

0.7% up SW

**RWY 05:** MALSR. PAPI(P4L)—GA 3.0° TCH 42'. Trees. Rgt tfc.

**RWY 23:** REIL. PAPI(P4L)—GA 3.0° TCH 49'. Trees.

**SERVICE:** S4 FUEL 100LL, JET A1+ OX 3, 4 LGT Actvt MALSR Rwy 05; REIL Rwy 23; HIRL Rwy 05-23—CTAF. PAPI Rwy 05 and 23 oper consly.

**AIRPORT REMARKS:** Attended 1300-2300Z†. Arpt unattended Thanksgiving Day and Christmas. Birds on and invof arpt. Daily skydiving ops. Glider act dalgt hrs wkends. Hel flight tng daily primly on W side of arpt and twy. Arpt phone 919-496-1234; make prior argmts drg FBO hours for svcs after hours.

**AIRPORT MANAGER:** 919-496-1234

**WEATHER DATA SOURCES:** AWOS-3 118.325 (919) 497-0810.

**COMMUNICATIONS:** CTAF/UNICOM 123.0

Ⓡ **RALEIGH APP/DEP CON** 125.3

**CLEARANCE DELIVERY PHONE:** For CD ctc Raleigh Apch at 919-380-3144.

**RADIO AIDS TO NAVIGATION:** NOTAM FILE RDU.

**RALEIGH/DURHAM (H) H VORTACW** 117.2 RDU Chan 119

N35°52.35' W78°47.00' 077° 23.9 NM to fld. 429/9W.

**ILS/DME** 109.35 I-LHZ Chan 30(Y) Rwy 05. Class IA. ILS mnt at fbo.

