

**HASTINGS MUNI** (HSI)(KHSI) 2 NW UTC-6(-5DT) N40°36.32' W98°25.67'OMAHA  
H-5B, L-10H  
IAP

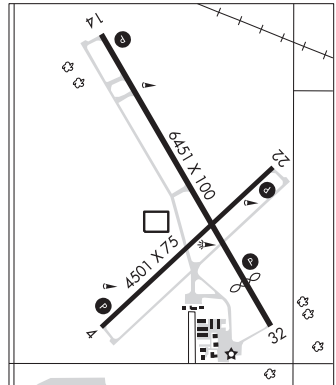
1961 B NOTAM FILE HSI

**RWY 14-32:** H6451X100 (CONC) S-36, D-58, 2D-106 MIRL  
0.4% up NW**RWY 14:** REIL. PAPI(P4L)—GA 3.0° TCH 38'. Tower.**RWY 32:** REIL. PAPI(P4R)—GA 3.0° TCH 42'. Thld dsplcd 950'.  
Road.**RWY 04-22:** H4501X75 (CONC) S-36, D-47 MIRL**RWY 04:** PAPI(P2L)—GA 3.0° TCH 40'.**RWY 22:** PAPI(P2L)—GA 3.0° TCH 40'.**RUNWAY DECLARED DISTANCE INFORMATION****RWY 14:** TORA-5500 TODA-6451 ASDA-5500 LDA-5500**RWY 32:** TORA-6451 TODA-6451 ASDA-6451 LDA-5500**SERVICE:** FUEL 100LL, JET A LGT ACTIVATE MIRL Rwy 04-22 and  
Rwy 14-32; PAPI Rwy 04-22 and Rwy 14-32; REIL Rwy 14 and  
Rwy 32—CTAF.**AIRPORT REMARKS:** Attended Mon-Fri 1400-2300Z‡. Self-svc fuel avbl 24  
hrs. Fuel injection additives avbl.**AIRPORT MANAGER:** 402-984-5223**WEATHER DATA SOURCES:** ASOS 120.525 (402) 463-4029.**COMMUNICATIONS:** CTAF/UNICOM 122.8

® MINNEAPOLIS CENTER APP/DEP CON 119.4

**CLEARANCE DELIVERY PHONE:** For CD ctc Minneapolis ARTCC at 651-463-5588.**AIRSPACE:** CLASS E svc 1200-0430Z‡ Mon-Fri, 1200-2000Z‡ Sat, 1600-0430Z‡ Sun; other times CLASS G.**RADIO AIDS TO NAVIGATION:** NOTAM FILE HSI.

(L) DME 108.8 HSI Chan 25 N40°36.27' W98°25.78' at fld. 1957.

**HAY SPRINGS MUNI** (4V6) 0 SW UTC-7(-6DT) N42°40.92' W102°42.04'

CHEYENNE

3831 B NOTAM FILE OLU

**RWY 11-29:** 2775X300 (TURF) MIRL 0.4% up W**RWY 29:** Thld dsplcd 205'. Pole.**SERVICE:** LGT ACTIVATE MIRL Rwy 11-29 and rotating bcn—CTAF.**AIRPORT REMARKS:** Unattended. Rwy 11-29 NSTD markings, marked with yellow cones around lgts.**AIRPORT MANAGER:** 308-638-7275**COMMUNICATIONS:** CTAF 122.9**CLEARANCE DELIVERY PHONE:** For CD ctc Denver ARTCC at 303-651-4257.**HAYES CENTER** N40°27.24' W100°55.41' NOTAM FILE OLU.OMAHA  
H-5B, L-10G

(VH) (H) VORTAC 117.7 HCT Chan 124 051° 23.4 NM to Curtis Muni. 3010/11E.

RCO 122.1R 117.7T (COLUMBUS RADIO)

**HEBRON MUNI** (HJH)(KHJH) 1 S UTC-6(-5DT) N40°09.12' W97°35.07'OMAHA  
L-10I  
IAP

1468 B NOTAM FILE HJH

**RWY 12-30:** H3600X60 (CONC) S-30 MIRL**RWY 12:** REIL. PAPI(P2L)—GA 3.9° TCH 52'. Tree.**RWY 30:** REIL. PAPI(P2L)—GA 3.0° TCH 40'. Road.**RWY 03-21:** 2513X150 (TURF) 0.7% up SW**RWY 03:** Trees.**SERVICE:** FUEL 100LL, JET A LGT ACTVAT MIRL Rwy 12-30; PAPI  
Rwy 12 and Rwy 30; REIL Rwy 12 and Rwy 30—CTAF. MAINT  
Airframe and pwr plant rprs by apntmt only.**AIRPORT REMARKS:** Unattended. Fuel: 100LL: Fuel avbl H24 via credit  
card. If unavbl call 402-768-6597. Rwy 03 mkd with reflectors and  
yellow cones. Rwy 21 mkd with reflectors and yellow cones.**AIRPORT MANAGER:** (402) 768-6597**WEATHER DATA SOURCES:** AWOS-3 118.525 (402) 768-2501.**COMMUNICATIONS:** CTAF 122.9

® MINNEAPOLIS CENTER APP/DEP CON 126.4

**CLEARANCE DELIVERY PHONE:** For CD ctc Minneapolis ARTCC at  
651-463-5588.**RADIO AIDS TO NAVIGATION:** NOTAM FILE ICT.**MANKATO (L) VORTACW** 109.8 TKO Chan 35 N39°48.38'  
W98°15.60' 046° 37.4 NM to fld. 1880/10E.