

PLATTE MUNI (1D3) 1 NE UTC-6(-5DT) N43°24.28' W98°49.83'

OMAHA
L-12H

1618 B NOTAM FILE HON

RWY 14-32: H3100X60 (CONC) S-125 MIRL 0.5% up SE

RWY 14: PAPI(P2L). Tree.

RWY 32: PAPI(P2L). Trees. Rgt tfc.

SERVICE: FUEL 100LL LGT ACTIVATE MIRL Rwy 14-32—CTAF.

AIRPORT REMARKS: Attended Mon-Sat 1400-2300Z. Fuel avbl 24 hrs with credit card. During winter months rwy could be slippery, confirm winter conditions with arpt manager call 605-337-2334/3923. Deer and other wildlife on and in/ov arpt.

AIRPORT MANAGER: 605-337-2334

COMMUNICATIONS: CTAF/AUNICOM 122.8

GCO 121.725 (4 clicks to MINNEAPOLIS CENTER and 6 clicks to FLIGHT SERVICES)

CLEARANCE DELIVERY PHONE: For CD if una via GCO ctc Minneapolis ARTCC at 651-463-5588.

RADIO AIDS TO NAVIGATION: NOTAM FILE MHE.

MITCHELL (L) (L) VORV/DME 114.15 MHE Chan 88(Y) N43°46.62' W98°02.25' 233° 41.2 NM to fld. 1298/4E.

PRESHO MUNI (5P5) 1 E UTC-6(-5DT) N43°54.36' W100°02.20'

OMAHA

1760 B NOTAM FILE HON

RWY 10-28: 3350X150 (TURF-GRVL) LIRL 0.4% up W

RWY 10: Road.

RWY 28: Fence.

SERVICE: LGT ACTIVATE LIRL Rwy 10-28—CTAF.

AIRPORT REMARKS: Unattended. Wildlife and waterfowl on and in/ov arpt. Rwy 10-28 center 52' gravel plus gravel turnarounds. Rwy 10-28 marked with black and white cones.

AIRPORT MANAGER: 605-280-4641

COMMUNICATIONS: CTAF 122.9

CLEARANCE DELIVERY PHONE: For CD ctc Minneapolis ARTCC at 651-463-5588.

RAPID CITY RGNL (RAP)(KRAP) P (ARNG) 8 SE UTC-7(-6DT) N44°02.72' W103°03.44'

CHEYENNE
H-2H, L-12G
IAP, AD

3204 B ARFF Index—See Remarks NOTAM FILE RAP MON Airport

RWY 14-32: H8701X150 (CONC-GRVD) S-140, D-190, 2S-175,

2D-300 PCN 65 R/C/W/T HIRL

RWY 14: REIL. PAPI(P4L)—GA 3.0° TCH 50'. RVR-R Fence. 0.6% down.

RWY 32: MALSR. PAPI(P4L)—GA 3.0° TCH 54'. RVR-T 0.5% up.

RWY 05-23: H3601X75 (ASPH) S-12.5 PCN 15 F/C/W/T MIRL 0.8% up NE

RWY 05: PAPI(P2L)—GA 3.0° TCH 34'. Rgt tfc.

RWY 23: PAPI(P2L)—GA 3.0° TCH 38'. Road.

RUNWAY DECLARED DISTANCE INFORMATION

RWY 05: TORA-3601 TODA-3601 ASDA-3601 LDA-3601

RWY 14: TORA-8701 TODA-8701 ASDA-8701 LDA-8701


RWY 23: TORA-3601 TODA-3601 ASDA-3601 LDA-3601

RWY 32: TORA-8701 TODA-8701 ASDA-8701 LDA-8701

SERVICE: S4 FUEL 100LL, JET A OX3 LGT When ATCT clsd actvt MALSR Rwy 32; REIL Rwy 14; HIRL Rwy 14-32; MIRL Rwy 05-23; Twy A and B lgts—CTAF. PAPI Rwys 05, 14, 23, 32 opr consly. **MILITARY—FUEL** ARNG ramp- A+(Mil) (NC-100LL,A)

AIRPORT REMARKS: Attended continuously. Birds on and in vicinity of arpt.

Be alert: extensive military jet traffic in vicinity of and north-northwest of arpt. Be alert do not mistake Ellsworth AFB, located 6.5 NM north-northwest for Rapid City Rgnl. 152' AGL twr 2.5 NM north-northwest of arpt. Line of sight is restricted between Rwy 14 and Rwy 23 physical ends. Twr has limited visibility of Twy T1 and Twy T2 and Twy B at AER 23. Rwy 05-23 not avbl for skedd acr ops with more than 9 psgr seats or unskd acr at least 31 psgr seats. Rwy 05-23 not avbl to acft over 12,500 lbs to taxi. Class I, ARFF Index B. ARFF Index C avbl upon req. 100LL and Jet A self svc avbl 24 hrs with credit card only NE side of GA ramp. Diverting non-based air carriers ctc arpt ops at 605-593-3419 prior to diverting due to limited gate space. Ctc ground for free tie-down locations, or call arpt opr at 605-593-3419. All charter serviced acft over 12,500 lbs must ctc arpt ops at 605-593-3419 at least 48 hrs prior to arrival. Overnight parking allowed in designated tiedown areas only. No cstmns svc avbl. Landing fee for acft over 12,500 lbs or greater.

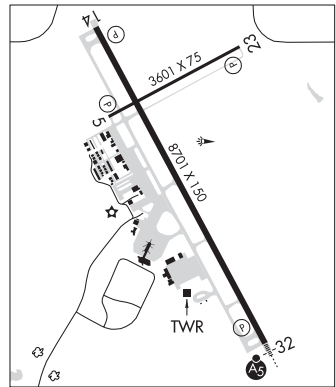

CONTINUED ON NEXT PAGE

CONTINUED FROM PRECEDING PAGE

AIRPORT MANAGER: 605-394-4195

WEATHER DATA SOURCES: ASOS 118.525 (605) 393-2832.

COMMUNICATIONS: CTAF 125.85 UNICOM 122.95

RCO 122.4 (HURON RADIO)

RCO 122.1R 112.3T (HURON RADIO)

® **ELLSWORTH APP/DEP CON** 119.5 (H24 1300Z‡ Mon thru 0500Z‡ Sat, 1300-0500Z‡ Sat-Sun, other times ctc Denver Center: 127.95 338.2)

TOWER 125.85 (1300-0500Z‡) **GND CON** 121.9

CLEARANCE DELIVERY PHONE: For CD ctc gnd or ATCT on freq. If una, ctc rap ATCT at 605-393-1161. When ATCT clsd, ctc Ellsworth Apch at 605-385-6198. When Apch clsd ctc Denver ARTCC at 303-651-4257.

AIRSPACE: CLASS D svc 1300-0500Z‡; other times CLASS E.

RADIO AIDS TO NAVIGATION: NOTAM FILE RAP.

(VH) (H) **VORTAC** 112.3 RAP Chan 70 N43°58.56' W103°00.74' 322° 4.6 NM to fld. 3157/13E.

VOR unusable:

215°-232° byd 40 NM

233°-243° byd 40 NM blo 8,300'

233°-243° byd 81 NM blo 18,000'

244°-253° byd 40 NM blo 8,000'

244°-253° byd 61 NM

254°-264° byd 40 NM blo 18,000'

ILS/DME 109.3 I-RAP Chan 30 Rwy 32. Class IE. Glideslope unusable for coupled approaches blo 3,360'. LOC unusable byd 27° left of course byd 27° r of course.

COMM/NAV/WEATHER REMARKS: High vol of heli tours invof Mt. Rushmore and Crazy Horse Monuments at or blw 7500'; all otr acft should rmn at or above 7700' and maintain 1 NM horizontal separation from the monuments; pilots are advised to monitor 122.85 for tfc advisories.

REDFIELD MUNI (1D8) 1 SW UTC-6(-5DT) N44°51.39' W98°31.87'

TWIN CITIES

1309 B NOTAM FILE HON

L-12H, 14G

RWY 17-35: H3500X75 (ASPH-CONC) MIRL

RWY 17: PAPI(P2R)—GA 3.0° TCH 40'.

RWY 35: PAPI(P2L)—GA 3.0° TCH 36'.

SERVICE: S2 FUEL 100LL LGT Actvt PAPI Rwy 17 and 35; MIRL 17-35—CTAF.

AIRPORT REMARKS: Unattended. Migratory birds and wildlife on and invof arpt. Ultralight activity on and invof arpt. Fuel avbl 24 hrs with credit card.

AIRPORT MANAGER: 605-472-4550

WEATHER DATA SOURCES: AWOS-3P 118.525 (605) 475-1877.

COMMUNICATIONS: CTAF/UNICOM 122.8

CLEARANCE DELIVERY PHONE: For CD ctc Minneapolis ARTCC at 651-463-5588.

RENEY N45°23.17' W98°19.71' NOTAM FILE ABR.

TWIN CITIES

NDB (LOMW) 203 AB 306° 5.4 NM to Aberdeen Rgnl. 1298/7E.

ROKKY N43°29.64' W96°49.74' NOTAM FILE FSD.

OMAHA

NDB (HW/LOM) 245 FS 031° 6.5 NM to Joe Foss Fld. 1528/5E.

L-12I