

**COLUMBUS** N31°49.15' W107°34.47' NOTAM FILE ABQ.  
**(VL) (L) VOR/DME** 111.2 CUS Chan 49 333° 27.5 NM to Deming Muni. 4008/12E. VOR/DME unmonitored.

EL PASO  
L-6E

VOR unusable:

013°-016° byd 40 NM  
 036°-037° byd 40 NM  
 052°-086° byd 40 NM  
 227°-259° byd 40 NM  
 260°-270° byd 40 NM blo 9,000'  
 260°-270° byd 54 NM  
 271°-281° byd 40 NM blo 10,000'  
 271°-281° byd 51 NM  
 282°-345° byd 40 NM  
 335°-342° byd 30 NM blo 10,500'

## CONCHAS DAM

**CONCHAS LAKE** (E89) 1 SW UTC-7(-6DT) N35°22.07' W104°10.83'

ALBUQUERQUE  
L-15A

4232 B NOTAM FILE ABQ

**RWY 09-27:** H4800X60 (ASPH) S-13 PCN 5 F/D/Y/T RWY

LGTS(NSTD) 0.9% up W

**RWY 09:** ODALS.

**RWY 27:** ODALS.

**SERVICE:** LGT Rwy 09-27 edge intens rwy lgts: reflective mkr. Rwy 09 ODALS: NSTD; one ODAL illuminates. Rwy 27 ODALS: NSTD; OTS indefly. ACTVT ODALS Rwy 09 and Rwy 27-CTAF.

**AIRPORT REMARKS:** Unattended. Wildlife on and invof arpt. Gate aces 4230. Twys have retro reflective mkr. Survey mkr 275 ft fm thr 55 ft left of cntrln.

**AIRPORT MANAGER:** 505-365-3891

**COMMUNICATIONS:** CTAF 122.9

**RCO** 122.6 (ALBUQUERQUE RADIO)


**CLEARANCE DELIVERY PHONE:** For CD ctc Albuquerque ARTCC at 505-856-4861.

**RADIO AIDS TO NAVIGATION:** NOTAM FILE TCC.

**TUCUMCARI (VH) (H) VORTACW** 113.6 TCC Chan 83 N35°10.93'  
 W103°35.91' 279° 30.7 NM to fid. 4035/12E.

VOR unusable:

125°-174° byd 40 NM  
 175°-193° byd 40 NM blo 12,500'  
 194°-227° byd 40 NM  
 228°-238° byd 40 NM blo 11,000'  
 228°-238° byd 46 NM  
 239°-249° byd 40 NM  
 250°-261° byd 40 NM blo 7,700'  
 250°-261° byd 46 NM blo 18,000'  
 262°-273° byd 40 NM  
 274°-284° byd 40 NM blo 18,000'  
 285°-355° byd 40 NM

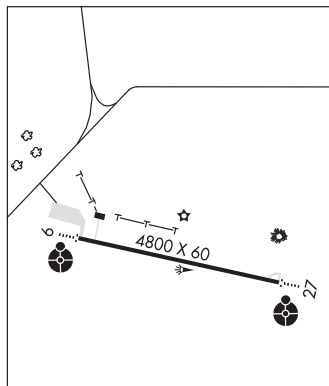

**CONCHAS LAKE SPB** (E61) 2 SW UTC-7(-6DT) N35°23.05' W104°12.98'

ALBUQUERQUE

4201 NOTAM FILE ABQ

**WATERWAY ALL-WAY:** 21120X1320 (WATER)

**SEAPLANE REMARKS:** Unattended. Hvy boat tfc May-Oct. Water level fluctuates 4153-4201 ft; Indg haz due to exposed snags and land masses blw 4175 ft; mnt water level - 575-868-22221 or USCGS website under Conchas Lake. Ops NA north of the dam. Wind warning lgt W of dam at lodge; lgts flash grt than 20 mph wind. Exp SW wind; rcmdn Indg and tkof to the W.

**AIRPORT MANAGER:** 575-868-2221

**COMMUNICATIONS:** CTAF 122.9

**CLEARANCE DELIVERY PHONE:** For CD ctc Albuquerque ARTCC at 505-856-4861.

**CONCHAS LAKE SPB** (See CONCHAS DAM on page 432)

**CONCHAS LAKE** (See CONCHAS DAM on page 432)