

KAKE

KAKE (AFE)(PAFE) 1 SE UTC-9(-8DT) N56°57.68' W133°54.62'

172 NOTAM FILE AFE

RWY 11-29: H4000X100 (ASPH) MIRL 0.5% up SE

RWY 11: REIL. PAPI(P4L)—GA 3.0° TCH 41'. Brush. Rgt tfc.

RWY 29: Thld dsplcd 1000'. Hill.

SERVICE: LGT Actvt MIRL Rwy 11-29, PAPI Rwy 11 and REIL Rwy 11—CTAF.

AIRPORT REMARKS: Unattended. Arpt CLOSED to acft over 12,500 lbs GWT, except PPR from arpt safety and security, DOT and public facilities, P.O. Box 112506, Juneau, AK 99811-2506, phone 907-465-1786. Arpt condition not monitored, arpt maintenance on irregular basis, recommend visual inspection prior to using. Recommend daylight ops only. High terrain N, E, and S of arpt. Parachute jumping onto arpt rwy, twy and acft apron prohibited. Birds, bear and deer on and invof rwy. Unlit 191' twr lctd aprxly 6300' N of Rwy 11 thld.

AIRPORT MANAGER: 907-966-2960

WEATHER DATA SOURCES: AWOS-3P 135.25 (907) 785-3124. (WX CAM)

COMMUNICATIONS: CTAF 122.9

RCO 122.65 (SITKA RADIO)

KUIU RCO 121.3 (SITKA RADIO)

Ⓡ **ANCHORAGE CENTER APP/DEP CON** 132.175

RADIO AIDS TO NAVIGATION: NOTAM FILE AFE.

NDB/DME (MHW) 223 AFE Chan 91 N56°57.84' W133°54.71'

NDB unusable:

040°-090° byd 15 NM

091°-135° byd 20 NM blo 4,600'


265°-280° byd 15 NM blo 4,900'

281°-310° byd 15 NM blo 10,000'

311°-340° byd 10 NM blo 12,500'

340°-040° byd 15 NM blo 12,500'

COMM/NAV/WEATHER REMARKS: For a toll free call to Sitka FSS dial 1-800-478-6300. For a toll free call to Juneau FSS dial 1-800-WX-BRIEF. DME Chan 91 paired with VHF freq 114.4.

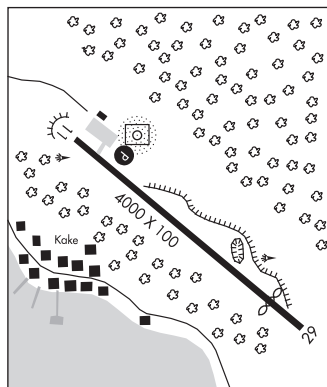

at fld. 170/21E.

JUNEAU

H-1C, L-1C

IAP

KAKE SPB (KAE) 0 S UTC-9(-8DT) N56°58.38' W133°56.74'

00 NOTAM FILE SIT

WATERWAY NW-SE: 10000X4000 (WATER)

SEAPLANE REMARKS: Unattended. Dock. Boats may be tied to SPB/float.

AIRPORT MANAGER: (907) 785-3804

COMMUNICATIONS: CTAF 122.9

RADIO AIDS TO NAVIGATION: NOTAM FILE SIT.

LEVEL ISLAND (H) (H) VOR/DME 116.5 LVD Chan 112 N56°28.06'

W133°04.99' 297° 41.7 NM to fld. 98/20E.

VOR unusable:

020°-050° byd 37 NM

270°-300° byd 25 NM blo 10,000'

301°-321° byd 25 NM blo 7,000'

wx cam avbl at <https://weathercams.faa.gov>

DME unusable:

020°-050° byd 25 NM blo 11,000'

020°-050° byd 37 NM

105°-120° byd 29 NM blo 10,000'


121°-135° byd 35 NM blo 7,000'

270°-300° byd 25 NM blo 10,000'

301°-321° byd 25 NM blo 7,000'

345°-350° byd 36 NM blo 8,000'

COMM/NAV/WEATHER REMARKS: For a toll free call to Sitka FSS call 800-478-6300. For a toll free call to Juneau FSS dial 1-800-WX-BRIEF.

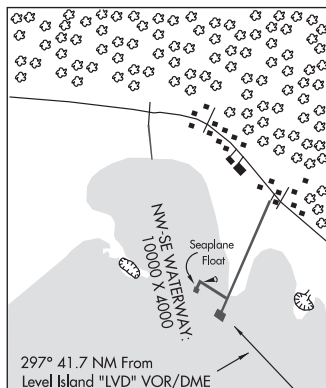

KAKO (See RUSSIAN MISSION on page 213)