

PIQUA/HARTZELL FLD (I17) 3 NW UTC-5(-4DT) N40°09.88' W84°18.51' DETROIT
L-27E
IAP
 993 B NOTAM FILE DAY
RWY 08-26: H3998X75 (ASPH) S-30, D-36 MIRL
RWY 08: REIL. PAPI(P2L)—GA 3.0° TCH 36'. Tree.
RWY 26: REIL. PAPI(P2L)—GA 3.0° TCH 37'.
SERVICE: S2 FUEL 100LL, JET A+, A1+ LGT ACTIVATE REIL Rwy 08 and Rwy 26; MIRL Rwy 08-26—CTAF. PAPI Rwy 08 and Rwy 26 opr consly. Rwy 08 PAPI unusbl byd 6° right of cntrln.
AIRPORT REMARKS: Attended Mon-Fri 1300-2200Z±. Unatnidd major hols. Fuel avbl H24 via credit card. Arpt conds unmon Mon-Fri 2100-1300Z±, Sat-Sun, and hols. Propeller repairs avbl. Aerobatic box lctd wi 1 NMR of arpt, blw 4500' MSL SR-SS.
AIRPORT MANAGER: 937-778-5742
COMMUNICATIONS: CTAF/UNICOM 123.0
 (R) **COLUMBUS APP/DEP CON** 134.45
CLEARANCE DELIVERY PHONE: For CD ctc Columbus Apch at 614-338-8537.
RADIO AIDS TO NAVIGATION: NOTAM FILE DAY.
DAYTON (VL) (L) VOR/DME 114.5 DQN Chan 92 N40°00.99' W84°23.81' 026° 9.8 NM to fld. 989/1W.
 DME unusable:
 Byd 35 NM blo 2,900'
 VOR unusable:
 245°-250° byd 40 NM
ROSEWOOD (H) (H) VORTACW 117.5 ROD Chan 122 N40°17.27' W84°02.59' 244° 14.3 NM to fld. 1080/5W.
 TACAN AZIMUTH unusable:
 000°-120°
 125°-135°
 VOR unusable:
 125°-135°

PORT BUCYRUS/CRAWFORD CO (See BUCYRUS on page 263)

PORT CLINTON

ERIE-OTTAWA INTL (PCW)(KPCW) 3 E UTC-5(-4DT) N41°30.98' W82°52.17' DETROIT
H-10G, L-30F
IAP
 590 B LRA NOTAM FILE CLE
RWY 09-27: H5646X100 (ASPH-GRVD) S-100 HIRL
RWY 09: REIL. PAPI(P4L)—GA 3.0° TCH 40'. Tree.
RWY 27: REIL. PAPI(P4L)—GA 3.0° TCH 40'. Thld dsplcd 201'. Tree.
RWY 18-36: H4002X75 (ASPH) MIRL
SERVICE: S4 FUEL 100LL, JET A+ OX 1, 2, 3, 4 LGT Actvt REIL Rwy 09 & 27; HIRL Rwy 09-27; MIRL Rwy 18-36—CTAF. PAPI Rwy 09 & 27 opr consly.
AIRPORT REMARKS: Attended 1200-2300Z±. Birds and otr wildlife on & invof arpt. Rwy 09-27 calm wind rwy. Taxilane A clsd to acft with wingspan more than 49 ft. Cust avbl 24 hrs 7 days per week, req must be made prior to arr, lcl office 419-732-4446. Hngr transient storage: subj avblty, PPR aft hrs.
AIRPORT MANAGER: 419-734-6297
WEATHER DATA SOURCES: AWOS-3 118.775 (419) 734-9955.
COMMUNICATIONS: CTAF/UNICOM 122.8
 (R) **CLEVELAND APP/DEP CON** 126.35
CLEARANCE DELIVERY PHONE: For CD ctc Cleveland Apch at 216-352-2323.

CONTINUED ON NEXT PAGE

CONTINUED FROM PRECEDING PAGE

RADIO AIDS TO NAVIGATION: NOTAM FILE CLE.

DRYER (VH) (DH) VOR/DME 113.6 DJB Chan 83 N41°21.48' W82°09.72' 292° 33.3 NM to fld. 780/5W.

VOR unusable:

001°-010° byd 40 NM
 020°-024° byd 40 NM
 034°-040° byd 55 NM
 080°-095° byd 40 NM
 110°-120° byd 40 NM
 135°-145° byd 40 NM
 135°-150°
 155°-165°
 160°-165° byd 40 NM
 185°-195° byd 40 NM
 187°-197°
 210°-224° byd 40 NM
 211°-218°
 225°-235° byd 40 NM blo 11,000'
 225°-235° byd 95 NM
 225°-245° byd 20 NM blo 3,500'
 245°-265° byd 40 NM
 275°-285° byd 40 NM blo 18,000'
 286°-355° byd 40 NM

DME unusable:

187°-197°
 289°-310°
 322°-332°
 350°-060°

PORTAGE CO (See RAVENNA on page 310)

PORTSMOUTH

GREATER PORTSMOUTH RGNL (PMH)(KPMH) 10 NE UTC-5(-4DT) N38°50.43' W82°50.84'

CINCINNATI
H-10G, L-26G
IAP

663 B NOTAM FILE DAY

RWY 18-36: H5001X100 (ASPH) S-30, D-42, 2D-70 MIRL

RWY 18: REIL. PAPI(P4L)—GA 3.0° TCH 25'.

RWY 36: REIL. PAPI(P4L)—GA 3.0° TCH 31'.

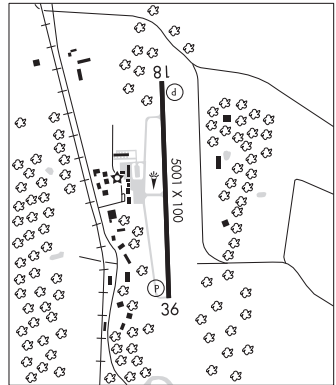
SERVICE: S4 FUEL 100LL, JET A1+ LGT Actvt REIL Rwy 18 & 36;
MIRL Rwy 18-36—CTAF. PAPI Rwy 18 & 36 opr consly.AIRPORT REMARKS: Attended 1400-2200Z. Hill obstruction lgts
460' (1124') 1 mile south and 410' (1074') 1/2 mile northwest.
No line of sight between rwy ends, acft not visible from one rwy end to other. Ldg fee for turbine acft waived with fuel purchase, ctc arpt for dtls.

AIRPORT MANAGER: 740-820-2700

WEATHER DATA SOURCES: AWOS-3 125.175 (740) 820-2500.

COMMUNICATIONS: CTAF/UNICOM 122.8

® HUNTINGTON APP/DEP CON 128.4

CLEARANCE DELIVERY PHONE: For CD ctc Huntington ATCT at
304-453-2490.

PUT IN BAY (3W2) 1 SW UTC-5(-4DT) N41°38.20' W82°49.70'

DETROIT

595 B NOTAM FILE CLE

RWY 03-21: H2870X75 (ASPH)

RWY 03: Thld dspld 450'. Trees. Rgt tfc.

RWY 21: Thld dspld 657'. Fence.

SERVICE: S4

AIRPORT REMARKS: Unattended. Acft ops prohibited dusk-dawn. Birds and other wildlife invof arpt. Decoy coyote near
movement areas. Exp mod turb on app/dep when wind exceeds 10 kts. Acft Indg Rwy 21 or dep Rwy 03 rnm 1000' clear
of Perry's Monument 352' (942') 1.3 NM NE of arpt. Prkg/ramp fees for all pvt or coml acft, all pilots are rqr'd to ck in
at arpt ofc at the time of arr; All acft rqr'd to shut down engine(s) when enplaning/deplaning pax.

AIRPORT MANAGER: 419-285-3371

COMMUNICATIONS: CTAF/UNICOM 122.8

CLEARANCE DELIVERY PHONE: For CD ctc Cleveland Apch at 216-352-2323.

HELIPORT REMARKS: Helipad is for touchdown, loading and lift off only—park on grass, west and SW of helipad.