

**HAGERSTOWN RGNL/RICHARD A HENSON FLD** (HGR)(KHGR) P (AR) 4 N UTC-5(-4DT)

WASHINGTON  
H-10H, 12I, L-29D, A  
IAP, AD

N39°42.51' W77°43.59'  
703 B ARFF Index—See Remarks NOTAM FILE HGR  
**RWY 09-27:** H7000X150 (ASPH-GRVD) S-100, D-150, 2S-175,  
2D-250 PCN 62 F/B/X/T HIRL 0.3% up E  
**RWY 09:** REIL. PAPI(P4L)—GA 3.0° TCH 55'.  
**RWY 27:** MALSR. PAPI(P4L)—GA 3.0° TCH 55'.  
**RWY 02-20:** H3165X100 (ASPH) S-80, D-100, 2S-127, 2D-170  
PCN 26 F/B/X/T MIRL 0.3% up N  
**RWY 02:** REIL. PAPI(P2L)—GA 4.0° TCH 53'.  
**RWY 20:** REIL. PAPI(P2L)—GA 4.0° TCH 33'.

**RUNWAY DECLARED DISTANCE INFORMATION**

**RWY 02:** TORA-3165 TODA-3165 ASDA-3165 LDA-3165  
**RWY 09:** TORA-7000 TODA-7000 ASDA-7000 LDA-7000  
**RWY 20:** TORA-3165 TODA-3165 ASDA-3165 LDA-3165  
**RWY 27:** TORA-7000 TODA-7000 ASDA-7000 LDA-7000

**SERVICE:** S4 FUEL 100LL, JET A OX 1, 2, 3, 4 LGT When ATCT clsd

ACTVT MALSR Rwy 27; REIL Rwy 09; HIRL Rwy  
09-27—CTAF. **MILITARY—FUEL A, A+** (Avbl 1000-0300Z†,  
C301-791-9119, OT 3 hr PN C301-730-4700/301-730-4100,  
fee \$100/hr.) (NC-100LL) OIL 0-128

**AIRPORT REMARKS:** Attended 1000-0300Z†. Airport unatnd  
0300-1000Z†. Birds on and invof arpt. Ultralight act 12 NM east to 5000' MSL. Low level mil acft 10 NM north on  
VR708 operating east to west. Fuel avbl 1000-0300Z†, call 301-791-9119. DOD contract fuel avbl. Rwy 02-20  
CLOSED when ATCT clsd. Class I, ARFF Index B. ARFF Index C avbl upon req; ctc amgr. PPR 24 hrs for unsked acr ops  
with more than 30 psgr seats call amgr 240-313-2764. Rwy 02-20 clsd to sked acr ops with more than 9 pax seats  
and non sked acr ops with more than 30 pax seats excp for taxi. Twy P not avbl for air carrier ops. Ldg fee.

**AIRPORT MANAGER:** 240-313-2764

**WEATHER DATA SOURCES:** ASOS 126.375 (301) 745-3497.

**COMMUNICATIONS:** CTAF 120.3 UNICOM 122.95

® POTOMAC APP/DEP CON 126.825

TOWER 120.3 (1200-0300Z†) GND CON 120.8

**CLEARANCE DELIVERY PHONE:** For CD when ATCT is clsd ctc Potomac Apch at 866-709-4993.

**AIRSPACE:** CLASS D svc 1200-0300Z†; other times CLASS E.

**RADIO AIDS TO NAVIGATION:** NOTAM FILE HGR.

(L) VORW 109.8 HGR N39°41.86' W77°51.34' 091° 6.0 NM to fld. 563/7W.

VOR unusable:

251°-280° byd 16 NM blo 4,000'

281°-300° byd 24 NM blo 8,000'


351°-050°

ST THOMAS (L) TACAN Chan 97 THS (115.0) N39°55.99' W77°57.06' 149° 17.0 NM to fld.

2338/7W. NOTAM FILE AOO.

ILS/DME 111.9 I-UYK Chan 56 Rwy 09. ILS unavbl when ATCT clsd.

ILS/DME 111.9 I-HGR Chan 56 Rwy 27. Class IE. OM/LOM OTS indef.

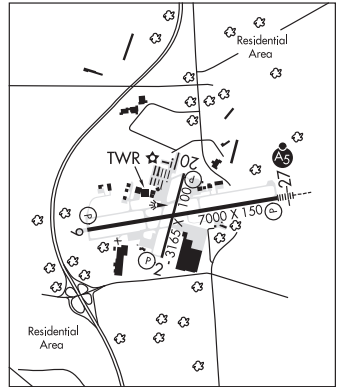

**HARFORD CO** (See CHURCHVILLE on page 95)

**HAVRE DE GRACE SPB** (MØ6) 1 E UTC-5(-4DT) N39°32.49' W76°04.18'

WASHINGTON

00 NOTAM FILE DCA

**WATERWAY E-W:** 8000X200 (WATER)

**WATERWAY E:** Bridge.

**WATERWAY N-S:** 8000X200 (WATER)

**WATERWAY S:** Bridge.

**SEAPLANE REMARKS:** Attended May-Nov dawn-dusk. Birds on and invof arpt. +100 ft bridge aprxly 3500 ft north of N/S rwy.

**AIRPORT MANAGER:** (410) 258-9648

**COMMUNICATIONS:** CTAF/UNICOM 123.0

**CLEARANCE DELIVERY PHONE:** For CD ctc Washington ARTCC at 703-771-3587.